I 29.88:EL 5/V.2/APP.D

Clemson University
3 1604 019 703 208

/app-D

existing condition survey
unit one buildings
volume 2
appendix D

PUBLIC DOCUMENTS
DEPOSITORY ITEM

FEB 22 1989

CLEMSON
LIBRARY

ELLIS ISLAND
STATUE OF LIBERTY

NATIONAL MONUMENT/NEW YORK-NEW JERSEY

Funds for preparation and printing of this document were provided by a donation from the Statue of Liberty/Ellis Island Foundation

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT

EXISTING CONDITION SURVEY
UNIT ONE BUILDINGS

Volume 2

Appendix D

Prepared by

Beyer Blinder Belle/
Anderson Notter Finegold

U.S. Department of the Interior / National Park Service

Existing Condition Survey

Acknowledgment

This document was prepared for the United States Government, National Park Service, Denver Service Center, preparatory to development of preservation plans for the main building and as part of the architectural/engineering technical services to the National Park Service.

The survey was conducted between August and September, 1984. Work was performed by the following staff members of Beyer Blinder Belle/Anderson Notter Finegold, Architects: John H. Stubbs developed the survey forms and methodology; Donna J. Carney conducted the survey and prepared the report; Allen Swerdlowe and team photographed the interiors and Bessie Ballantine, Michel Paillet, Francis Ihedoro , Donna J. Carney, Nancy Cooper, Naomi Ehrenpreis, Matthew Winkelstein and Mark Stankard executed the documentary drawings.

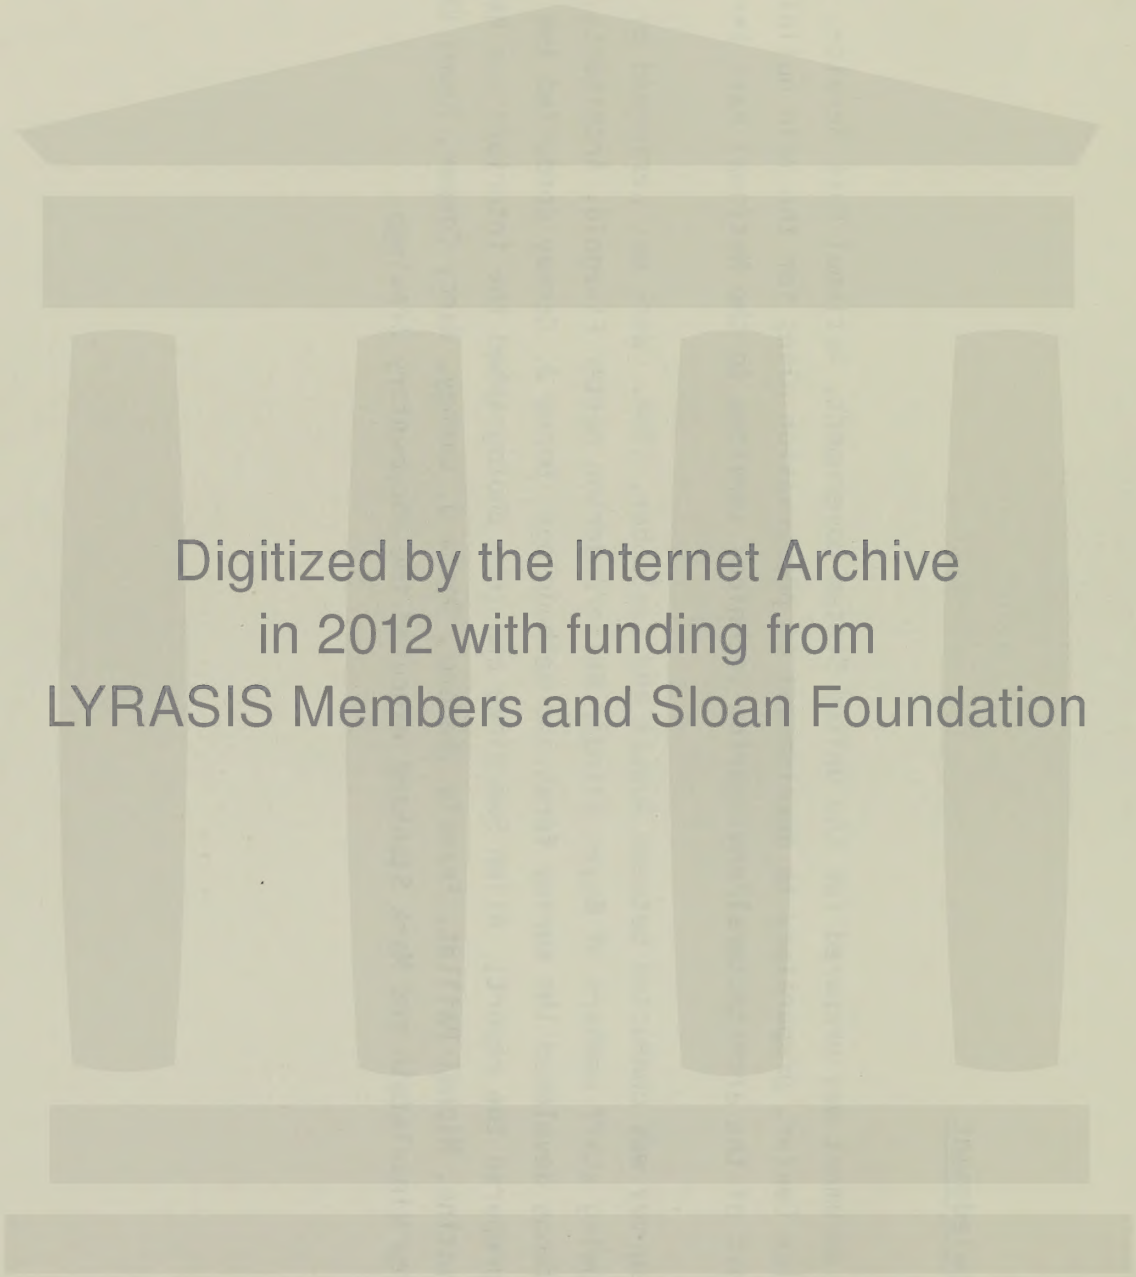

Digitized by the Internet Archive
in 2012 with funding from
LYRASIS Members and Sloan Foundation

http://archive.org/details/existingconditio00v2appd

HISTORIC STRUCTURES REPORT

TABLE OF CONTENTS

PAGE

I. Introduction.....1

II. Survey Methodology

A. Explanation of Forms.....2

B. Definition of Existing Condtions.....4

Floor - Tile.....5

Floor - Vinyl.....6

Floor - Linoleum.....7

Base - Wood.....8

Base - Tile/Tile Wainscot.....9

Walls & Ceilings - Plaster.....10

Walls & Ceilings - Gypsum Board/ Glazed Wood Partitions/Acoustic Panels.....11

Doors/Openings - Wood/Glass Paneled.....12

Doors/Openings - Wood Veneer.....13

Doors/Openings - Galvanized Metal.....14

Lighting Fixtures.....16-17

Heating/Ventilation/Plumbing.....18-21

C. Definitions of Architectural Significance.....22

Areas of Most Architectural Significance.....23
Areas of Some Architectural Significance.....24
Areas of Minor Architectural Significance.....25
Areas of Negligible Architectural Significance...26

III. Inventory & Plans Building

A. Kitchen & Laundry Building

1. Plans Depicting Existing Conditions
First Floor.....27
Second Floor.....28
2. Plans Depicting Architectural Significance
First Floor.....29
Second Floor.....30
3. Inventory
Basement.....31
First Floor.....32
Second Floor.....95

B. Baggage & Dormitory Building

1. Plans Depicting Existing Conditions
First Floor.....119
Second Floor.....120
Third Floor.....121

2. Plans Depicting Architectural Significance
First Floor.....122
Second Floor.....123
Third Floor.....124
3. Inventory
First Floor.....125
Second Floor.....199
Third Floor.....288

C. Bakery & Carpentry Building

1. Plans Depicting Existing Conditions
First Floor.....360
Second Floor.....361
2. Plans Depicting Architectural Significance
First Floor.....362
Second Floor.....363
3. Inventory
First Floor.....364
Second Floor.....372

D. Corridors & Covered Ways - Inventory Forms

1. Corridor 1.....393
2. Corridor 2.....398
3. Covered Way 3.....437
4. Covered Way 4.....440
5. Corridor 5.....444
6. Corridor 6.....471

E. Freestanding Structures - Inventory Forms

1. Incinerator.....475
2. Shelter.....479
3. Greenhouse.....483

INTRODUCTION

This survey provides a definitive record of existing conditions of all interior spaces of Unit One buildings on Ellis Island as of October 1984. In addition, each space has been evaluated for architectural significance. The survey has been used to assist in the preparation of the Historic Structures Report. Observations recorded in this study will also help to identify appropriate design parameters for alternative space utilization proposals.

The results of the survey have been plotted on graphically-coded floor plans that illustrate the relative condition and architectural significance of each space.

EXPLANATION OF FORMS

This interior architectural survey of Unit One buildings consists of a room-by-room analysis of all visually accessible finishes, decorative trim, doors, lighting, plumbing, and heating equipment. Nearly 200 survey forms were completed at the site. On these, the room number, last known use, square footage, ceiling height, and date of survey are recorded. The surface materials in each space are described and assessed for their existing condition and approximate date. A summary condition and date has been tabulated based on this information. In cases where sizable portions of the room are from different periods, more than one date has been given. Rooms are also evaluated for relative architectural significance within the building. Photographs of each room supplement the written description; however, in some instances photographic coverage was limited due to the accumulation of debris.

Room numbers were assigned by the surveyor in a roughly clockwise order and do not represent any historical numbering systems.

The definition of square footage used for calculations was the area of each room measured from the inside edge of the exterior and/or principal walls in each space, including both structural and non-structural interior walls.

Survey forms for each building are in numerical sequence for each floor and are followed by forms for the hallways (numbers preceded by an "H"). Forms for all interior stairs (numbers preceded by an "S") are located in the last section for each building.

References to directions have been simplified to relate to wall orientation. For example, the wall of the kitchen and laundry building facing the ferry slip will be referred to as the "south" wall, though the true compass direction is southwest. See drawing below for directional references.

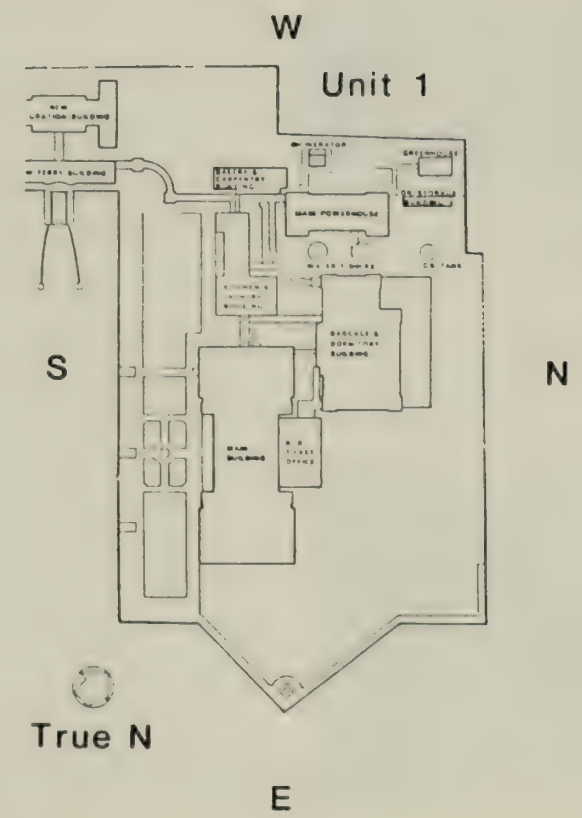

DEFINITIONS OF EXISTING CONDITIONS

The condition of each space has been evaluated according to criteria that were specifically developed for the main building on Ellis Island and adapted for all Unit One buildings. A range of conditions was defined for each material in the buildings following careful field inspection. The condition of a finish was evaluated relative to other similar finishes in all buildings using the standard terms "good", "fair", "poor", and "destroyed". Since these buildings have experienced extensive deterioration no surfaces or fixtures were considered to be in "excellent" condition. In borderline cases, the more deteriorated condition was selected. It has been noted where the survey of a room or parts of a room was made difficult or impossible by debris accumulation.

Following are definitions of the criteria that were used in the existing condition survey of Unit One buildings. Items are discussed in the order that they appear on the forms.

FLOOR
Tile

GOOD

85-100% intact. Very few, if any, cracks in tile. Minor discoloration. Retiling noticeable in places.

FAIR

60-85% intact. Some cracks in localized areas. Some tiles missing.

POOR

30-60% intact. Large cracks. Large areas missing.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

FLOOR
Vinyl

GOOD

85-100% intact. Squares in place, adhered to floor, not broken.

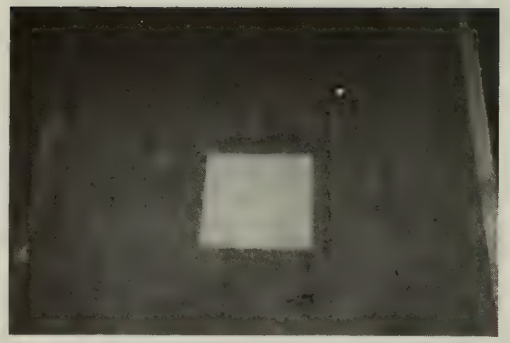

FAIR

60-85% intact. Some squares broken, some buckling, some adhesive failure. Sections of wood floor exposed.

POOR

30-60% intact. Significant number of squares are missing, broken, buckling, loose, no longer adhered.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

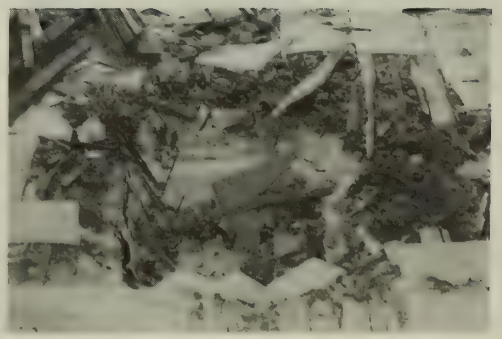

FLOOR
Linoleum

GOOD

85-100% intact. Little or no cracking or buckling. No material missing.

FAIR

60-85% intact. Some material missing. Cracked into sections. Some buckling.

POOR

30-60% intact. Significant amount of material missing. Extensive cracking, buckling, and spalling of material.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

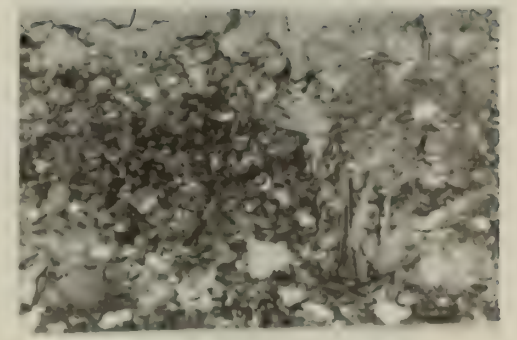

DEFINITIONS OF EXISTING CONDITIONS

The condition of each space has been evaluated according to criteria that were specifically developed for the main building on Ellis Island and adapted for all Unit One buildings. A range of conditions was defined for each material in the buildings following careful field inspection. The condition of a finish was evaluated relative to other similar finishes in all buildings using the standard terms "good", "fair", "poor", and "destroyed". Since these buildings have experienced extensive deterioration no surfaces or fixtures were considered to be in "excellent" condition. In borderline cases, the more deteriorated condition was selected. It has been noted where the survey of a room or parts of a room was made difficult or impossible by debris accumulation.

Following are definitions of the criteria that were used in the existing condition survey of Unit One buildings. Items are discussed in the order that they appear on the forms.

FLOOR
Tile

GOOD

85-100% intact. Very few, if any, cracks in tile. Minor discoloration. Retiling noticeable in places.

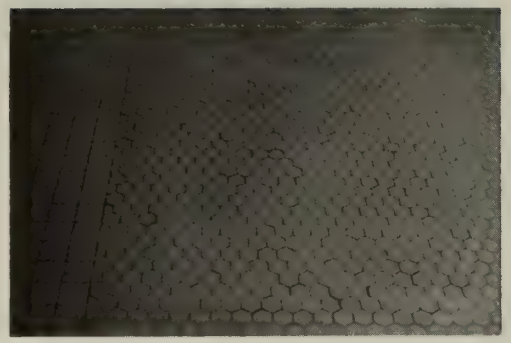

FAIR

60-85% intact. Some cracks in localized areas. Some tiles missing.

POOR

30-60% intact. Large cracks. Large areas missing.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

FLOOR
Vinyl

GOOD

85-100% intact. Squares in place, adhered to floor, not broken.

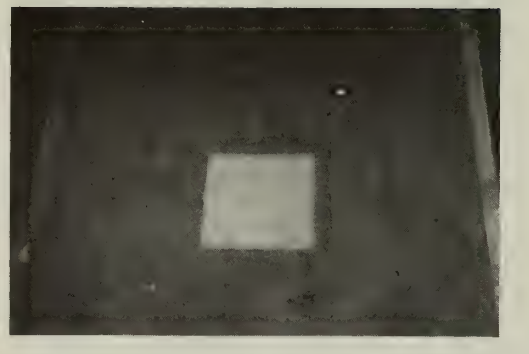

FAIR

60-85% intact. Some squares broken, some buckling, some adhesive failure. Sections of wood floor exposed.

POOR

30-60% intact. Significant number of squares are missing, broken, buckling, loose, no longer adhered.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

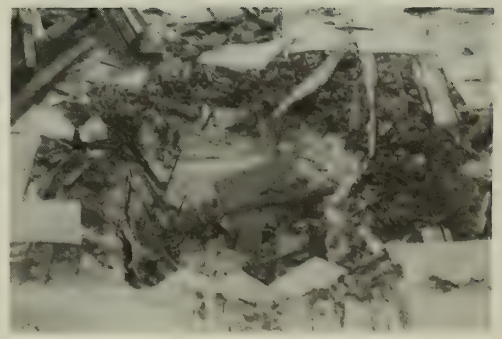

FLOOR
Linoleum

GOOD

85-100% intact. Little or no cracking or buckling. No material missing.

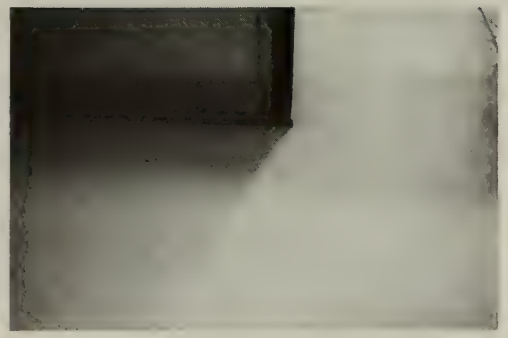

FAIR

60-85% intact. Some material missing. Cracked into sections. Some buckling.

POOR

30-60% intact. Significant amount of material missing. Extensive cracking, buckling, and spalling of material.

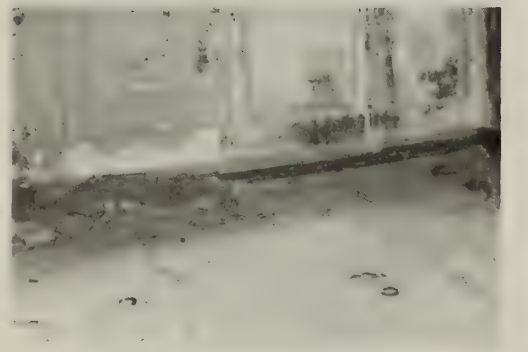

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

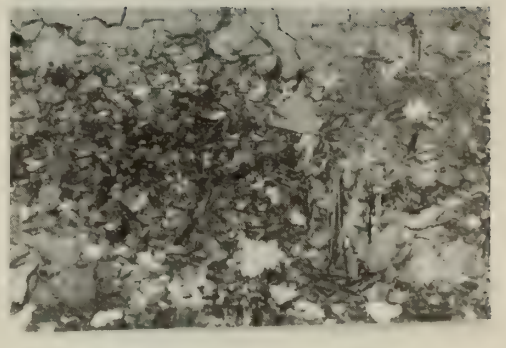

BASE
Wood

GOOD

90-100% intact. Still joined to wall. Minor deterioration of paint surface.

FAIR

75-90% intact. Separated from wall in limited areas. Some deterioration in localized areas (generally along window).

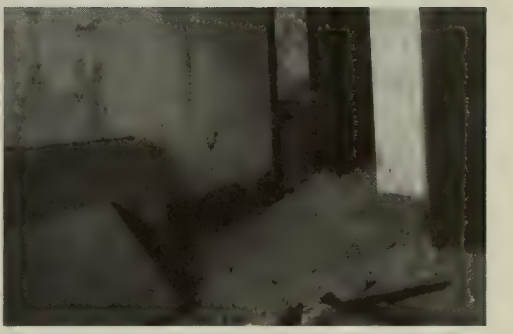

POOR

20-75% intact. Complete separation from wall. Serious deterioration (generally under windows).

DESTROYED

Material is completely missing or is destroyed beyond practical retrieval.

BASE
Tile / Tile Wainscot

GOOD

85-100% intact. Few or no cracks forming. Minimum number of tiles missing.

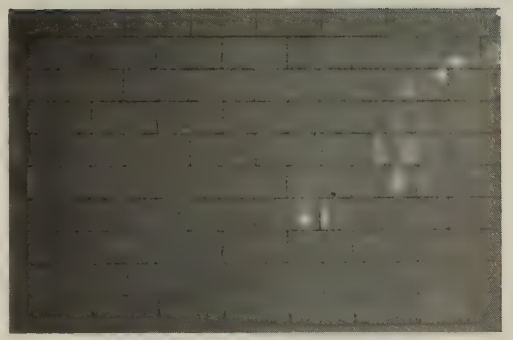

FAIR

60-85% intact. Some cracks in localized areas. Some tiles missing.

POOR

30-60% intact. Large areas missing, sizable cracks present.

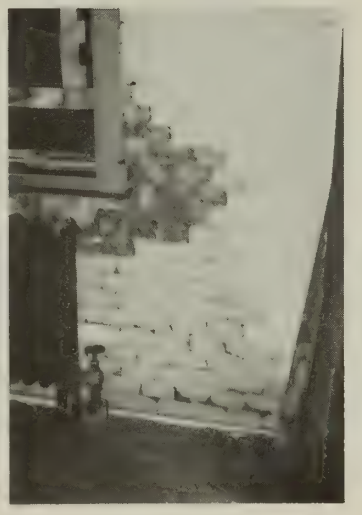

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

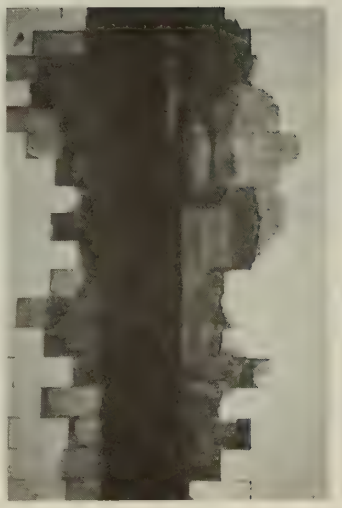

WALLS & CEILINGS
Plaster

GOOD

70-100% intact. Minor surface spalling, cracking and peeling of paint.

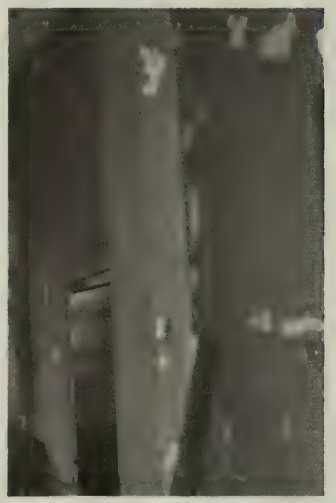

FAIR

50-70% intact. Substantial surface spalling, cracking and peeling of paint. Unit masonry and/or basecoat exposed in certain areas.

POOR

20-50% intact. Majority of plaster is severely cracked with buckling and spalling. Exposure of significant areas of base surface.

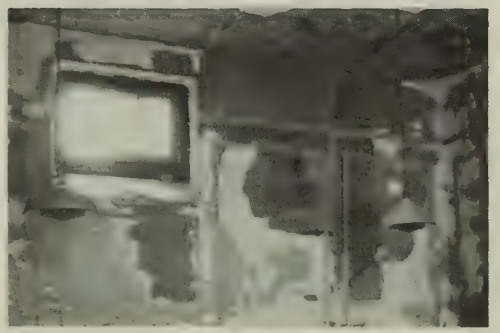

DESTROYED

0-20% intact. Material is completely missing or is destroyed beyond practical retrieval.

WALLS & CEILINGS
Glazed Wood Partitions / Gypsum Board / Acoustic Panels

GOOD

85-100% intact. Minor surface damage including scrapes, knicks and peeling of paint.

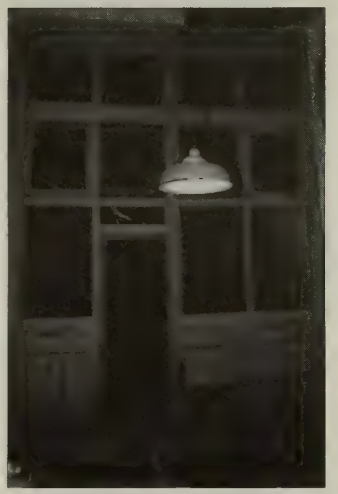

FAIR

50-70% intact. Small holes and cracks. Some missing material. Glass missing.

POOR

20-50% intact. Large holes and cracks. Major amount of missing material.

DESTROYED

0-20% intact. Material is completely missing or is destroyed beyond practical retrieval.

DOORS / OPENINGS
Wood / Glass Panelled

GOOD

Wood, glass, and hardware intact. Minor peeling of paint. Minor surface knicks and scrapes.

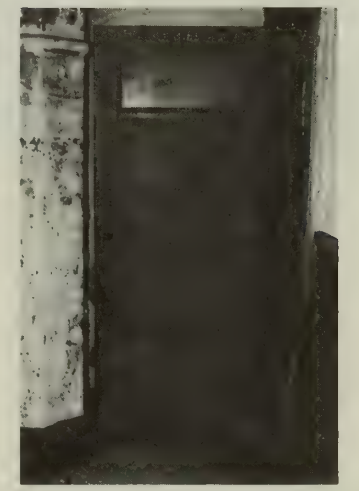

FAIR

Hardware intact, part may be missing. Minor warping of doors. Deteriorated paint finish and/or surface damage.

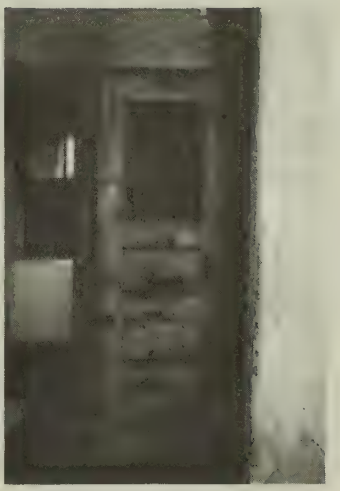

POOR

Severe wood damage, i.e., splitting and missing elements. Glass broken or missing. Extensive deterioration.

DESTROYED

Door is missing or is destroyed beyond practical retrieval.

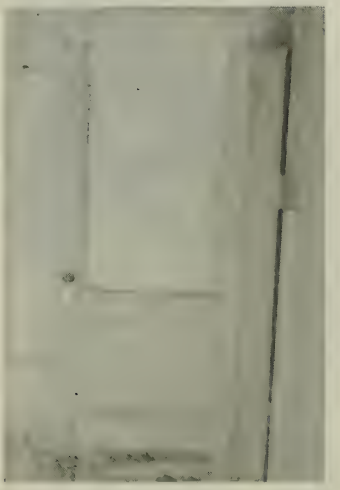

DOORS / OPENINGS
Wood Veneer

GOOD

Wood and hardware intact, no splitting.

FAIR

Minor splitting and/or delamination. Finish and hardware may have minor deterioration.

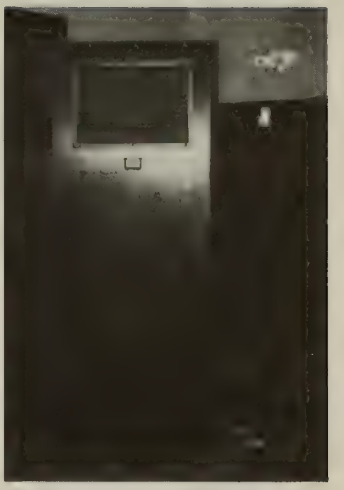

POOR

Hardware missing. Severe splitting and/or delamination.

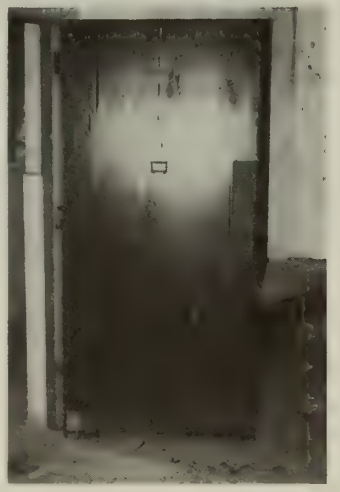

DESTROYED

Door is missing or is destroyed beyond practical retrieval.

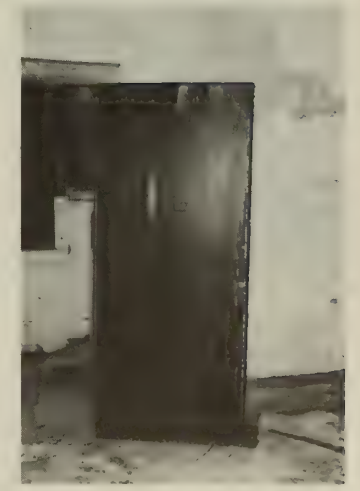

DOORS / OPENINGS
Galvanized Metal

GOOD

Minor peeling of paint finish. Hardware intact.

FAIR

Deteriorated paint finish. Small dents to surface. Hardware may have minor damage.

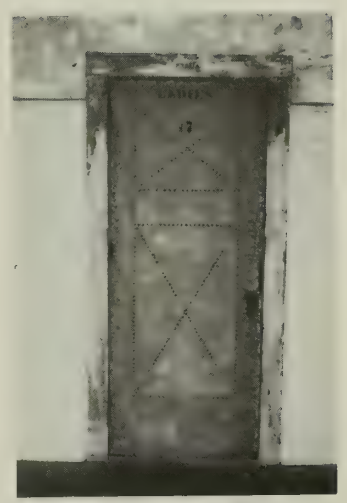

POOR

Deteriorated paint finish. Severe corrosion to surface. Bad dents. Hardware badly damaged or missing.

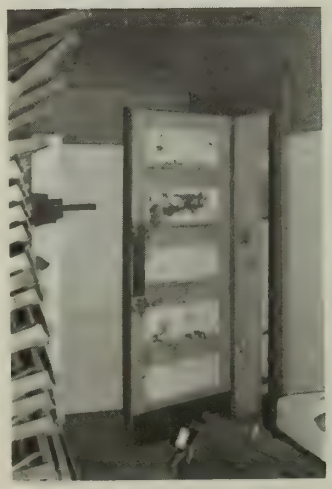

DESTROYED

Door is missing or is destroyed beyond practical retrieval.

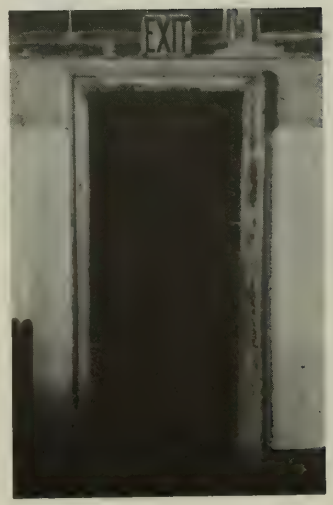

LIGHTING:	☐	Incandescent/Type A	☐	Intact	☐	Destroyed
	☐	Incandescent/Type B	☐	Intact	☐	Destroyed
	☐	Incandescent/Type C	☐	Intact	☐	Destroyed
	☐	Other:	☐	Intact	☐	Destroyed

The evaluation of lighting fixtures is based on physical appearance only and does not consider whether the fixture still functions. Fixtures are considered "intact" if the shade and mount are in place. A fixture may be given an "intact" designation with or without its lamp, or bulb. A fixture is designated "destroyed" if it is damaged beyond practical retrieval or is missing.

Lighting fixture types consist of suspended glass globes, Type A, and ceiling mounted or suspended "RLM"-type incandescent fixtures, Type B. "RLM" refers to a type of flared metal enamel shade, commonly used in industrial installations. Type C consists of miscellaneous secondary fixtures used for task, safety, or exit lighting. Another light source is referred to as "CML" (ceiling mounted lamp) on survey forms. These fixtures consist of ceiling-mounted bare lamps in porcelain sockets and metal housing or lamps mounted to a ceiling conduit.

TYPE A: glass globes

TYPE B: "RLM" metal shade fixtures

TYPE C: directional shade and cone-shaped counter shade

OTHER: "CML"- ceiling-mounted lamps, with metal housing and conduit mount

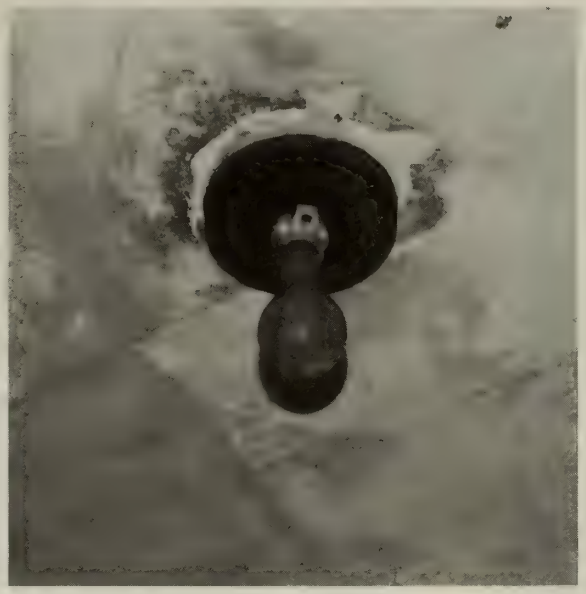

HEATING/ VENTILATION PLUMBING:	☐	Radiators	☐	Intact	☐	Destroyed
	☐	Vents/Fans	☐	Intact	☐	Destroyed
	☐	Sink/Toilet/Urinal	☐	Intact	☐	Destroyed
	☐	Other:	☐	Intact	☐	Destroyed

Evaluation of heating, ventilation and plumbing fixtures is based on external appearance only and does not consider whether the fixture is still functioning. If a fixture is not "intact", it has been damaged beyond practical retrieval or is missing and is designated "destroyed"

The following photographs illustrate typical fixture types referred to in the survey form "notes".

RADIATOR: sectional floor type

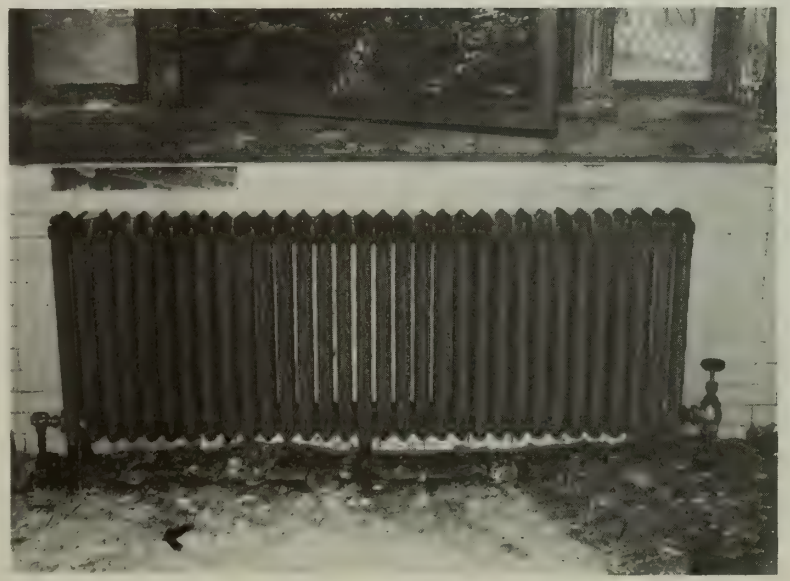

RADIATOR: sectional wall-mounted type

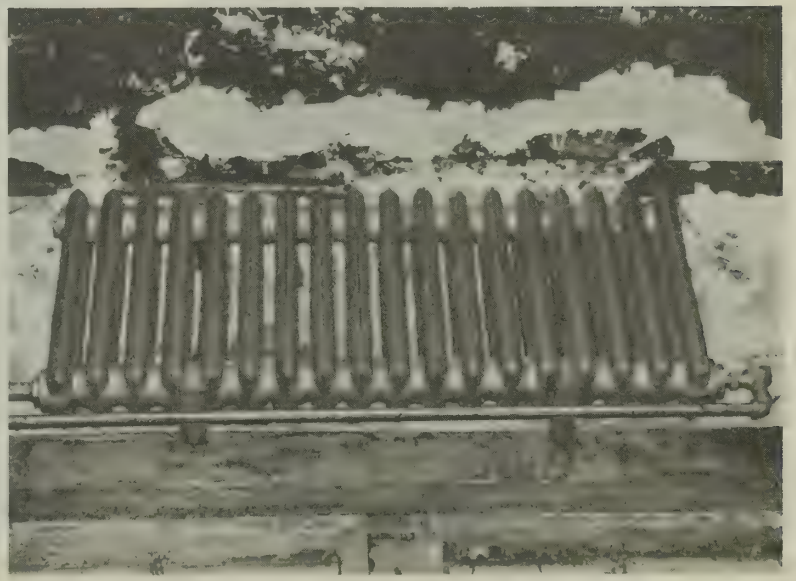

RADIATOR: parallel pipe cluster, ceiling-suspended

FAN: wall-mounted rotary

FAN: window fan

VENT: ceiling grille to fan house

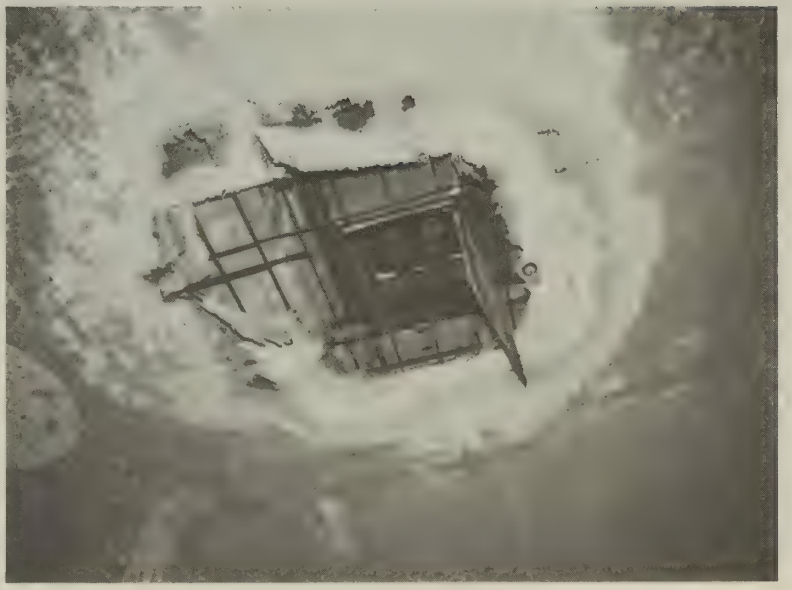

PLUMBING: porcelain rounded pedestal wall sinks (c. 1920's)

PLUMBING: free-standing metal supported sinks and water fountain

PLUMBING: slop sinks

PLUMBING: wall-mounted type urinal (c. 1940)

PLUMBING: floor-type urinal

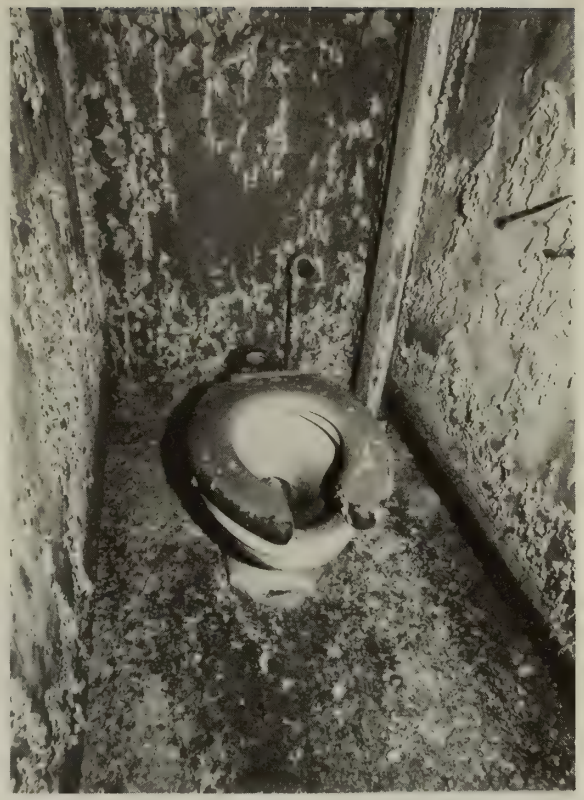

PLUMBING: toilet

PLUMBING: shower stall with galvanized metal partitions

DEFINITIONS OF ARCHITECTURAL SIGNIFICANCE

A range of significance for spaces within the unit one buildings was developed for existing architectural spaces in the structure. The ranking of spaces for architectural significance is relative to the specific architectural context of each building. Certain factors were considered in evaluating the spaces:

- Volume, size, monumentality, proportions
- Quality of materials and workmanship
- Overall design
- Uniqueness of the design, rare features

In borderline cases, the higher level of significance was selected.

Following is a brief discussion of the criteria:

MOST ARCHITECTURAL SIGNIFICANCE

The classification of "Most Architectural Significance" was assigned to spaces that have great architectural character. Such spaces may exhibit monumental proportions and their design, materials, and workmanship are of a high quality. They are often unique volumes. An example is room 112 of the baggage and dormitory building. It is unique as the building's only central space with its large volume punctuated by five skylights.

SOME ARCHITECTURAL SIGNIFICANCE

The classification of "Some Architectural Significance" was assigned to spaces that have a moderate amount of architectural character. Volume, size, monumentality, and proportions may distinguish them from the more common and generally smaller spaces in the building. Careful attention was given to the use of materials and the execution of details. An example is room 125 of the baggage and dormitory building. The space is part of a large recreation porch with high ceiling, round cast-iron columns, window wall,and incorporates the original north exterior wall.

MINOR ARCHITECTURAL SIGNIFICANCE

The classification of "Minor Architectural Significance" was assigned to spaces that exhibit few architectural pretensions. Materials and workmanship are standard. Volume and proportions are relatively undistinguished. Rooms are common for their type. An example is room 206, a small dormitory room on the west side of the baggage and dormitory building with painted plaster walls and ceiling surfaces, tile floor and tile wainscot.

NEGLIGIBLE ARCHITECTURAL SIGNIFICANCE

The classification, "Negligible Architectural Significance" was assigned to spaces that have no architectural character. They are often very small and of standard materials and design. An example is room 226A, a small lavatory on the second floor of the baggage and dormitory building.

KITCHEN & LAUNDRY BUILDING

Exhibit 33

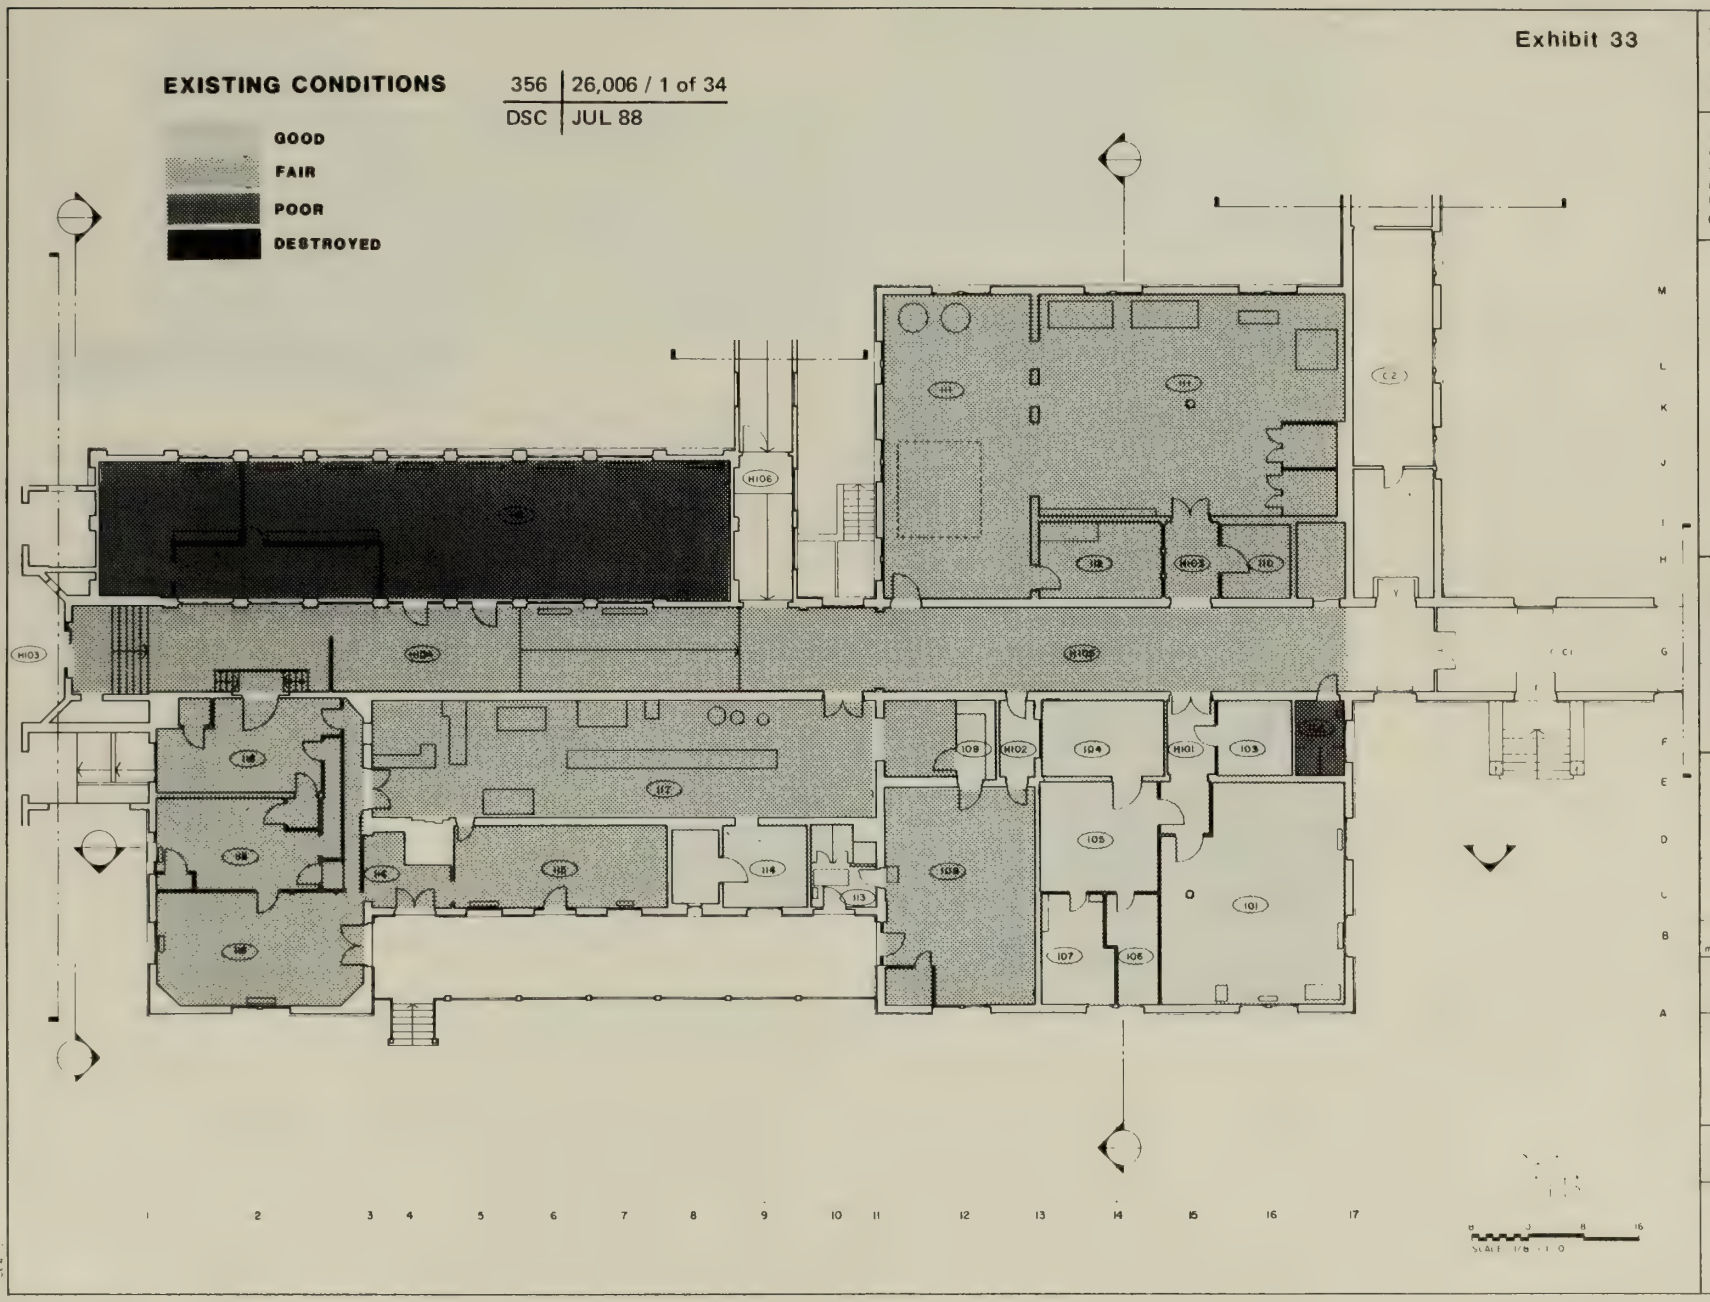
EXISTING CONDITIONS
356 | 26,006 / 1 of 34
DSC | JUL 88
GOOD
FAIR
POOR
DESTROYED
UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER
ARCHITECTS
BEYER BLINDER BELLE / ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960
SURVEY OF STRUCTURES
UNIT ONE
ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY
REVISIONS
DESIGNED
DATE
DRAWN
TECH REVIEW
KEY PLAN
TITLE OF SHEET
KITCHEN & LAUNDRY
FIRST FLOOR PLAN
SUB SHEET NO
DRAWING NO
PKG NO
SHEET
OF

Exhibit 34

EXISTING CONDITIONS

356 | 26,006 / 2 of 34
DSC | JUL 88

GOOD
FAIR
POOR
DESTROYED

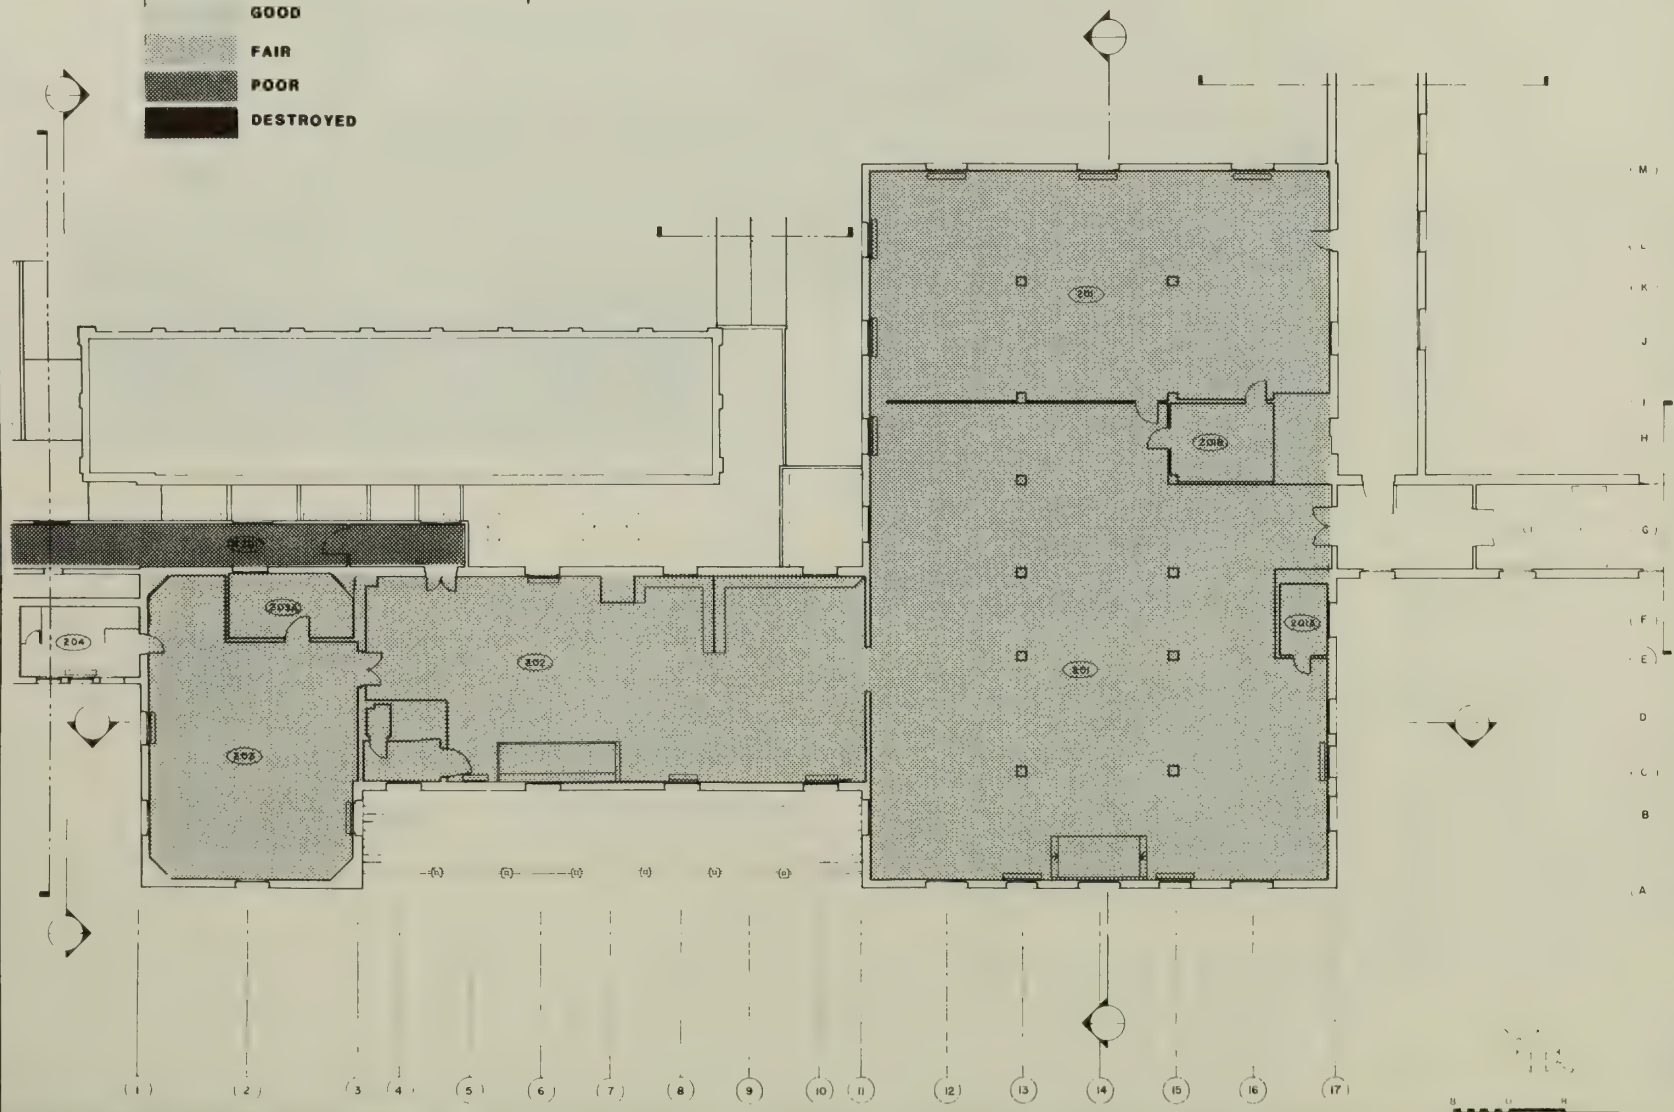

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk sht REVISIONS date

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
KITCHEN & LAUNDRY
SECOND FLOOR PLAN

SUB SHEET NO | DRAWING NO

Exhibit 35

ARCHITECTURAL SIGNIFICANCE

356	26,006 / 3 of 34
DSC	JUL 88

MOST
SOME
MINOR
NEGLIGIBLE

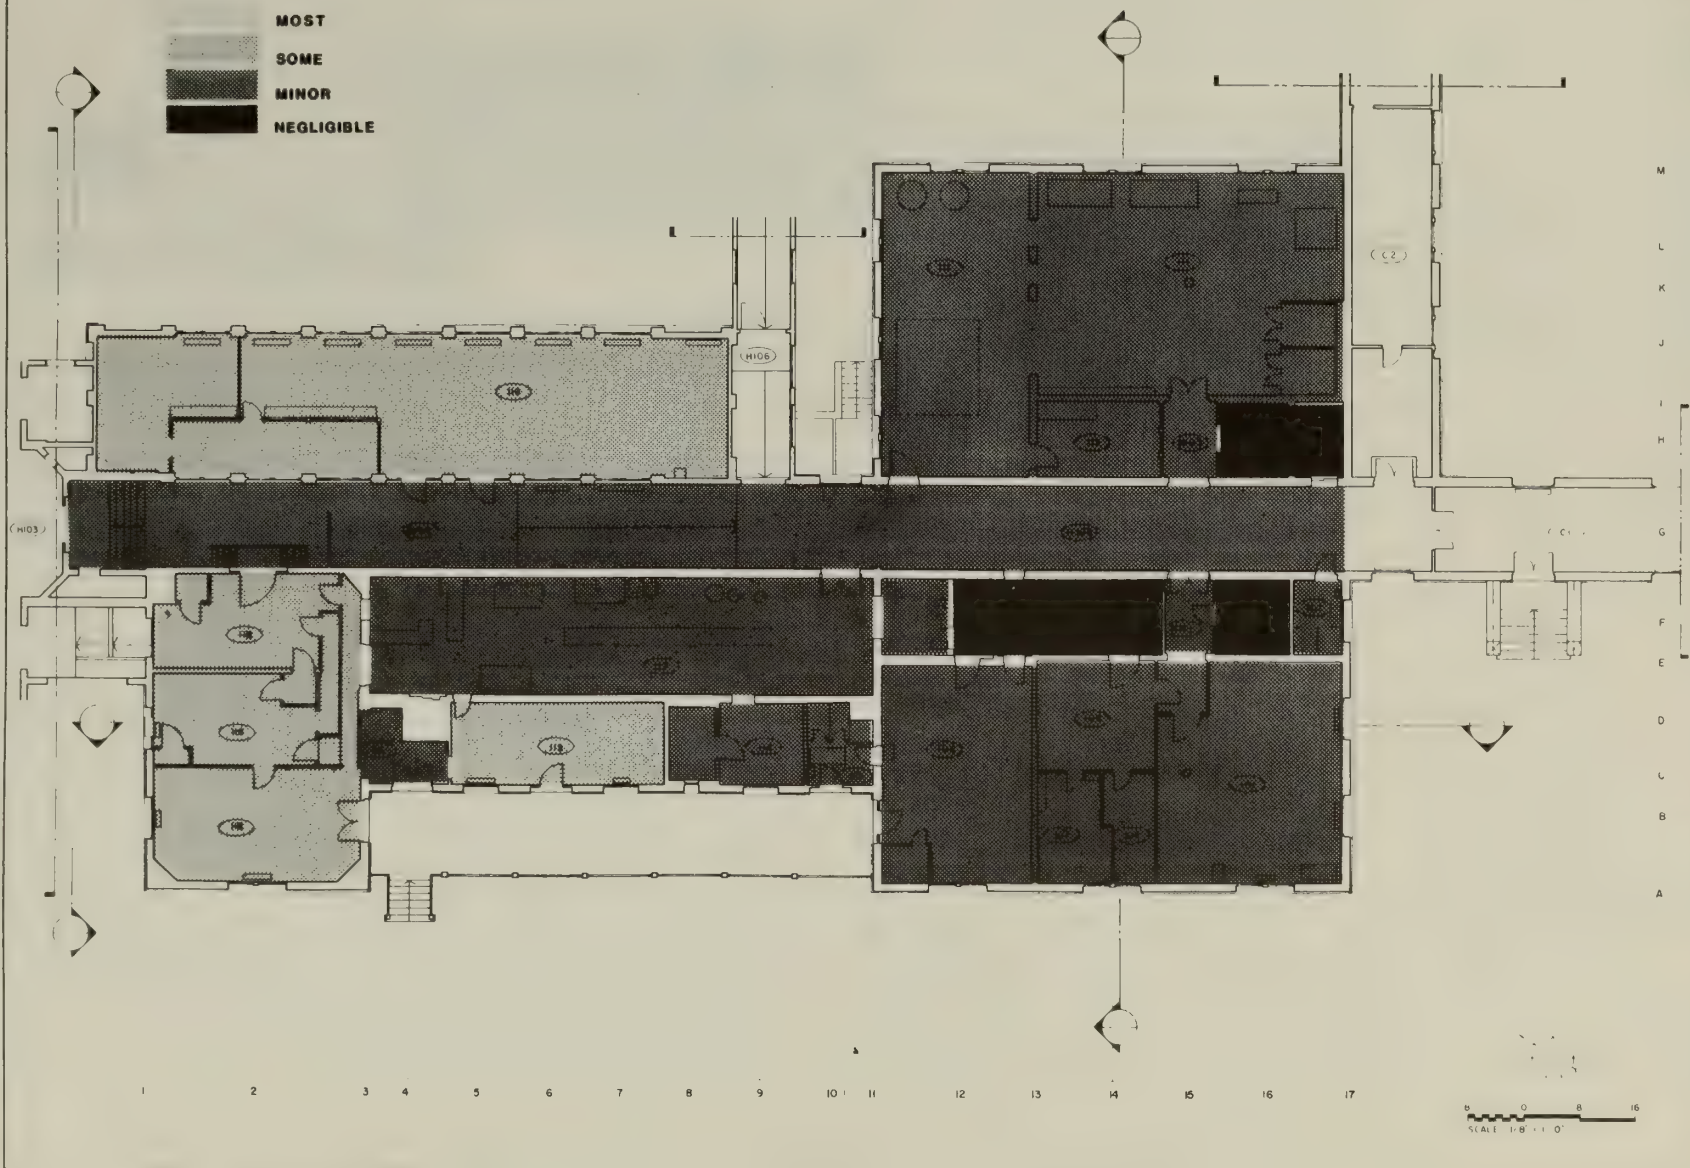

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk sht REVISIONS date rev

DESIGNED	DATE
DRAWN	TECH REVIEW

KEY PLAN

TITLE OF SHEET
KITCHEN & LAUNDRY FIRST FLOOR PLAN

SUB SHEET NO	DRAWING NO
	PKG NO / SHEET

Exhibit 36

ARCHITECTURAL SIGNIFICANCE

356 | 26,006 / 4 of 34
DSC | JUL 88

MOST
SOME
MINOR
NEGLIGIBLE

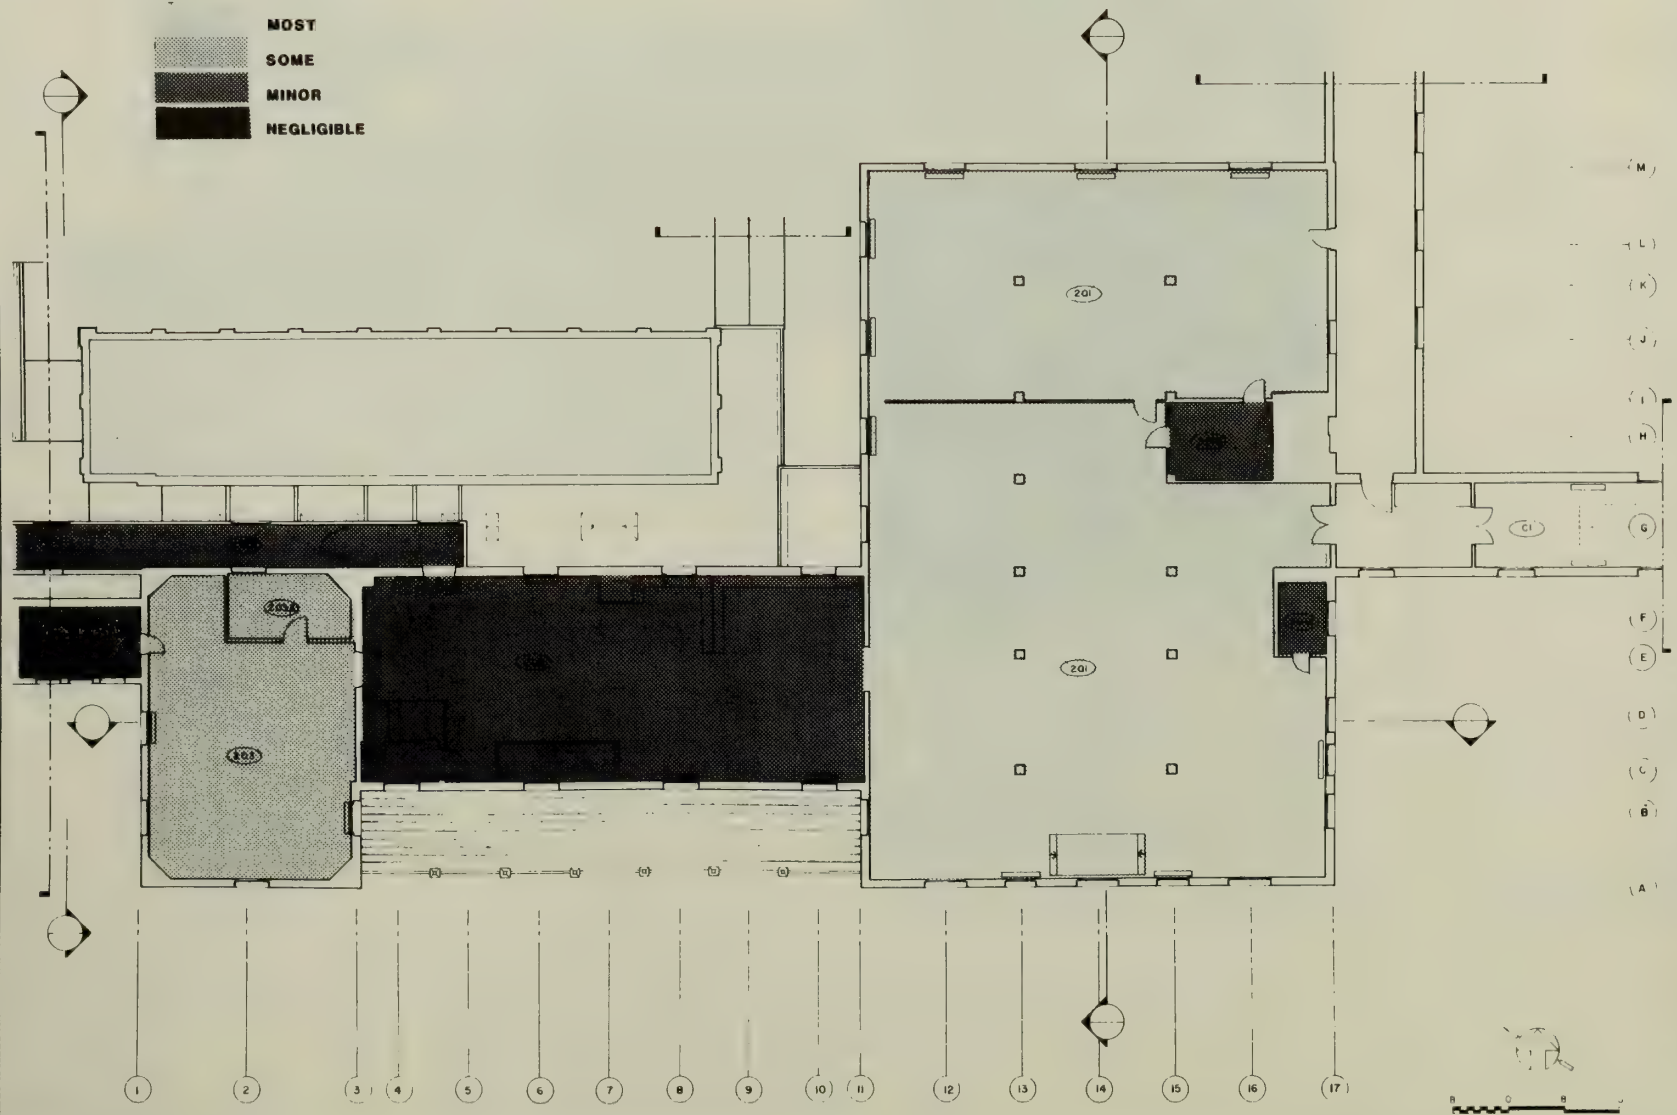

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk shi REVISIONS date and

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
KITCHEN & LAUNDRY SECOND FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET OF

356 | 26,006 / 5 of 34
DSC | JUL 88

Exhibit 12

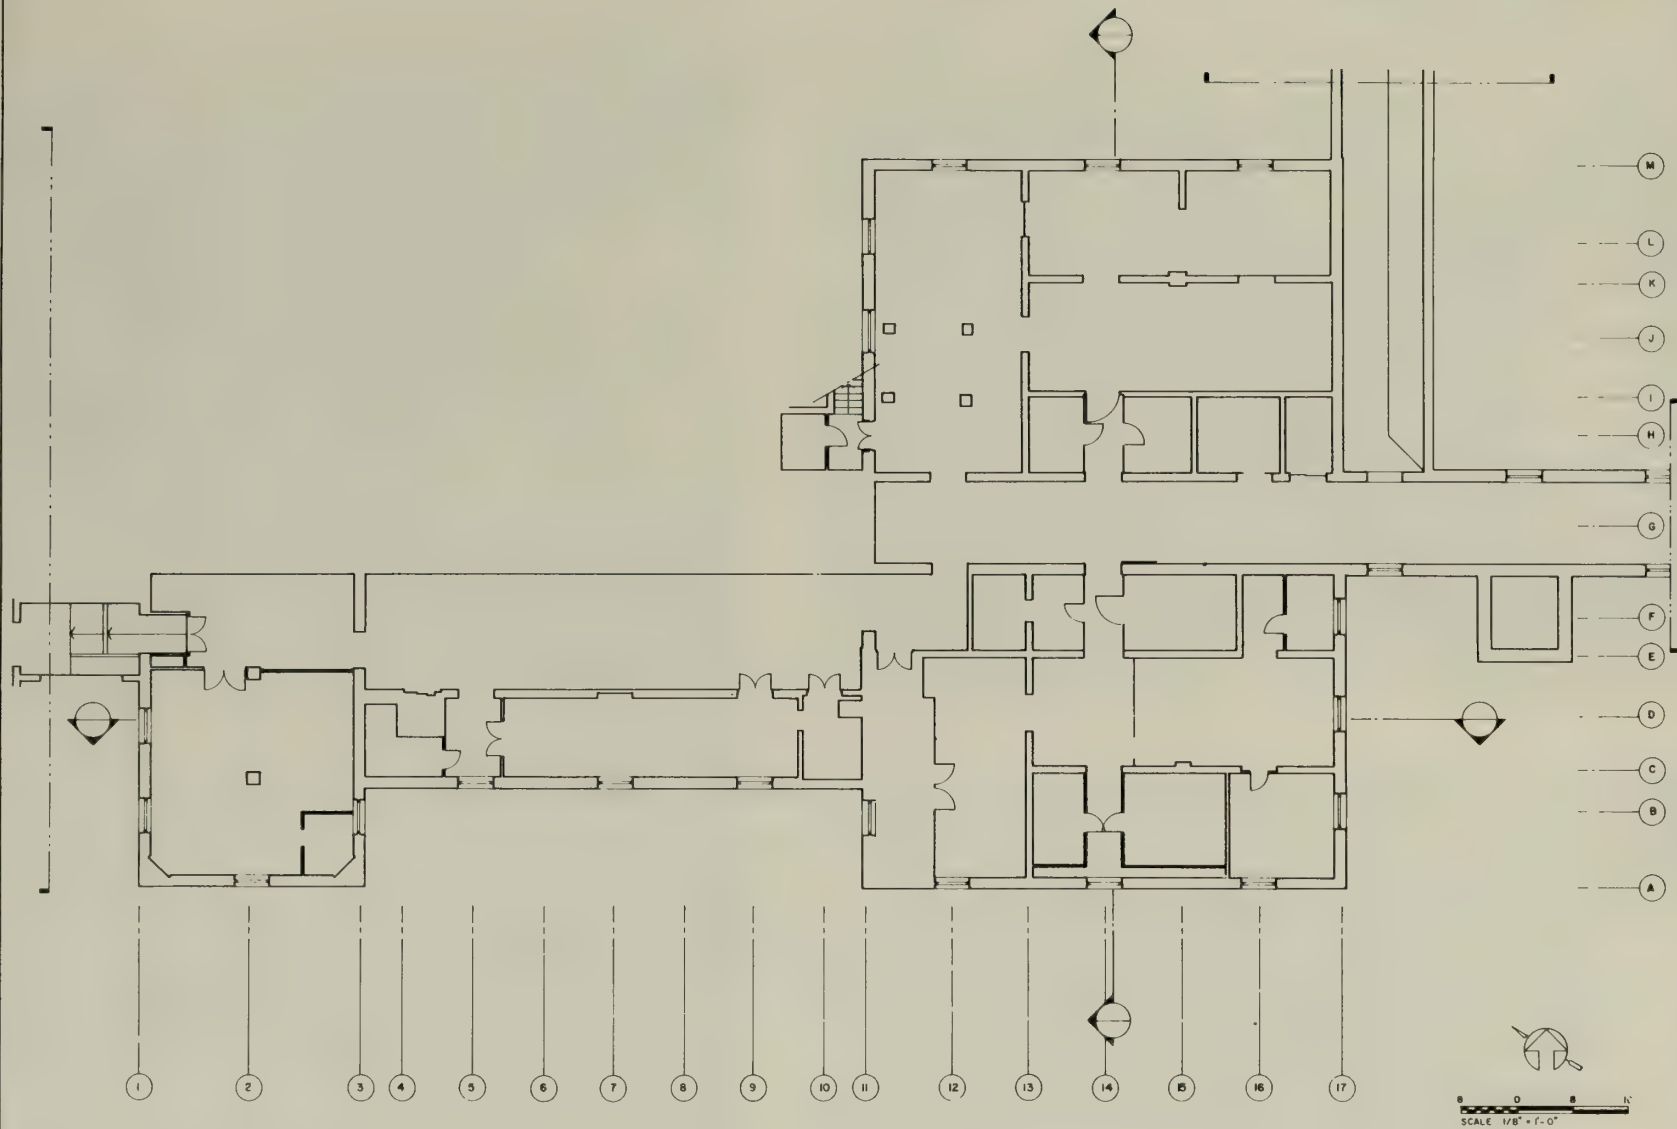

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk. dsn REVISIONS date

DESIGNED DATE

DRAWN TECH REVIEW

KEY PLAN



TITLE OF SHEET
KITCHEN & LAUNDRY
BASEMENT PLAN

SUB SHEET NO. DRAWING NO.

PKG NO. SHEET

OF

ROOM NO: - LAST KNOWN USE: BASEMENT SQUARE FEET: CEILING HEIGHT: DATE: 9/11/84

Description:

The basement has concrete flooring, rubble stone and brick walls and a white-washed terra-cotta block low ceiling. A series of mechanical pipes from the power-house are suspended from the ceiling and from the north wall. The space is divided into rooms with a connecting corridor. The eastern section of rooms originally housed refrigeration and ice storage. Access from the west is via a ramped enclosure branching off covered way 5. This passage has been temporarily enclosed with a plywood ceiling and gypsum board south wall. The corridor continues to the east into the basements of corridor 1 and the main building. Lighting consists of ceiling mounted bulbs on conduit and ceiling mounted fluorescent troughs.

Condition:

Concrete flooring appears to be in generally good condition. Whitewash on some areas of walls and ceiling have flaked off. The walls appear to be damp along the base with some brick efflorescence and mortar deterioration.

SUMMARY:						ARCHITECTURAL SIGNIFICANCE:	
		[X]	Good	[X]	1900-1907		Most
		[ ]	Fair	[ ]	1908-1923		Some
		[ ]	Poor	[ ]	1924-1938	[X]	Minor
		[ ]	Destroyed	[ ]	1939-Present	[ ]	Negligible

PHOTOGRAPHS:

ROOM NO. BASEMENT

ENTRY - VIEW E.

CORRIDOR - VIEW E.

S.W. CORNER ROOM. - VIEW S.

CORRIDOR - VIEW E.

PHOTOGRAPHS:

ROOM NO. BASEMENT

CORRIDOR - VIEW E.

356 | 26,006 / 6 of 34
DSC | JUL 88

Exhibit 13

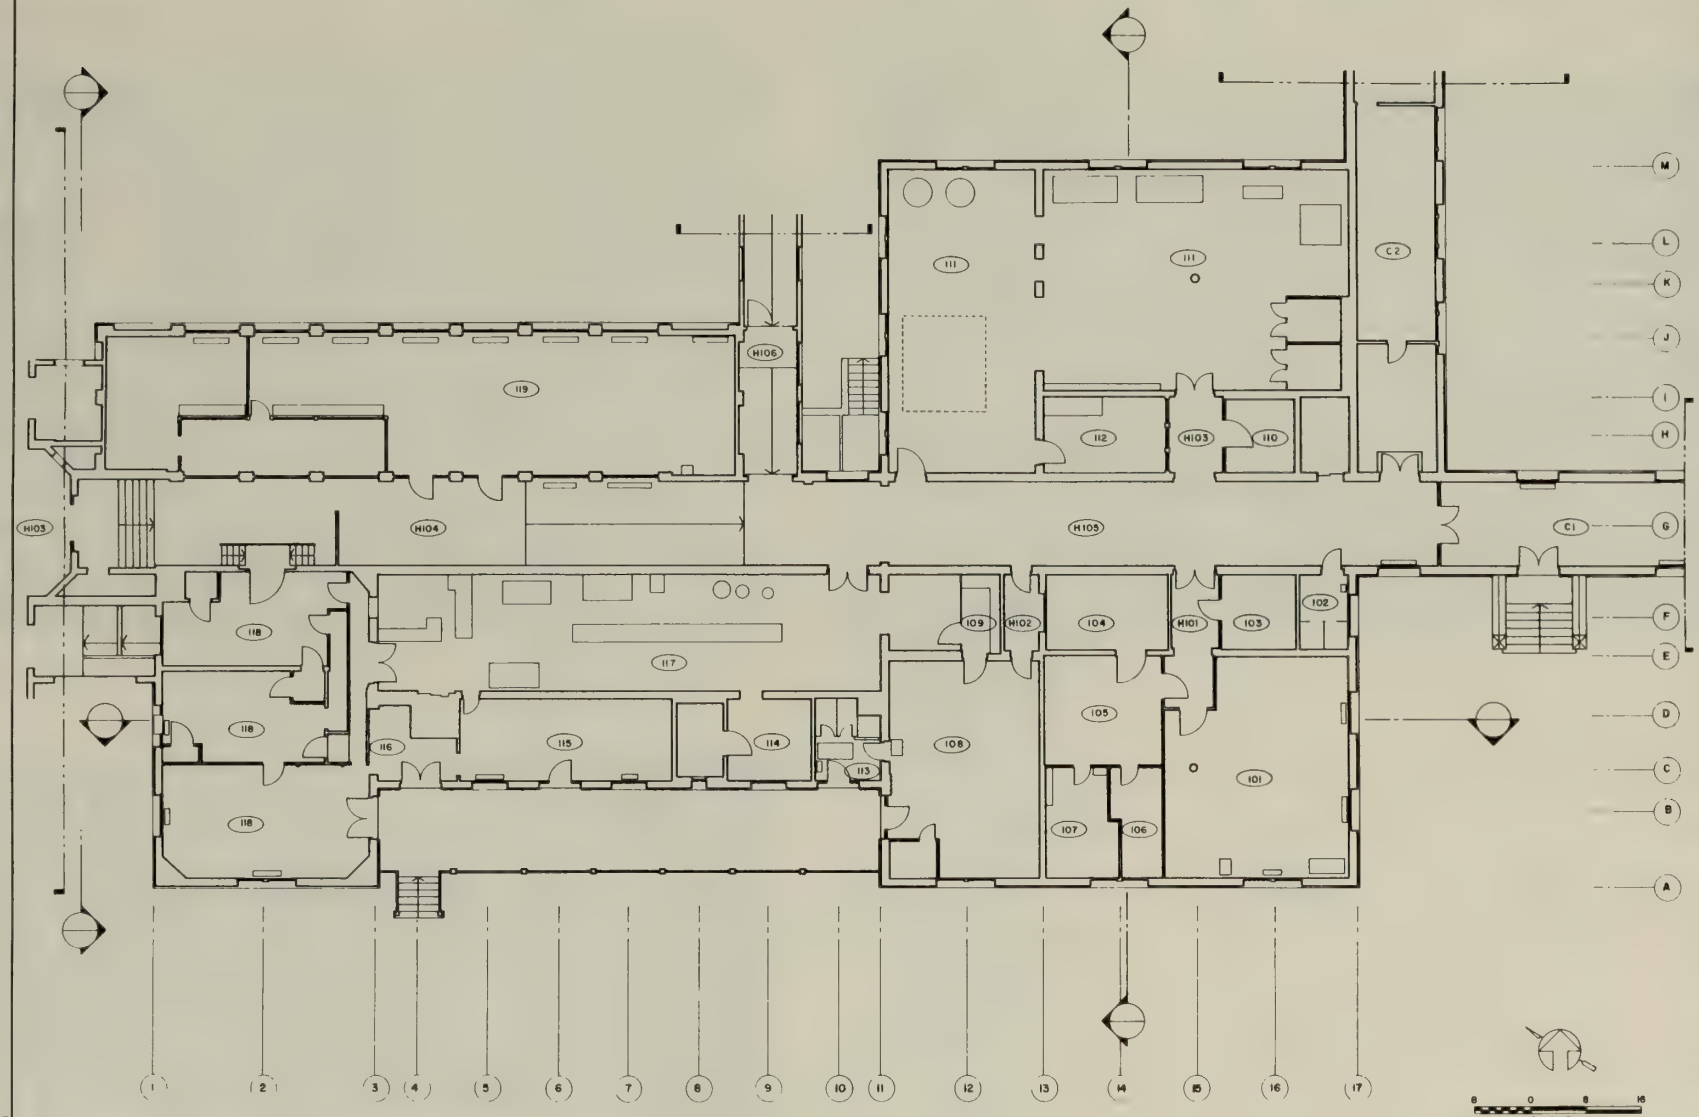

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3660

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | a/n | REVISIONS | date | by

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
KITCHEN & LAUNDRY FIRST FLOOR PLAN

SUB SHEET NO | DRAWING NO
PKG NO | SHEET OF

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 36

ROOM NO: 101 LAST KNOWN USE: N.P.S. MAINTENANCE SQUARE FEET: 769. CEILING HEIGHT: 15'-5" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	SCORED & PAINTED CRACK - E TO W.
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	CONCRETE COVE
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions WOOD ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	CRACK - N. WALL PART. - W. + N.W.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	PLY
LIGHTING:	☐ Incandescent/Type A ☐ Intact ☐ Destroyed ☒ Incandescent/Type B 6 Intact ☐ Destroyed ☐ Incandescent/Type C ☐ Intact ☐ Destroyed ☒ Other: ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	WHITE ENAMEL FINISH - RLM 2 FLUORESCENT TROUGH
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Intact ☐ Destroyed ☐ Vents/Fans ☐ Intact ☐ Destroyed ☐ Sink/Toilet/Urinal ☐ Intact ☐ Destroyed ☐ Other: ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NO
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	S. WALL - ALUM. DUCT THROUGH WINDOW ARCH
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 101

VIEW N.E.

VIEW S.W.

VIEW S.E.

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 38

ROOM NO: 102 LAST KNOWN USE: TOILET SQUARE FEET: 74. CEILING HEIGHT: 15'5" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	WHITE HEX.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	7' E - MISSING SOME S. - CHIPPING, REPL. TILES
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions G.M. [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	2 TOILET PARTITIONS NE - EXPOSED T.C. HALF N. & S. - BULGING " N. - DESTROYED
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	HOLE - NE CORNER MOST FINISH COAT DESTROYED
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	5 PANEL WOOD NO HARDWARE, WORN
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	CHAIN
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [X] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [X] 1924-1938 ? [ ] 1939-Present	E. WALL - 5 FIN SINK MISSING, 2 TOILET, 2 URINAL - WALL TYPE
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 102

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 40

ROOM NO: 103 LAST KNOWN USE: SUPPLY CL. SQUARE FEET: 114. CEILING HEIGHT: 18'-8" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	CONCRETE COVE
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	PP TRANSOMS - N & S
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	PP
DOORS/ OPENINGS:	☒ Wood/~~Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☒ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	SLIDING FREIGHT DOOR ON TRACK SOLID WOOD (W.)
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	C.M.L. - 1
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	WALL SHELVES, N.E.S.
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS: NOT AVAILABLE

ROOM NO.

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 42

ROOM NO: 104 LAST KNOWN USE: SUPPLY CLOSET SQUARE FEET: 186. CEILING HEIGHT: 18'-8" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	SLOPED
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	CEMENT PLASTER
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	PLYWOOD
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	CHAIN -
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	2 - LONG - SLOP SINKS W/ BASIN 1930's
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: NOT AVAILABLE

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 44

ROOM NO: 105 LAST KNOWN USE: STORAGE N.P.S. SQUARE FEET: 260. CEILING HEIGHT: 8'-0" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	SCORED
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	—
WALLS:	☐ Plaster ☐ Gypsum Board ☒ Partitions PLY ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other PLY	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	2 HOLLOWCORE - S. 1 PLY - N. TO RM. 109
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed 2 Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	2 FLUOR. TROUGH- CEILING MT.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	CABINETS — W & N
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 105

VIEW S.W.

VIEW N.W.

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 46

ROOM NO: 106 LAST KNOWN USE: N.P.S. OFFICE SQUARE FEET: 104. CEILING HEIGHT: 7'-11" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	4"
WALLS:	☒ Plaster S. ☐ Gypsum Board ☐ Partitions ☒ Other: PLY	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 S. ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other PLY	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	N. - HOLLOW CORE
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	FLUOR. TROUGH - CEILING MT.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 106

VIEW S.

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 43

ROOM NO: 107 LAST KNOWN USE: N.P.S. OFFICE SQUARE FEET: 148. CEILING HEIGHT: 7'-10" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	4"
WALLS:	[X] Plaster S [ ] Gypsum Board [ ] Partitions [X] Other: PLY	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 S. [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other PLY	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	HOLLOW CORE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CEILING MT. FLUORES. TROUGH
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 107

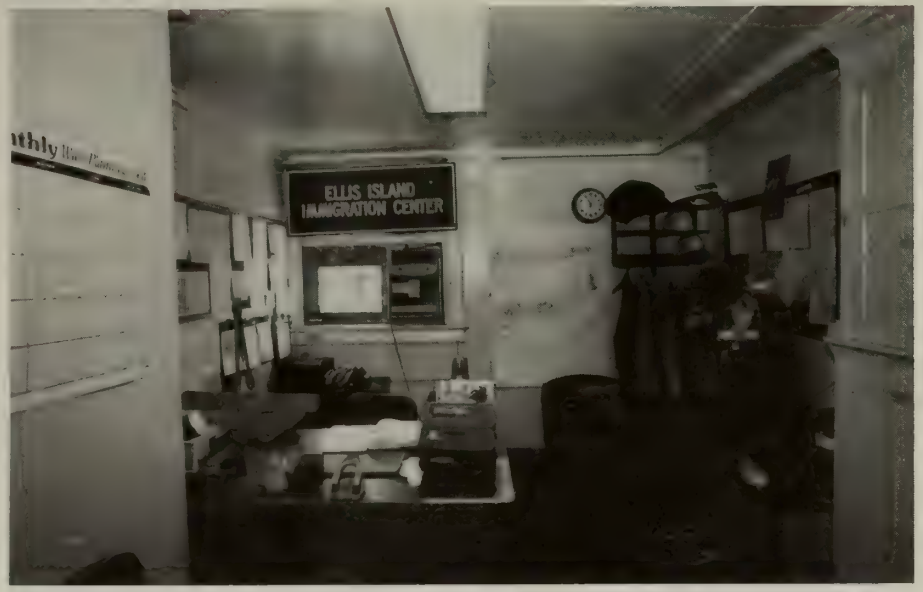

VIEW S.

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 50

ROOM NO: 108 LAST KNOWN USE: D.S.C. OFFICE SQUARE FEET: 664. CEILING HEIGHT: 15'-6" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	GREEN/GRAY SQUARES
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	8½"
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions WD. ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	WD. CHAIRRAIL - 3'-5" SW CORNER - EXPOSED T.C. S.W. - 2 PARTITION WALLS W/ DOOR OF PLY. PANELING
CEILING:	☐ Plaster ☒ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	SW CORNER - MISSING PANELS EXPOSED T.C.
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	W. - WIREGLASS PANE N. - 4 WOOD PANEL
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed 6 Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	FLUORES. TROUGH - CHAIN SUSPENDED
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	S WALL - ENCLOSED
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: **ROOM NO.** 108

VIEW S.W. - CORNER PARTITION

N. WALL

VIEW N.W.

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 52

ROOM NO: 109 LAST KNOWN USE: PANTRY SQUARE FEET: 61. CEILING HEIGHT: 8'-5" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete BLACK ☒ Other: LINOLEUM	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	5"
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 N+S ☐ 1908-1923 1934 ☒ 1924-1938 W+E ☐ 1939-Present	PP W+E ADDED - 1934
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	PP
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	W + S - PANELED
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	1 - C.M.L.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☒ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed / Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	LONG SINK - SIDE DRAIN BOARDS NO FAUCETS
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	BUILT-IN WD. SHELVES, CABINET W/ GLASS DOORS, N+E
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 1934 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (NOT AVAILABLE)

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 54

ROOM NO: 110 LAST KNOWN USE: FIRST-AID SQUARE FEET: 103 CEILING HEIGHT: 8'-1" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	SCORED
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	PAINTED PLY PANELING
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	PAINTED PLY
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	SOLID WOOD — DIVIDED CAFE-TYPE IN HALF W/ SHELF
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	3 C.M.L. ON CONDUIT
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	CPR, TABLE, CHAIRS
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS: (NOT AVAILABLE)

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 5C

ROOM NO: 111 LAST KNOWN USE: LAUNDRY SQUARE FEET: 2,334. CEILING HEIGHT: 15'-6" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	SCORED (BLANKET CLOSET - SE - WOOD FLOOR)
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	CEMENT PLASTER - 3'-9" WAINSCOT PP
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions METAL ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	W. - OVER 50% DESTROYED - EXPOSED T.C N. - BULGING - EXPOSED T.C. SE - METAL ENCLOSED BLANKET STORAGE CLOSET
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	ALONG W. - EXP. T.C. PORTIONS ALONG NE & SE CORNERS DESTROYED
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	8 LT. TRANSOM - S. HARDWARE GONE CRACKED UPPER LT. DOUBLE DOOR - G.M. OVER BOTTOM HALF
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 8 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	WHITE ENAMEL RLM CEILING MT.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☒ Vents (Fans) ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed 2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	WALL FANS
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	2 - "AMERICAN HUMATIC EXTRACTOR" IRONING PRESSES "SMITH DRUM" PRESSURE BARREL SHEET PRESSER, WASH BINS
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☑ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 111

N.W. CORNER - "HUMATIC EXTRACTORS"

VIEW W.

S.E. CORNER - BLANKET STORAGE PARTITIONS

PHOTOGRAPHS: ROOM NO. 111

N.E. CORNER

VIEW S. - WEST SIDE

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 60

ROOM NO: 112 LAST KNOWN USE: SUPPLY RM. SQUARE FEET: 186. CEILING HEIGHT: 15'-6" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	CEMENT PLASTER WAINSCOT 3'-9"
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	PP E. WALL - WD. COUNTER W/ WIRE MESH TO CEILING
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	PP
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	5 PANEL
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	SUSPENDED
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	WALLS LINED W/ SHELVES, BOXES CABINETS
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 112

VIEW S.E.

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 62

ROOM NO: 113 LAST KNOWN USE: DRESSING/ SHOWER SQUARE FEET: 100. CEILING HEIGHT: 15'-8" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	6" RED SQUARES WHITE HEX. IN SHOWER
BASE:	[X] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	TILE IN SHOWER (WHITE RECT.)
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	PP - DK. GREEN PAINTED BAND AT CLOSET HT. AROUND RM.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	PP - SOME OUTER COAT SPALLING
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good E [X] Fair S [ ] Poor [ ] Destroyed	[X] 1900-1907 ? [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	E. - 4 LONG WD. PANEL S. - WD. RAIL SPLIT CRACKED WIRE GLASS PANE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	CHAIN ONLY
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: SHOWER	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1907 [X] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	1 CAST IRON RADIATOR - DECORATIVE)-RD. PEDESTAL SINK PLASTER WALL ENCLOSED SHOWER TILE BASE + FLOOR (HEX.)
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	TONGUE-IN-GROOVE CLOSET W/ CROWN MOLDING OIL TANK
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 113

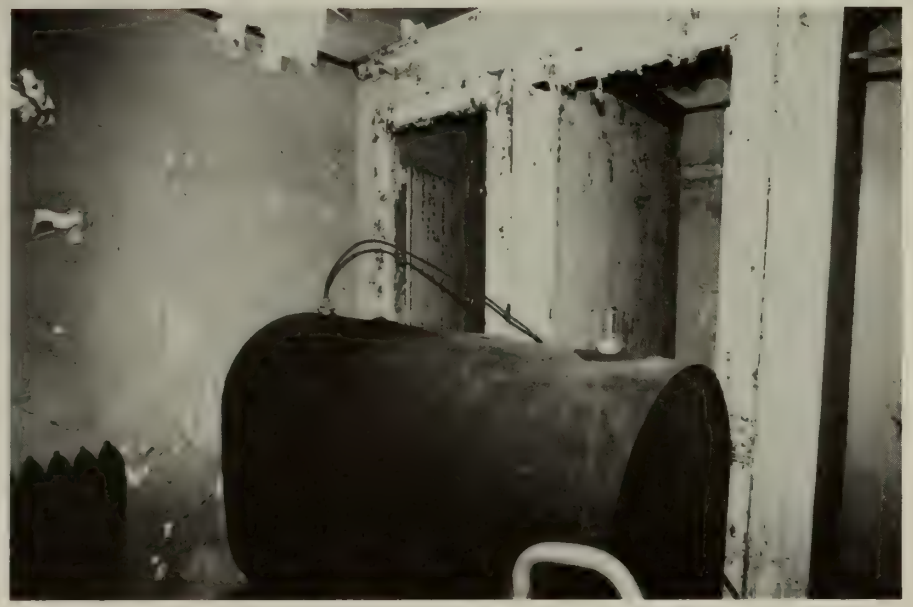

NW.

VIEW NE

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 64

ROOM NO: 114 LAST KNOWN USE: PANTRY / REFRIG. SQUARE FEET: 218 CEILING HEIGHT: 15'-8" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	FLOOR DRAIN
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	BUFF RECT.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	PP - SOME PLASTER SPALLING
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CHAIN SUSPENDED
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	REFRIG. UNIT ON W. - (WALK-IN) WD. + METAL DOOR - CONCRETE FLOOR, PLASTER WALLS + CEILING METAL SHELVES
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 114

NW - COOLED DOOR - LEFT

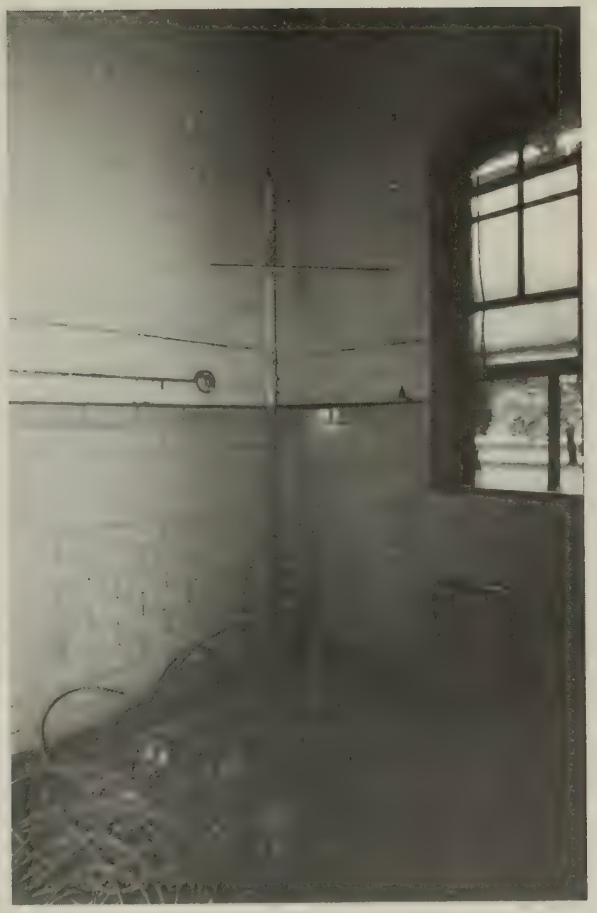

S.E.

PHOTOGRAPHS:

ROOM NO. 114

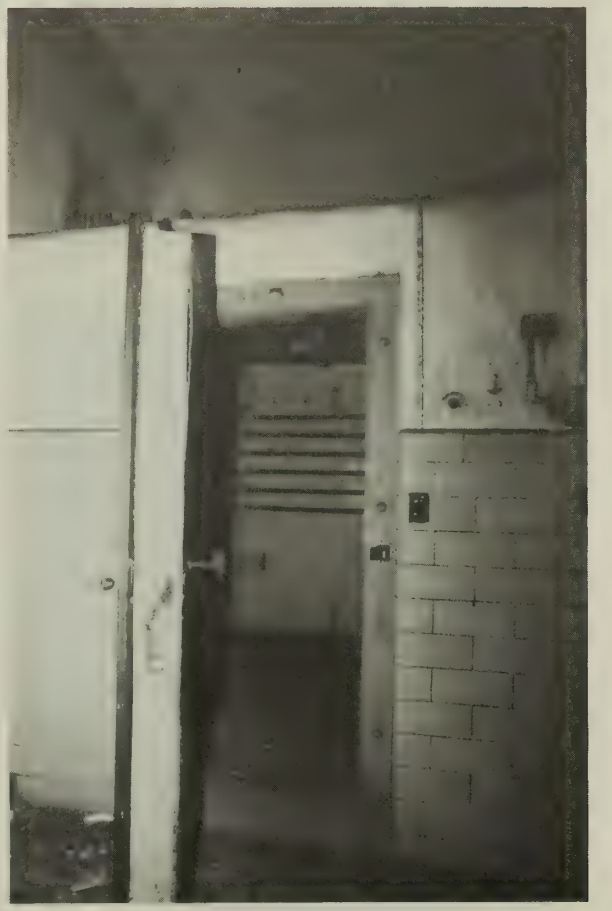

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 67

ROOM NO: 115 LAST KNOWN USE: COMMISSARY DEPT. OFFICE SQUARE FEET: 348. CEILING HEIGHT: 15'-8" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete BLACK ☒ Other: LINOLEUM	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	CRACKED, BUCKLED OVER WOOD PLANK
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	8½"
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	PP APPLIED MOLDING FORMING 2 ROWS OF PANELS PLUS PICTURE RAIL
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	E. - PEELING PP
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good N - SWINGING ☒ Fair S ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	2 WOOD PANELS - UPPER WIRE GLASS - DOUBLE DOORS (2) ON S. N. - WOOD PANEL TO KITCHEN (R4.117)
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 3 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	RLM - SUSPENDED ON CHAINS W/ HOOKS
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☒ Sink/Toilet/Urinal ☐ Other:	2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	S. WALL ROUND PEDESTAL SINK
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 115

VIEW W.

VIEW. E.

E. END WALL

PHOTOGRAPHS: ROOM NO. 115

N.E. CORNER

W. WALL - PAINTED MURAL (DARK AREAS) REVEALED UNDER PAINT

N.W. CORNER

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 70

ROOM NO: 116 LAST KNOWN USE: ENTRY SQUARE FEET: 174. CEILING HEIGHT: 15'-8" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	1" HEX
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	5½"
WALLS:	[X] Plaster [X] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	SW CORNER - POWDERY PLASTER W. - G.B. PARTITION WD. DADO RAIL - 5'-11" PAINTED CANVAS OVER PLASTER
CEILING:	[ ] Plaster [X] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	DOUBLE DRS. TRANSOM FILLED IN NO HARDWARE
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [X] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	HOOD ON CHAIN - NO GLOBE
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 116

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 72

ROOM NO: 117 LAST KNOWN USE: KITCHEN SQUARE FEET: 1,188 CEILING HEIGHT: 15'-9" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	6" RED QUARRY
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	5'-6" YELLOW BUFF - RECT.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	CRUMBLING - NW CORNER & NE CENTER - N. END - LARGE BULGE
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	PP HOLE - NW & NE
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [X] 1939-Present	W. - DOUBLE - 3 WD. PANELS UNDER WIRE GLASS N. - DOUBLE DR. - VENEER S. - SWINGING WOOD
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed 8 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	SUSPENDED ON CHAINS
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	KITCHEN EQUIPMENT ICE BOXES, SERVING COUNTER
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 117

VIEW N.E.

PHOTOGRAPHS: ROOM NO. 117

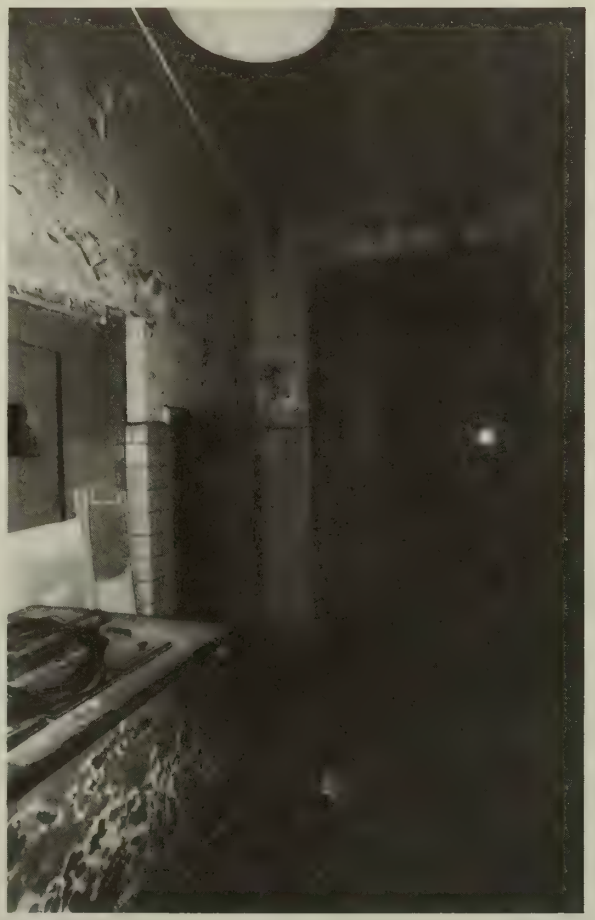

S.W. END - DOOR TO RM. 118

N.W. CORNER

PHOTOGRAPHS:

ROOM NO. 117

STOVE - N. WALL

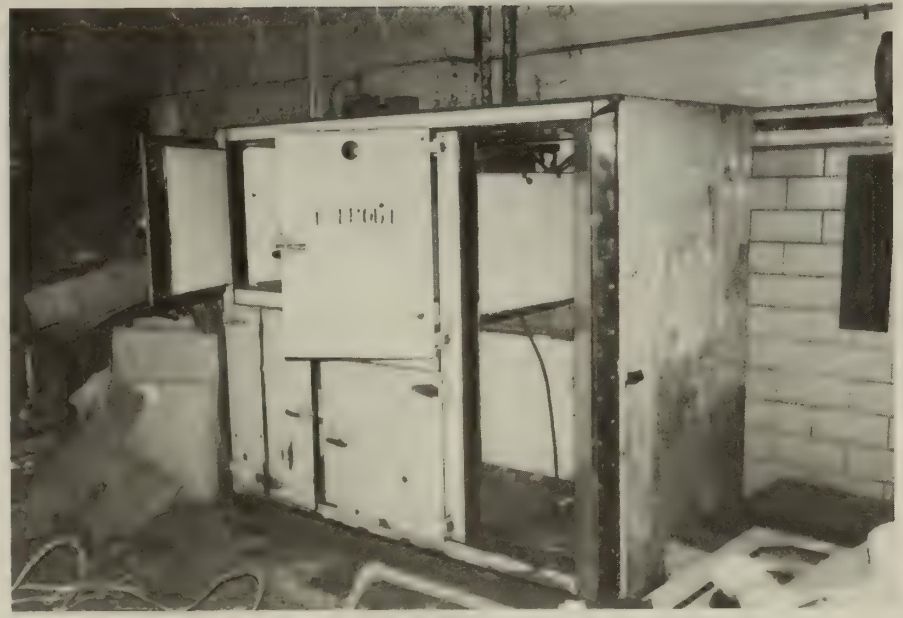

ENAMELED METAL ICE BOX - N. WALL

WOODEN ICE BOX - S. WALL

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 76

ROOM NO: 118 LAST KNOWN USE: DINING ROOM SQUARE FEET: 1,276. CEILING HEIGHT: 15'-8" & 7'-11" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Concrete X Other:	X Good Fair Poor Destroyed	1900-1907 X 1908-1923 1924-1938 1939-Present	1" WHITE HEX
BASE:	Wood X Tile Tile Wainscot Other:	X Good Fair Poor Destroyed	1900-1907 X 1908-1923 1924-1938 1939-Present	5½" SQ. TILE - WHITE WOOD DADO RAIL - 7" WIDE 5'-11" h. (TOP)
WALLS:	X Plaster X Gypsum Board Partitions Other:	X Good G.B. Fair X Poor Destroyed	X 1900-1907 1908-1923 1924-1938 X 1939-Present *	SE, NW + W - EXPOSED T.C. G.B. - PARTITIONED RMS. W/ PLYWOOD CEILINGS E. - PEELING CANVAS WALLCOVERING
CEILING:	X Plaster X Acoustic panels Cove Other	Good X Fair Poor Destroyed	X 1900-1907 1908-1923 1924-1938 X 1939-Present	PLASTER DESTROYED ALONG N. + SE. ACOUSTIC - 25% GONE
DOORS/ OPENINGS:	X Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1907 1908-1923 1924-1938 1939-Present	E. - DOUBLE - UPPER SINGLE LT. 2 WOOD PANELS - RAISED MOLDING NO HARDWARE N. -
LIGHTING:	X Incandescent/Type A Incandescent/Type B Incandescent/Type C Other:	1 Intact 2 Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	Pre-1924 X Post-1924 In Question	
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans Sink/Toilet/Urinal Other:	3 Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1900-1907 1908-1923 1924-1938 1939-Present	S. + W. - 2
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1907 1908-1923 1924-1938 1939-Present *	(ALL WALLS HAD CANVAS WALLCOVERING - REMAINS ONLY ON E. WALL) PARTITIONS ERECTED BY CONTRACTOR
SUMMARY:		Good X Fair Poor Destroyed	X 1900-1907 1908-1923 1924-1938 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor / Negligible

PHOTOGRAPHS:

ROOM NO. 118

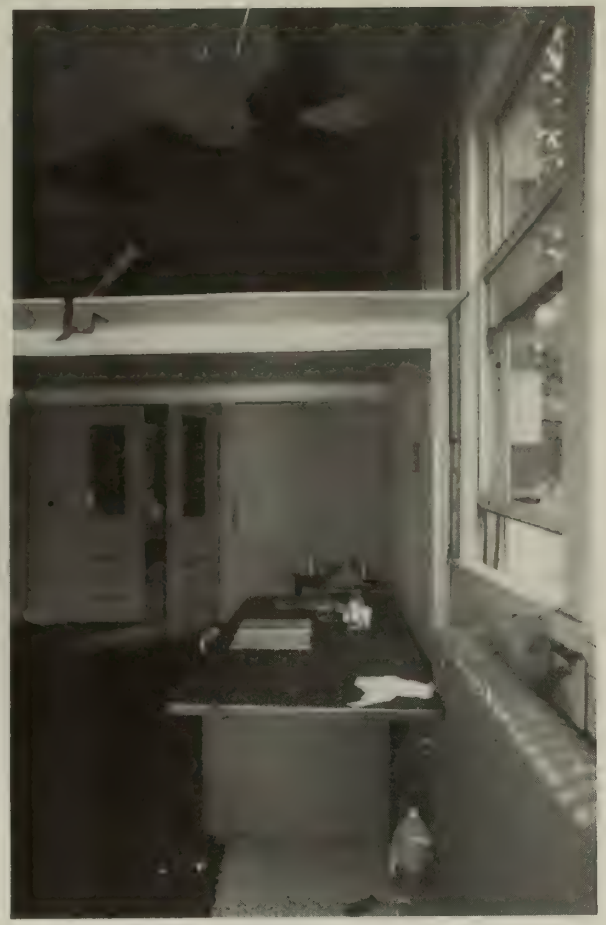

PHOTOGRAPHS: ROOM NO. 118

VIEW N. ALONG E. WALL

VIEW E. - PARTITIONS

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 79

ROOM NO: 119 LAST KNOWN USE: TICKETS/MONEY EXCHANGE SQUARE FEET: 1,800 CEILING HEIGHT: 17'-4" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 '35 [ ] 1939-Present	DEBRIS - MOSSY GROWTH 2 TYPES - N - 8½" RED/ORANGE QUARRY S - 6" RED QUARRY TILE
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 '35 [ ] 1939-Present	S - 5½" RED TILE N - DEBRIS
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions WOOD [ ] Other:	[ ] Good [ ] Fair [X] Poor PARTITIONS [X] Destroyed	[X] 1900-1907 [ ] 1908-1923 [X] 1924-1938 S.-'35 [ ] 1939-Present	S. - METAL FRAME EXPOSED N. - EXPOSED LATH + BROWN COAT PARTITIONS - W. END - NO GLASS REMAINS ABOVE COUNTERS
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED T.C.
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair 2 [ ] Poor [X] Destroyed 1	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 '35 [ ] 1939-Present	3 SETS GLASS DRS. (WD. FRAME) W/ SIDELIGHTS & TRANSOMS - 1 MISSING DOOR
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [X] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [13] Intact [1] Destroyed [2] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	13 RLM ON CHAINS - GLASS GLOBES INTACT 2 - GREEN METAL SHADES OVER COUNTER MTED TO COUNTER
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents, (Fans) [ ] Sink/Toilet/Urinal [ ] Other:	[8] Intact [1] Destroyed [2] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	8 - N. WALL MOUNTED 1 - BROKEN 2. FANS - WALL MOUNTED - N.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 119

VIEW E.

VIEW NW

VIEW W.

VIEW E. FROM COUNTERS

PHOTOGRAPHS: ROOM NO. 119

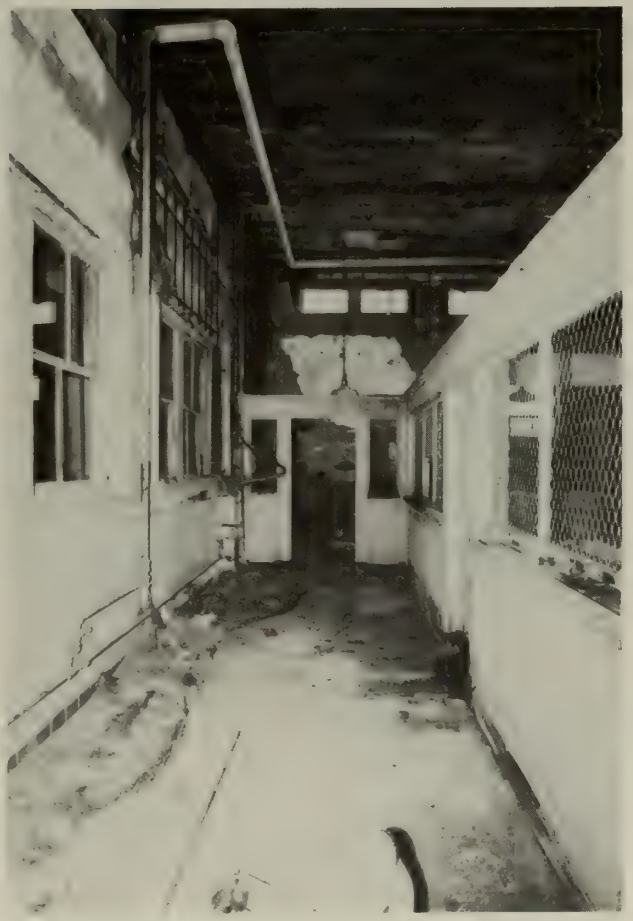

VIEW W. FROM E. END OF COUNTERS

S. WALL - DOORS FROM H104

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 82

ROOM NO: H101 LAST KNOWN USE: HALL SQUARE FEET: 120. CEILING HEIGHT: DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	PAINTED SLOPING UP
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	CEMENT PLASTER
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	GOOD PAINT (RECENT)
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	N. - GALV. METAL PLATES - UPPER PANE - WIRE GLASS DOUBLE 8-LT. TRANSOM S. - NO DRS. - 8 LT. TRANSOM
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	C.M.L. ON CONDUIT
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H101

VIEW S. FROM ENTRY

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 84

ROOM NO: H102 LAST KNOWN USE: HALL SQUARE FEET: 55. CEILING HEIGHT: 8'-5" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	GREEN + GRAY SQUARE TILE
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	8½"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	W. WALL BUILT - 1935
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	WOOD PANELS
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. H102

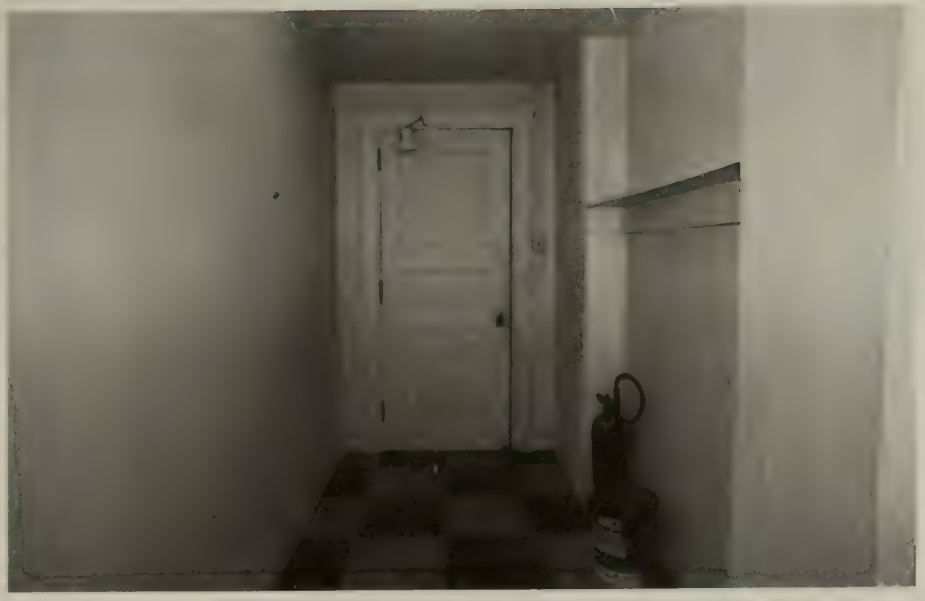

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY

ROOM NO: H103 LAST KNOWN USE: HALL SQUARE FEET: 82. CEILING HEIGHT: 15'-6" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	CEMENT PLASTER WAINSCOT N. & S.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	PLY PARTITION (SEE RM. 110) W. - WOOD COUNTER W/ WIRE MESH TO CEILING E. - OVER 50% PLASTER DESTROYED
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED T.C. FINISH - SPALLING
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair N [ ] Poor [X] Destroyed S. - 8LT. T.	[ ] 1900-1907 [X] 1908-1923? [ ] 1924-1938 [ ] 1939-Present	G.M. PLATE ON WOOD PANEL LEFT DR. - PLATE MISSING
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed 1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CHAIN SUSPENDED
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H103

VIEW N. - DOORS TO RM. 111

VIEW S. INTO H105

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY

ROOM NO: H104 LAST KNOWN USE: HALL SQUARE FEET: 1,142. CEILING HEIGHT: 11'-8" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	SCORED IN SQUARES 1935 FINISH ON E. END OF RAMP CARBORUNDUM ABRASIVE
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	S. WALL
WALLS:	☐ Plaster ☒ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 S. ☐ 1908-1923 ☒ 1924-1938 N. ☒ 1939-Present	S- PAINTED BRICK (EXTERIOR WALL) N.- BRICK PIERS - WOOD W. & DOORS G.B. TEMPORARY PARTITION - NEAR STAIR TO RM. 118
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	EXPOSED T.C. + METAL FRAME (N+S) 4 METAL FRAMED SKYLIGHTS METAL FASCIA
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	3 GLASS PANE DOORS W/ SIDELTS. & TRANSOMS 1 MISSING - 1 NO HARDWARE
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	CEILING MOUNTED METAL DOUBLE LAMP (HORIZONTAL) HOUSING- SHADES MISSING
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	4 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	SECTIONAL N. WALL - 2 WALL HUNG
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. H104

VIEW E.

W. END STEPS - VIEW E.

VIEW W.

STAIR TO RM. 118

PHOTOGRAPHS: ROOM NO. H104

SKYLIGHT

W. END - TO COVERED WAY 5

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 91

ROOM NO: H105 LAST KNOWN USE: HALL SQUARE FEET: 1,180. CEILING HEIGHT: 15'-11" + 8'-5" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	CEMENT PLASTER WAINSCOT - 5'
WALLS:	☒ Plaster OVER BRKK ☐ Gypsum Board + T.C. ☐ Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	DESTROYED AT W. UPPER END & S.E. AT WINDOW
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	DESTROYED AT W. END - 15' LENGTH
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	3 N. - 1 ELEV. 1 - DOUBLE WD. DOOR 4 S. - 1 DOUBLE WD - 4 LT. TRANSOM 1 - 4 WD. PANEL 1 - 5 " " - DOUBLE - G.M. - WIRE GLASS
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other: ?	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	3 CHAINS
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. H105

VIEW E.

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 93

ROOM NO: H106 LAST KNOWN USE: HALL 1937 ADDITION SQUARE FEET: 168. CEILING HEIGHT: SLOPED FLOOR 7'-3"–9'-11" DATE: 9/4/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	2 RAMPS - PLATFORM BETWEEN METAL SAFETY TREADS ON LOWER RAMP
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	UNPAINTED EVERY 6TH COURSE - DARKER HEADERS (N. OF CENTER DRS. ON W. + ALL OF E. WALL ENGLISH BOND - W.
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	MOISTURE DISCOLORATION - SW SIDE
DOORS/ OPENINGS:	☒ Wood/~~Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	DOUBLE DOORS AT CENTER - W. HALF OF DOOR REMAINS OFF HINGE - MISSING 1 OF 4 LT BADLY WORN
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	C.M.L. ON CONDUIT
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. H106

VIEW N. - ENTRY TO C-4

356 | 26,006 / 7 of 34
DSC | JUL 88

Exhibit 14

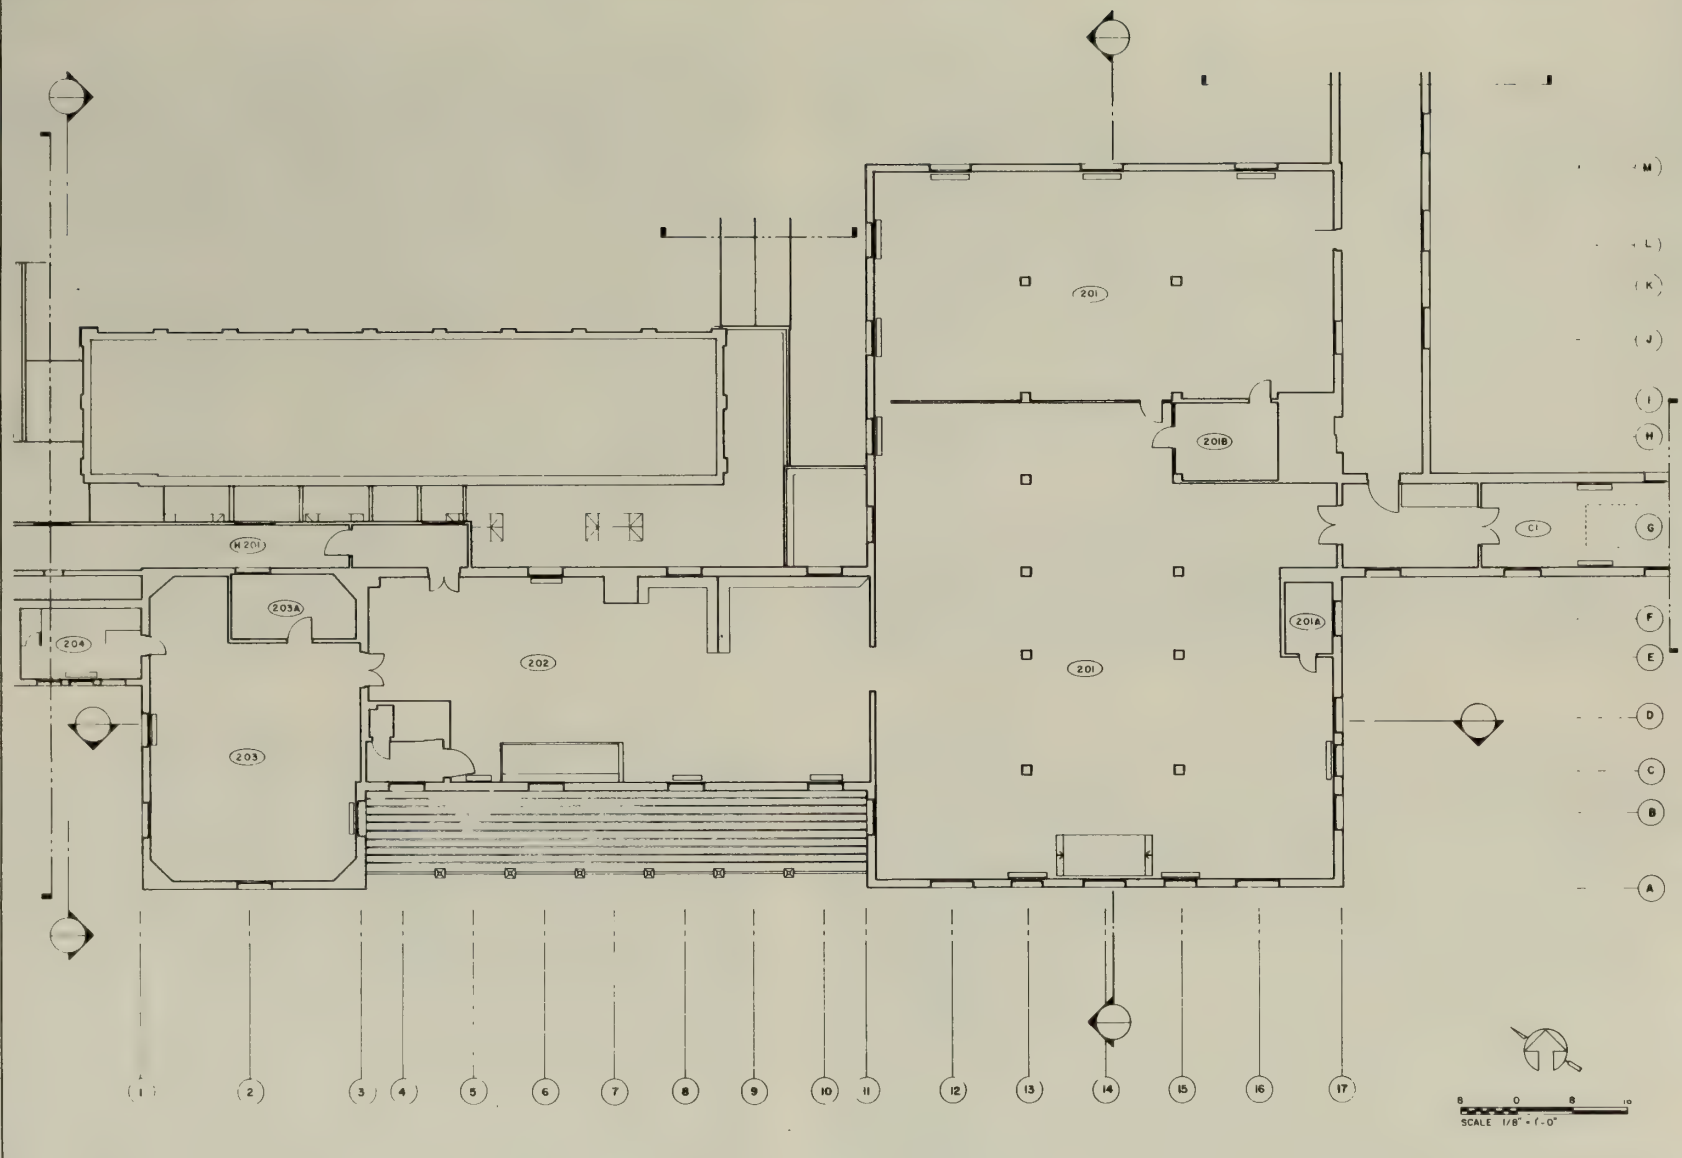

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
50 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3660

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | sht | REVISIONS | date | by

DESIGNED | DATE:
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
KITCHEN & LAUNDRY SECOND FLOOR PLAN

SUB SHEET NO | DRAWING NO
PKG NO | SHEET OF

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 96

ROOM NO: 201 LAST KNOWN USE: CLASSROOM HISTORICALLY: DININGRM. SQUARE FEET: 6,279. CEILING HEIGHT: 12'-4" DATE: 8/2/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Concrete Other:	Good X Fair Poor Destroyed	1900-1907 X 1908-1923 1924-1938 1939-Present	WHITE MEX. CRACKING - AREAS OF REPLACEMENT TILE
BASE:	Wood Tile X Tile Wainscot Other:	X Good Fair Poor Destroyed	1900-1907 X 1908-1923 1924-1938 1939-Present	MISSING PEN TILES - W. DISCOLORATION - W. SOME CRACKING 4'-6½" h. (ALSO ON COLUMNS)
WALLS:	X Plaster Gypsum Board X Partitions Other:	X Good PARTITION Fair X Poor Destroyed	1900-1907 X 1908-1923 1924-1938 1939-Present	50% PLASTER GONE - EXPOSED T.C. + BRICK CENTER PARTITION TO CEILING - MASONITE + STUD
CEILING:	X Plaster w/ COVE Acoustic panels Cove Other	Good X Fair Poor Destroyed	X 1900-1907? 1908-1923 1924-1938 1939-Present	SECTIONS OF EXPOSED METAL LATH CRACKING E. - COVE LATH EXPOSED COVE PERIMETER POWDERY - W + N
DOORS/ OPENINGS:	X Wood/Glass Panelled Wood Veneer Galvanized Metal Other:	X Good - E. - DOUBLE Fair X Poor Destroyed	1900-1907 X 1908-1923 1924-1938 1939-Present	W. - DOUBLE DRS. MISSING E. - (2) SINGLE DR. - MISSING PANEL DOUBLE DR. - 8 LT. PIV. TRANSOM (ENTRY FROM CORRIDOR 1)
LIGHTING:	X Incandescent/Type A X Incandescent/Type B Incandescent/Type C Other:	2 Intact 7 Destroyed 9 Intact 1 Destroyed Intact Destroyed Intact Destroyed	Pre-1924 X Post-1924 In Question	2 GLASS GLOBES INTACT - REST - CHAINS + HOODS N. SIDE OF PARTITION - RLM FIXTURES (B)
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans Sink/Toilet/Urinal Other:	9 Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	X 1900-1907 1908-1923 1924-1938 1939-Present	CORRODED
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1907 1908-1923 1924-1938 1939-Present	
SUMMARY:		Good X Fair Poor Destroyed	1900-1907 X 1908-1923 1924-1938 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** X Most; Some; Minor; Negligible

PHOTOGRAPHS:

ROOM NO. 201

PHOTOGRAPHS:

ROOM NO. 201

PHOTOGRAPHS:

ROOM NO. 201

PHOTOGRAPHS:

ROOM NO. 201

N.E. CORNER

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 101

ROOM NO: 201A LAST KNOWN USE: OFFICE SQUARE FEET: 71. CEILING HEIGHT: 12'-4" DATE: 8/2/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete BLACK ☒ Other: LINOLEUM	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	
BASE:	☐ Wood ☒ Tile ☒ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☒ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	TILE ON W., S. & PART OF N. - 5½"h. WAINSCOT - PART N., E. - 5'-8"h. PROJECTING CAP TILE
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☒ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ? ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	DAMAGE ALONG WINDOW - E.
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☒ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	MISSING
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☒ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	WALL GRILLE - N.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	DESK, 3 CHAIRS, COAT RACK
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☒ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. 201A

ELLIS ISLAND **EXISTING CONDITION SURVEY** **KITCHEN & LAUNDRY** page: 103

ROOM NO: 201B LAST KNOWN USE: OFFICE SQUARE FEET: 165. CEILING HEIGHT: 12'-4" DATE: 8/2/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [X] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [X] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	E. ONLY MISSING TILES, DISCOLOR.
WALLS:	[X] Plaster E [ ] Gypsum Board [X] Partitions WOOD [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [X] 1908-1923 E [ ] 1924-1938 [X] 1939-Present	SOME DISCOLOR. E. WALL PLASTER DESTROYED EXP. T.C.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [X] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	HOLE ALONG E. WALL SPALLING
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	WIRE GLASS PANE / 3 WD. PANELS (2 DRS.)
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	—
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 201B

E. WALL

EXTERIOR OF N. WALL - LOOKING S.

VIEW NW.

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 105

ROOM NO: 202 LAST KNOWN USE: CLASSRM. SQUARE FEET: 1,982. CEILING HEIGHT: 12'-2" DATE: 8/2/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete BLACK ☒ Other: LINOLEUM	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	BUCKLED AT E. ENTRY LOOSE, CRACKED INCISED COMPASS DESIGN AT CENTER
BASE:	☐ Wood ☐ Tile ☒ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☒ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	WHITE TILE COVERED BY PAINTED CANVAS - PEELING (ON S. + E. ONLY)
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☒ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	EXP. T.C.
CEILING:	☒ Plaster w/ COVE ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	LARGE BULGE + CRACK PERPENDICULAR TO CENTER BAY EXP. LATH
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer W. ☒ Galvanized Metal ☒ Other: WIRE MESH TO 202A	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☒ 1939-Present W.	N - G.M. OVER WOOD - WIRE GLASS PANE OVER 3 PANELS W. - VENEER-DOUBLE DR. - 1 LT. @ - OBSCURE GLASS
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact 7 Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☒ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	6 Intact ☐ Destroyed 2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1907 RAD ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	2 WOOD SLAT VENTS TO ATTIC
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☒ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 202

S.W. CORNER

VIEW E.

VIEW N.E.

VIEW NW

PHOTOGRAPHS: ROOM NO. 202

VIEW S.E.

CEILING VENT TO ATTIC

COMPASS DESIGN IN LINOLEUM FLOOR

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 108

ROOM NO: 202A LAST KNOWN USE: REFRIG./ELEVATOR SQUARE FEET: 66. CEILING HEIGHT: 12'-2" DATE: 8/2/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☒ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	METAL ABRASIVE PLATE - W. END
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	PP PAINTED BAND
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: CEMENT PLASTER	☒ Good ☒ Fair PLASTER ☐ Poor ☐ Destroyed	☒ 1900-1907 S+W ☒ 1908-1923 N+E. ☐ 1924-1938 ☐ 1939-Present	CEMENT PLASTER FLOOR TO DOOR HT. - PLASTER ABOVE, SOME PP EXPOSED T.C.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	PP
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☒ Other: WIRE MESH	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	CORRODED REFRIG. DOOR - 7" THICK - WOOD OUTSIDE, METAL FACE INSIDE LATCH HANDLE
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	C.M.L. - PORCELAIN MT.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☒ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	OVER REFRIG. UNIT
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	ELEVATOR - CORRODED DOORS - 1911 REFRIG. - WALK-IN COOLER TYPE SHELF
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☒ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. 202A

VIEW W.

VIEW NW - REFRIG. DOOR

PHOTOGRAPHS:

ROOM NO. 202A

INSIDE REFRIG./COOLER

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 111

ROOM NO: 203 LAST KNOWN USE: CLASSROOM SQUARE FEET: 1,107. CEILING HEIGHT: 11'-11" DATE: 8/2/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 1935 [ ] 1939-Present	BUFF/BROWN 6" SQUARE
BASE:	[ ] Wood [X] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	SINGLE TILE BASE - ON 2 WALLS OF PARTITIONED RM. - 6" h. ROOM - 2'-8½" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [X] Other: PART. BOARD	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	PEELING, EXPOSED T.C. S.E. WINDOW DESTROYED N.E. CORNER - 2 PARTICLE BOARD
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	PP
DOORS/ OPENINGS:	[X] Wood/Glass Panelled N [X] Wood Veneer E+W [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 E. [X] 1939-Present	VENEER - SWING DOUBLE DRS. - E. TO 203A - 6 LT. / WD. PANEL
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	5 [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	2 [ ] Intact 1 [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	1 ON FLOOR
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 203

VIEW S.

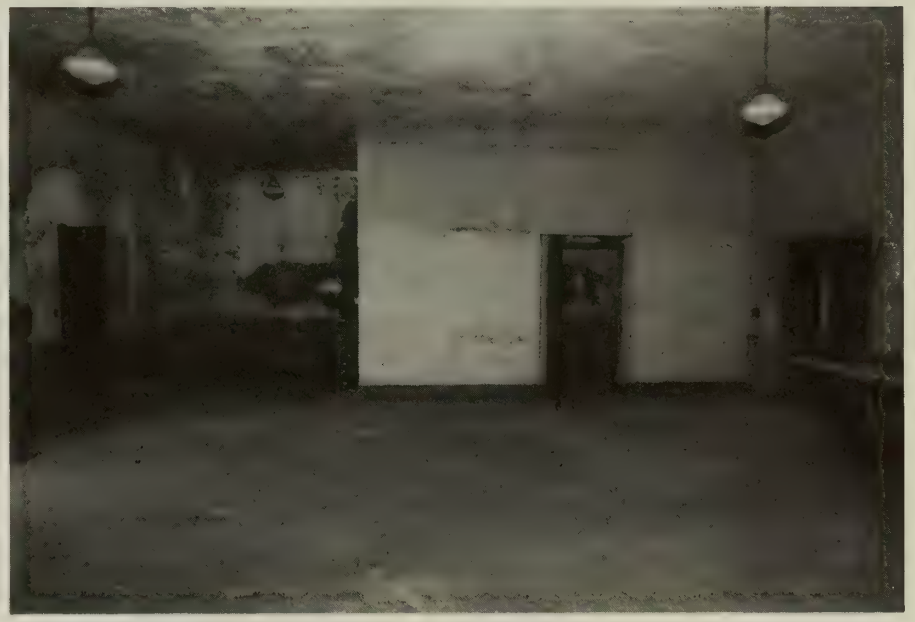

VIEW N.

VIEW S.E

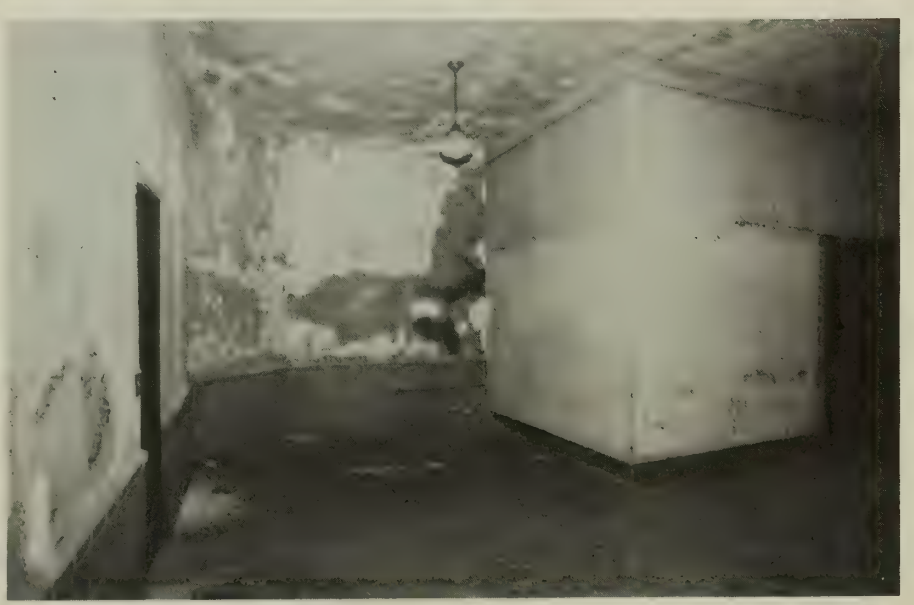

N.W. CORNER

ELLIS ISLAND EXISTING CONDITION SURVEY KITCHEN & LAUNDRY page: 113

ROOM NO: 203A LAST KNOWN USE: SQUARE FEET: 153. CEILING HEIGHT: 11'-11" DATE: 8/2/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [X] Tile S+W [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [X] 1924-1938 [X] 1939-Present S+W	S+W - 6" BASE TILE E+N - 2'-8½" h. WAINSCOT
WALLS:	[X] Plaster N+E [ ] Gypsum Board [ ] Partitions [X] Other: PARTICLE	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907. N+E [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	PLASTER - SOME EXP. LATH W+S - PLASTERED TO 7'-3½" h. ABOVE - PARTICLE B. OVER WD. STUD
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	6 LT./WD. PANEL
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1-CHAIN
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [ ] 1939-Present	WALL OUTLET - E.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1907 [ ] 1908-1923 [ ] 1924-1938 [X] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 203A

VIEW SW

VIEW NW

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 115

ROOM NO: 204 LAST KNOWN USE: TOILET SQUARE FEET: 187. CEILING HEIGHT: DATE: 8/2/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 '35 ☐ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	PAINTED ON BRICK
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions ☒ Other: BRICK, N,S,E	☒ Good ☐ Fair ☒ Poor PARTITIONS ☐ Destroyed	☒ 1900-1907 E. ☐ 1908-1923 ☒ 1924-1938 '35 - N+S ☒ 1939-Present W.	E. - EXTERIOR BRICK WALL W. - PLASTER OVER T.C. METAL TOILET PART. + L AT DOOR CORRODED
CEILING:	☒ Plaster ON CONCRETE ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	WATER LEAKAGE - DISCOLOR. SOME EXP. CONCRETE - SPALLED OFF REINF. BARS
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	(LARGER DOUBLE DR. OPENING WAS FILLED IN FOR EXISTING DOOR IN 1940's.)
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	C.M. — MISSING
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☒ Sink/Toilet/Urinal ☒ Other: SLOP	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☒ Intact ☐ Destroyed 1 Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	2 PEDESTAL SINKS 1 TOILET, 1 URINAL - WALL MT.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 204

VIEW N.E.

N. WALL PLUMBING

VIEW W.

ELLIS ISLAND — EXISTING CONDITION SURVEY — KITCHEN & LAUNDRY — page: 117

ROOM NO: H201 LAST KNOWN USE: HALL 1935 ADDITION SQUARE FEET: 436. CEILING HEIGHT: DATE: 8/2/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	RAMPS DOWN TO BAKERY & CARPENTRY SHOP SECOND FLOOR
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions CONCRETE ☒ Other: BRICK - S.	☒ Good S. ☐ Fair ☒ Poor N+E ☐ Destroyed	☒ 1900-1907 S. ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	N. + E. - STUCCO COATING OVER CONCRETE - PAINTED CORROSION AT METAL WINDOWS, GENERAL CRACKING, WALLS SEPARATING IN N.E. CORNER
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	RE-BARS EXPOSED IN SPOTS CROSS-BEAMS - CONCRETE ENCASED
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☒ Other:	☐ Good ☐ Fair ☒ Poor CORRODED ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	G.M. - W. END TOWARD E. END - WIRE MESH ON 1 SIDE - SOLID G.M. ON OTHER - MOUNTED IN WIRE MESH PARTITION
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	1 C.M.L. 1 C.M. SOCKET
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. H201

VIEW E.

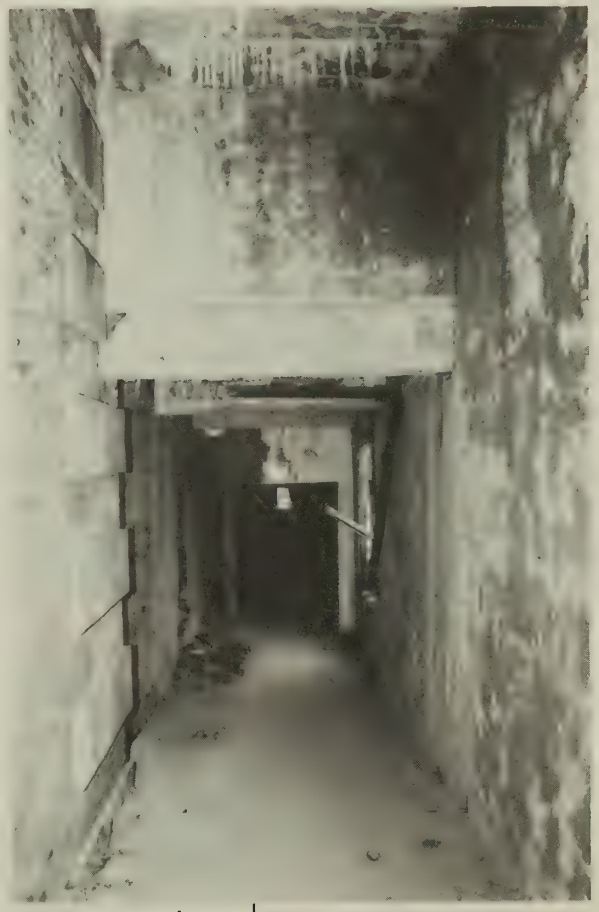

VIEW W.

VIEW W. END INTO B+C BLDG.

BAGGAGE & DORMITORY BUILDING

Exhibit 47

EXISTING CONDITIONS

- GOOD
- FAIR
- POOR
- DESTROYED

356	26,006 / 8 of 34
DSC	JUL 88

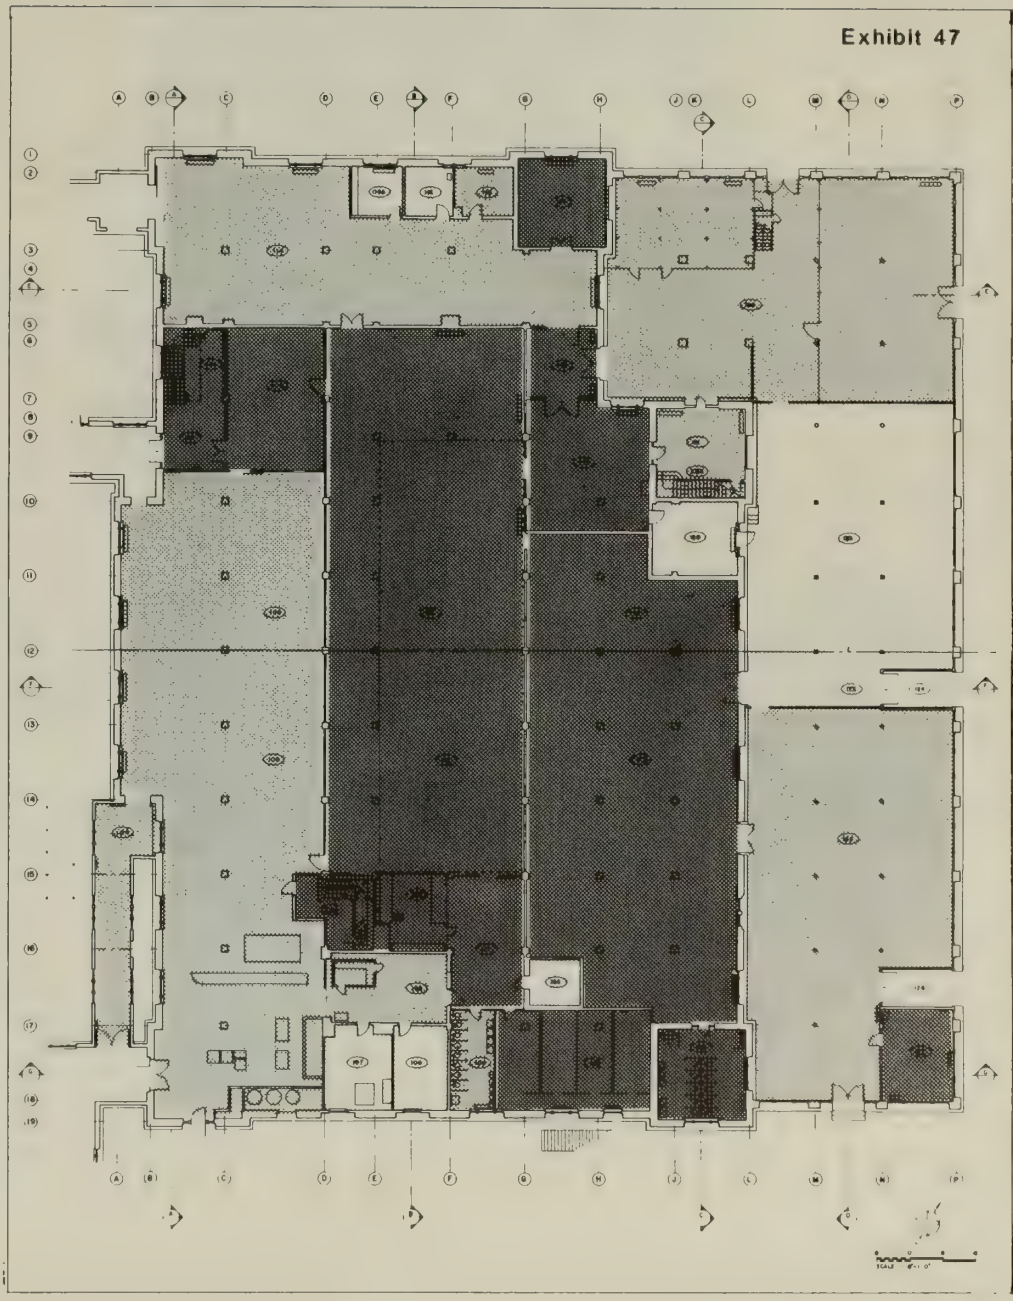

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk shl REVISIONS date by

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAGGAGE & DORMITORY
1st FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET
OF

Exhibit 48

EXISTING CONDITIONS

- GOOD
- FAIR
- POOR
- DESTROYED

356 | 26,006 / 9 of 34
DSC | JUL 88

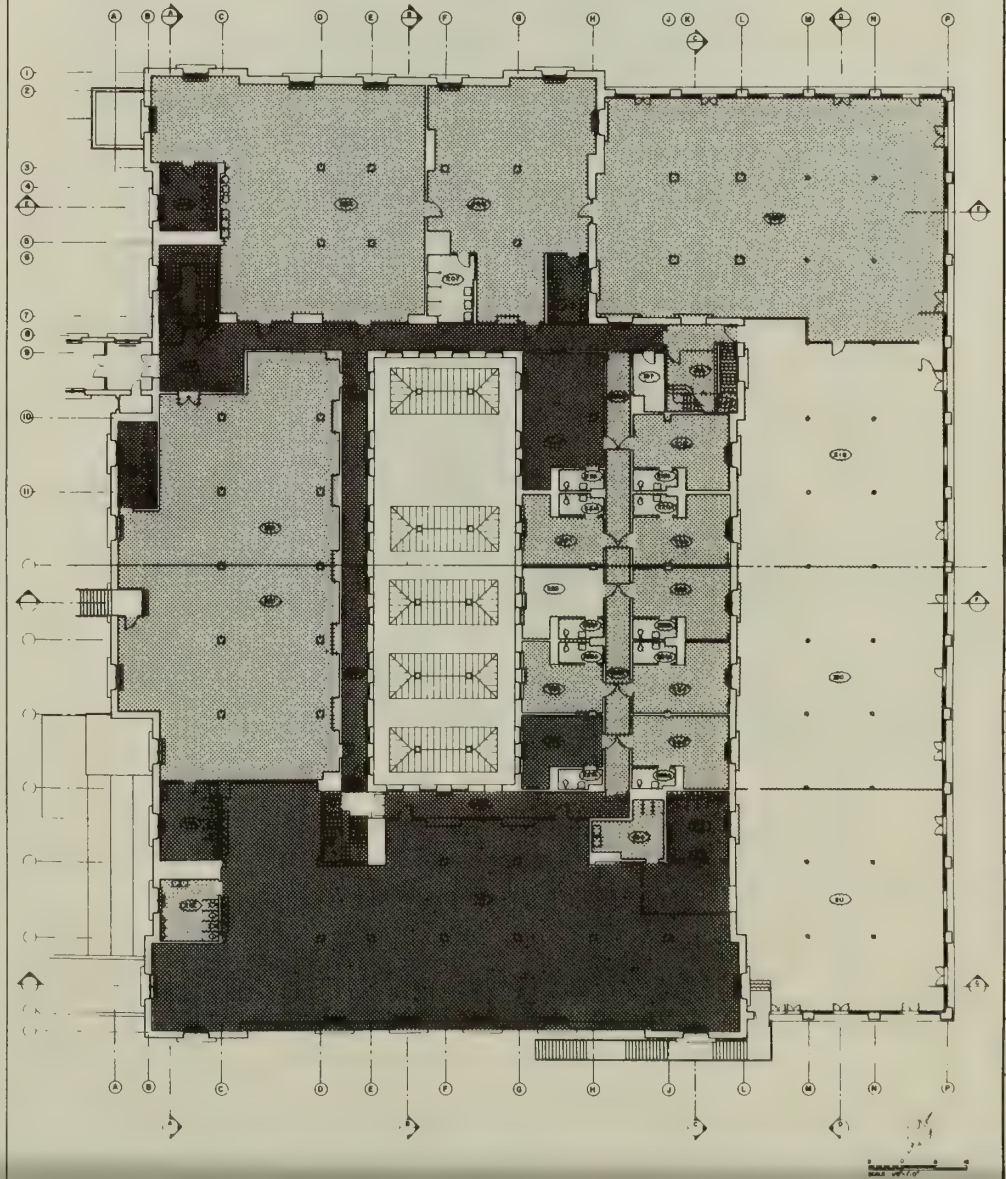

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
60 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | s/h | REVISIONS | date | by

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAGGAGE & DORMITORY
2nd FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET OF

Exhibit 49

EXISTING CONDITIONS

- GOOD
- FAIR
- POOR
- DESTROYED

356	26,006 / 10 of 34
DSC	JUL 88

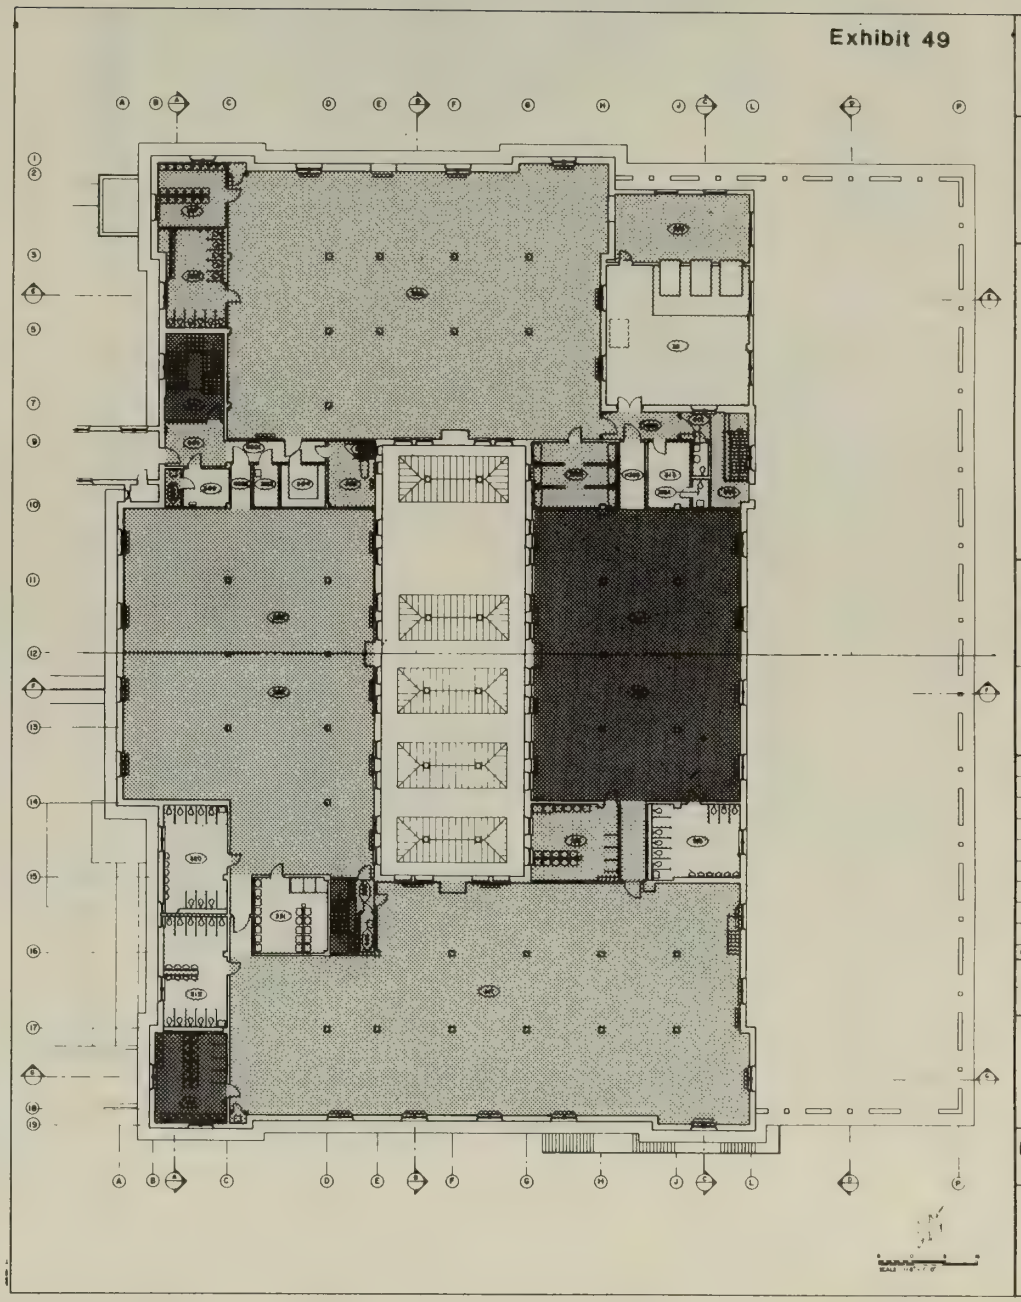

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD

80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3860

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | aht | REVISIONS | date | ini

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAGGAGE & DORMITORY
3rd FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET
OF

ARCHITECTURAL SIGNIFICANCE

- MOST
- SOME
- MINOR
- NEGLIGIBLE

356 | 26,006 / 11 of 34
DSC | JUL 88

Exhibit 50

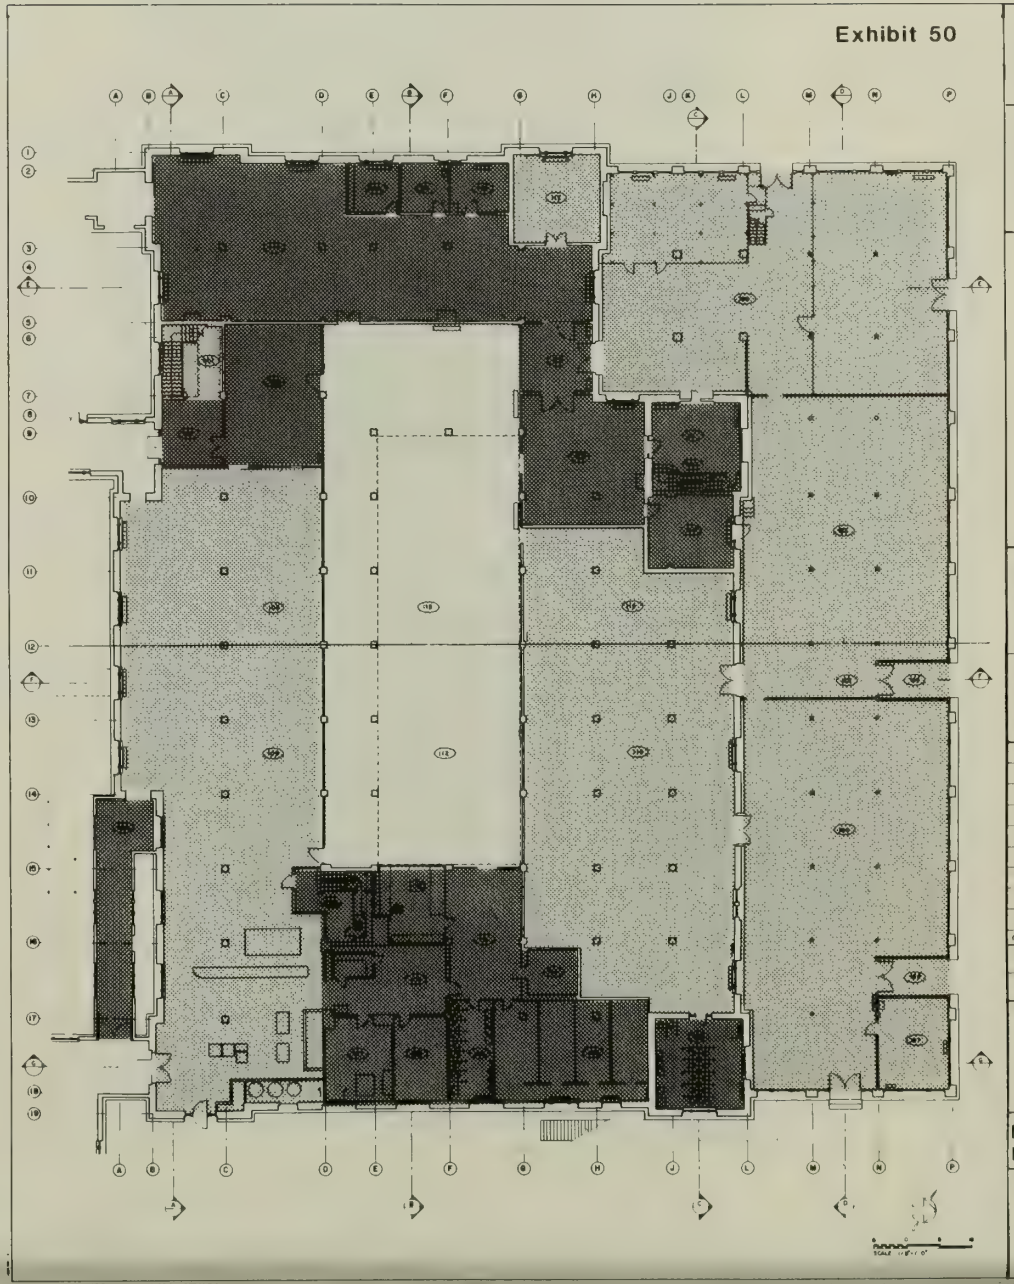

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | ahl | REVISIONS | date | by

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAGGAGE & DORMITORY
1st FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET
OF

ARCHITECTURAL SIGNIFICANCE

- MOST
- SOME
- MINOR
- NEGLIGIBLE

356	26,006 / 12 of 34
DSC	JUL 88

Exhibit 51

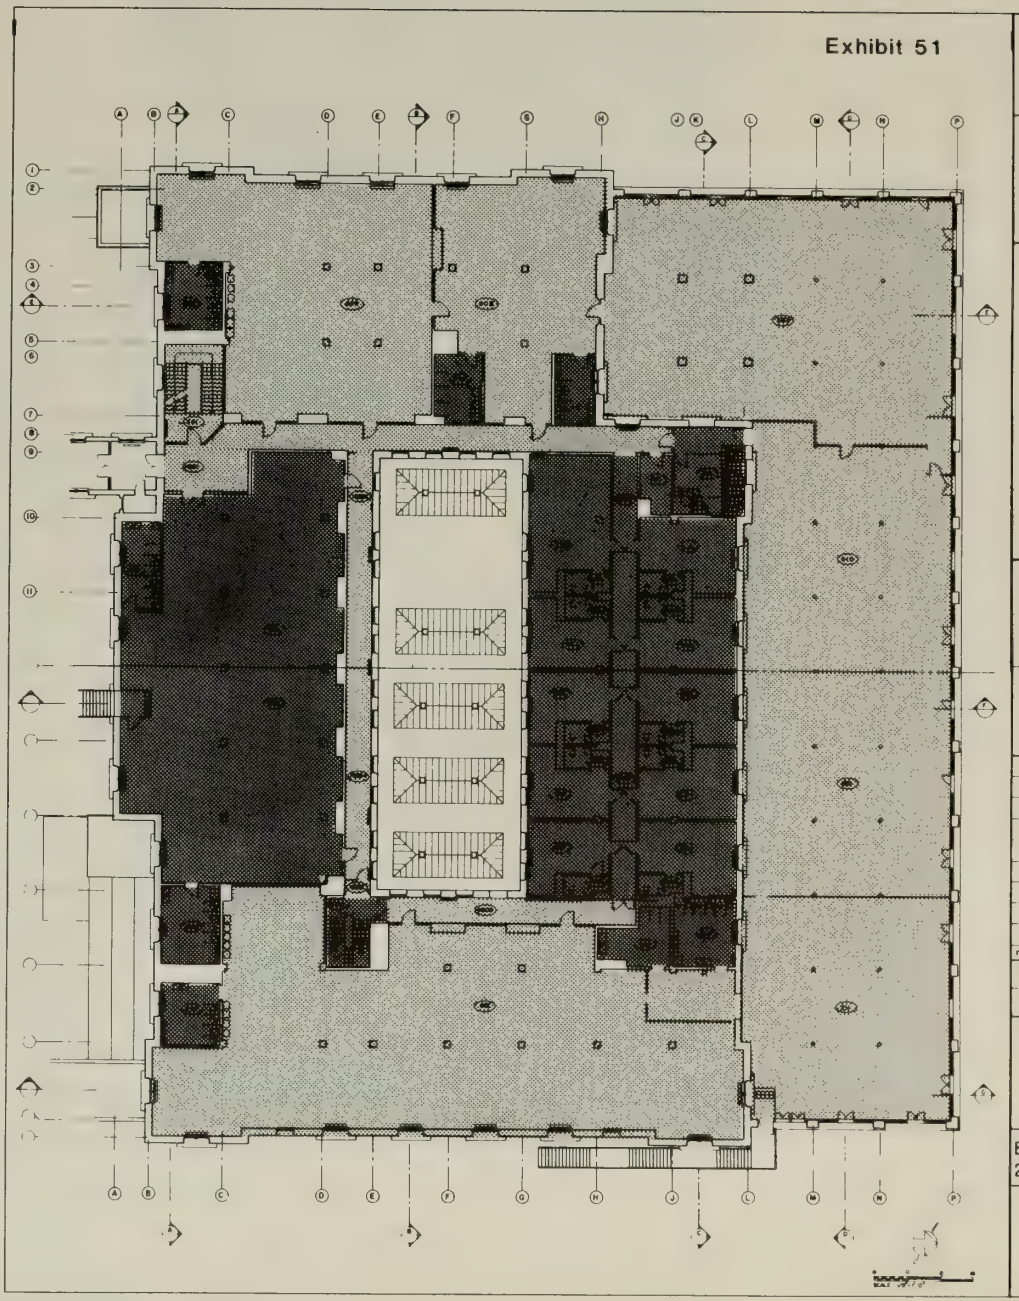

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | sht | REVISIONS | date | ini

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAGGAGE & DORMITORY
2nd FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO — | SHEET [ ] OF

Exhibit 52

ARCHITECTURAL SIGNIFICANCE

- MOST
- SOME
- MINOR
- NEGLIGIBLE

356	26,006 / 13 of 34
DSC	JUL 88

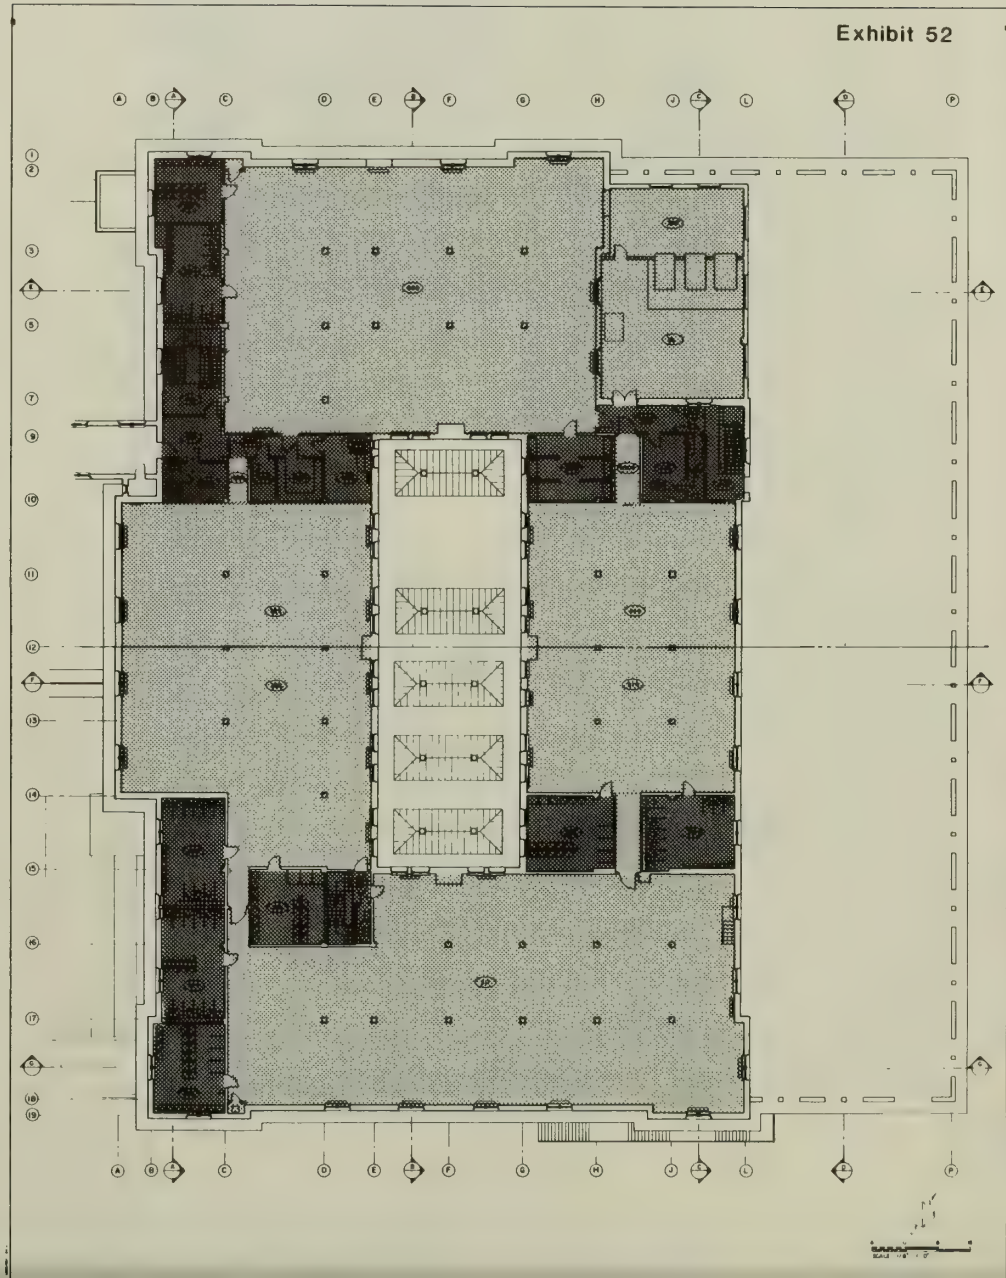

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD

60 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | sht | REVISIONS | date | ini

DESIGNED | DATE

DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAGGAGE & DORMITORY
3rd FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET OF

356 | 26,006 / 14 of 34
DSC | JUL 88

Exhibit 17

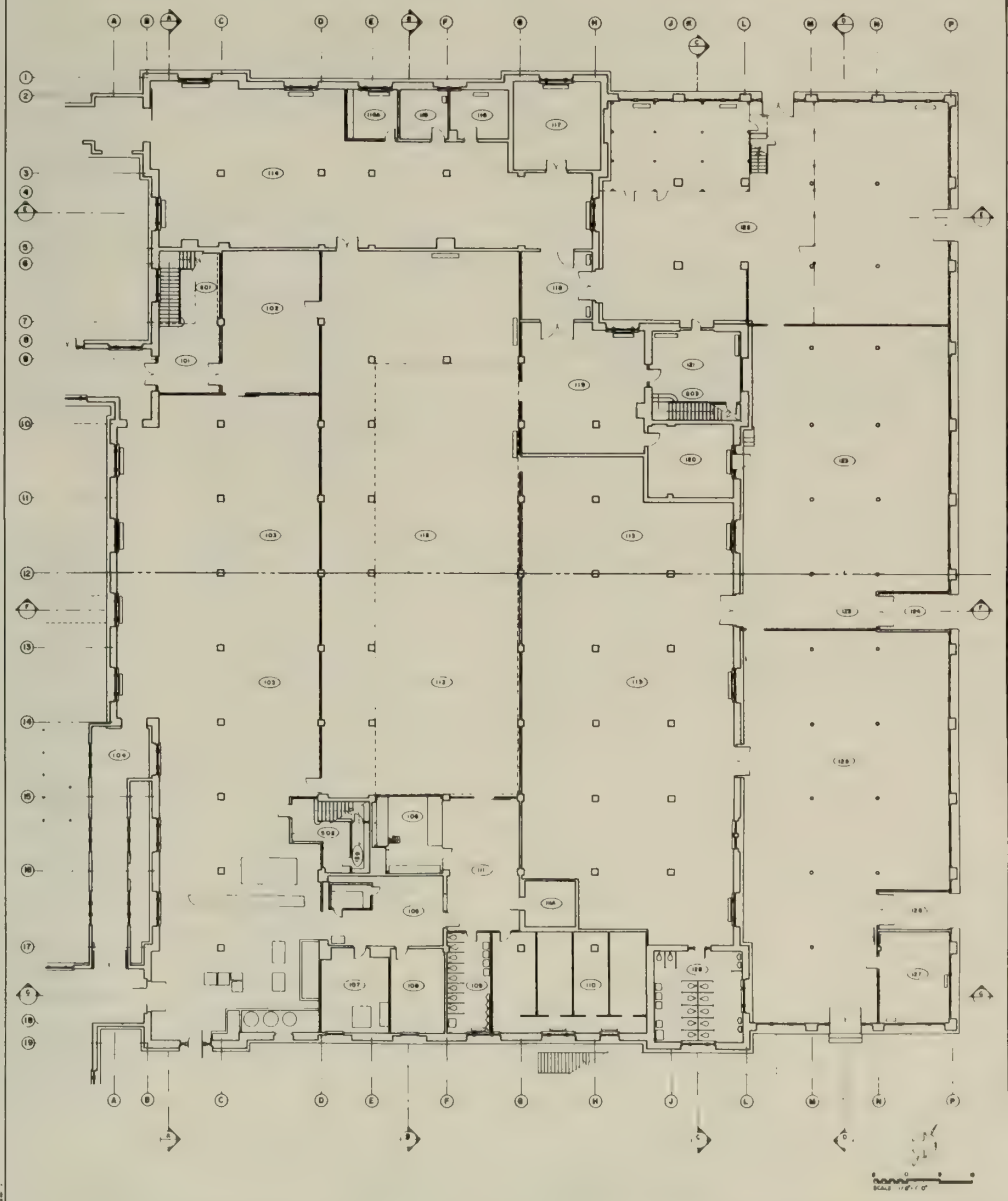

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD

80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3860

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | sht | REVISIONS | date | by

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAGGAGE & DORMITORY
1st FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET
OF

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 126

ROOM NO: 101 LAST KNOWN USE: ENTRY SQUARE FEET: 236 CEILING HEIGHT: 18'-1" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-½" H. S. - ONLY
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed E, N. S.	[X] 1909-1912 S. [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	EXP. & CORRODED METAL LATH & STUDS - N & E, EXP. T.C. ON S. N. - 1939 & 1951 E. - 1951
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED T.C. BLOCK
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	SURFACE CORRODED - SMALL SINGLE PANE - WIRE GLASS - EACH OR. 2 DOUBLE DRS. - N & S
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [I] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 101

VIEW SW - (ALSO STAIR - 501)

VIEW NE - DESTROYED E. WALL 127

ELLIS ISLAND EXISTING CONDITION SURVEY BAGGAGE & DORMITORY page: 128

ROOM NO: 102 LAST KNOWN USE: DISH WASHING SQUARE FEET: 800 CEILING HEIGHT: 18'-1" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	W. WALL + 2 COLUMNS
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions WOOD [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 W. [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present 1951- N+E	N+E. - WOOD PARTITION - 9'-6" H.+ WIRE MESH TO CEILING S. WALL E. OF COLUMN - PARTIALLY DESTROYED
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED T.C.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [X] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	E. - SLIDING METAL FREIGHT N. - DIAMOND WIRE MESH S. - DOUBLE - G.H. - SMALL LT.
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [4] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	2 ELM SHADES ON FLOOR 2 HANGING CHAINS
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	W. WALL - 1 DOUBLE WINDOW 4/4 LT. PIVOTED WIRE MESH ON OTHER SIDE
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 102

VIEW NW

VIEW SE

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: 103 LAST KNOWN USE: ALIEN DINING RM. AND KITCHEN SQUARE FEET: 6,584 CEILING HEIGHT: 18'-1" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	2" HEX SOME CRACKING AREA MISSING TILE
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SECTIONS MISSING CRACKED ON COLUMNS 5'½" H.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions WOOD [ ] Other:	[ ] Good [X] Fair PARTITIONS [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	EXP. T.C. - MOST PLASTER ON S, W + E DESTROYED PART. - 9'-6" H. - WIRE MESH TO CEILING
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	LARGE PORTIONS - EXPOSED T.C. MORE THAN 60% DESTROYED AREAS OF EXP. STEEL BEAMS - CORRODED
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal N. [X] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 1935- [X] 1939-Present W.	W. - SLIDING METAL FREIGHT E. - METAL GRILLS S. - DOUBLE DR. - UPPER LT. - 2 WD. PANELS ea.
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed 16 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	16 - RLM. - GREEN ENAMEL FINISH DROP CORDS & CHAINS
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	5 Intact [ ] Destroyed 4 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	2 RAD. IN KITCHEN - 2 - W. WALL 2 WALL FANS. - W. 2 WINDOW FANS - E. - 1940
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 103

VIEW S.W.

VIEW W.

S. WALL

SW CORNER

PHOTOGRAPHS: ROOM NO. 103

VIEW TOWARD E.

VIEW NE - 502 ENTRANCE

PHOTOGRAPHS:

ROOM NO.

VIEW NE

S.E. CORNER - DOOR TO C-6

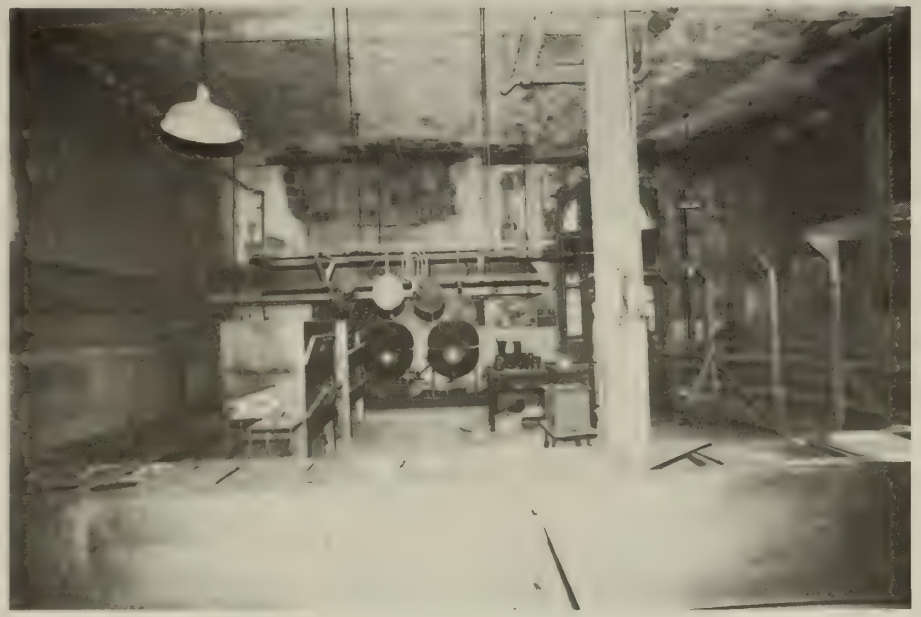

E. WALL

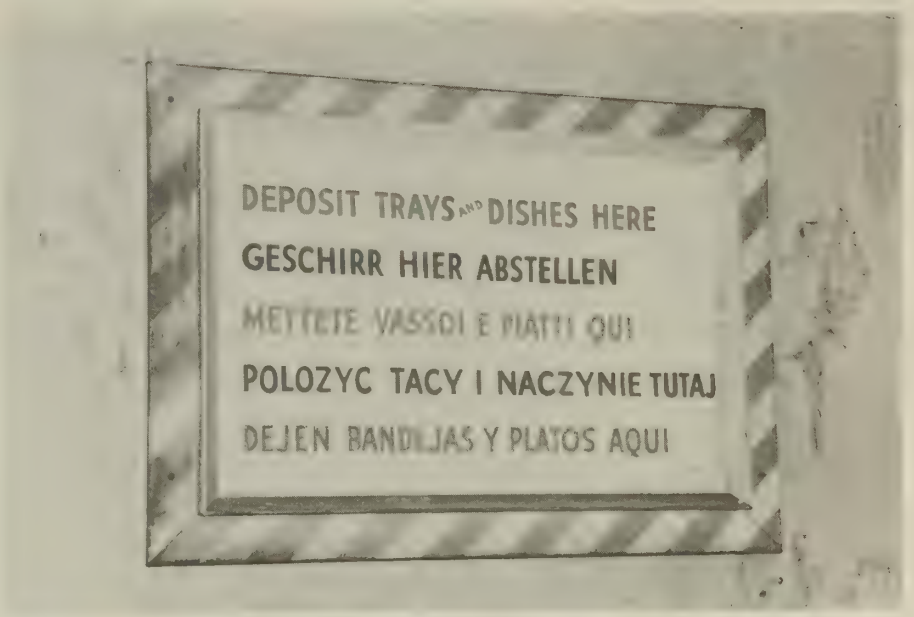
DEPOSIT TRAYS AND DISHES HERE
GESCHIRR HIER ABSTELLEN
METTETE VASSOI E PIATTI QUI
POLOZYC TACY I NACZYNIE TUTAJ
DEJEN BANDEJAS Y PLATOS AQUI

SIGN OVER COUNTER - WEST WALL PARTITION

ELLIS ISLAND EXISTING CONDITION SURVEY BAGGAGE & DORMITORY page: 134

ROOM NO: 104 LAST KNOWN USE: PASSAGE SQUARE FEET: 556 CEILING HEIGHT: DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	CRACKS ACROSS WIDTH 1 DRAIN
BASE:	☐ Wood ☐ Tile ☒ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	5'-1½" FEW MISSING TILES
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	PP AREA OF EXPOSED BRICK UNDER SKYLIGHT
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other WOOD	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	6 STEEL TRUSSES & CHANNEL PURLINS WOOD TONGUE-IN-GROOVE SHEATHING SOME ROTTING AROUND SKYLIGHT
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	PP SOLID DOUBLE DOOR
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed 3 Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	C.M.L.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	WALL-MOUNTED
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	SIGN ON WEST END: "TRAYS & DISHES STRAIGHT AHEAD" IN FIVE LANGUAGES
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 104

VIEW W. - ORIGINAL EXTERIOR WALL

VIEW S.E.

VIEW E.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 136

ROOM NO: 105 LAST KNOWN USE: KITCHEN ADJUNCT SQUARE FEET: 483 CEILING HEIGHT: 19'-9" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WHITE HEX DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-3/4" H.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present S.	CRACKING- PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED DUCT 40% DESTROYED - EXP. T.C.
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	2 WD/GLASS PANEL - RMS. 107-108 N. - SCREEN DR. - WOOD FRAME
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [3] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	BULBS ON CHAINS HOODS INTACT
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	LARGE REFRIG./COOLER UNIT
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 105

VIEW N.

NW CORNER

ELLIS ISLAND EXISTING CONDITION SURVEY BAGGAGE & DORMITORY page: 139

ROOM NO: 106 LAST KNOWN USE: FOOD STORAGE SQUARE FEET: 293 CEILING HEIGHT: DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Concrete [ ] Other:	[X] Good [ ] Fair [X] Poor - UPPER LEVEL [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	DEBRIS WOOD FLOOR - UPPER LEVEL
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions GRILLE [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 E+S [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present W+N	W - METAL GRILLE - GRILLE DOOR WELDED N. - SQUARE GRILLE ABOVE W/ DIAMOND GRILLE DOOR - CORRODED
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [X] Other PLY	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	ORIGINAL PLASTER - DESTROYED - EXPOSED T.C. BLOCK UPPER LEVEL - UNDERSIDE OF FLOORING - PLY - BULGING - DESTROYED ON W.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: GRILLE	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	CORRODED - BENT DOOR STILE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 3 Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L. - 2 - LOWER LEVEL 1 - UPPER LEVEL
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	UPPER LEVEL - SHELV
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 106

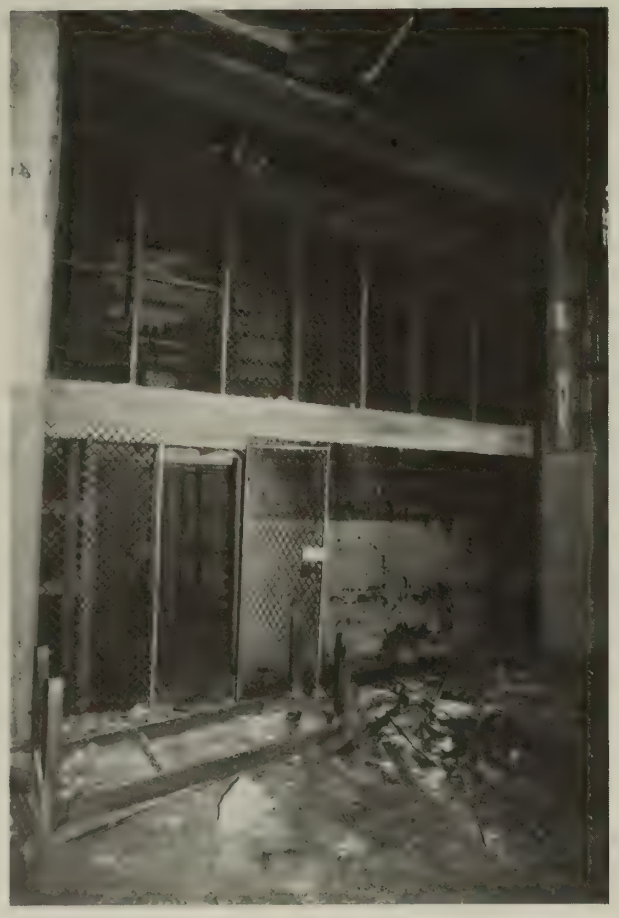

EXTERIOR N. WALL

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: 107 LAST KNOWN USE: BAKE SHOP SQUARE FEET: 322 CEILING HEIGHT: 18'-1" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX WHITE - 2"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-3/4"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	1 MAJOR CRACK - S WALL PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	9 LIGHT OVER SINGE WD. PANEL HARDWARE INTACT
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [X] Incandescent/Type C [ ] Other:	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed 2 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	TYPE C - CHAIN SUSPENDED METAL SKIRT SHADES OVER S. WALL COUNTER CENTER ROOM SUSP. GLOBE - TYPE A
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	LOCKER, FLOUR MIXER, 3 TRAY OVEN, 2 LARGE COOLING RACKS, PRESS S. WALL - WORK TABLE, SHELVES + BINS
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 107

VIEW SE

VIEW SW.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 142

ROOM NO: 108 LAST KNOWN USE: KOSHER KITCHEN SQUARE FEET: 263 CEILING HEIGHT: 18'-1" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WHITE HEX DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-3/4" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PEELING OUTER LAYER
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NW AREA + NE CORNER - EXPOSED T.C. - 30% GONE
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present '51	9 LIGHT OVER WOOD PANEL
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	CENTER OF ROOM - BARE BULB ON CHAIN - WAS PROBABLY FIXTURE A
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed 1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	WALL VENT - S. WALL GRATE NEAR CEILING DOUBLE SLOP SINK - NO FAUCETS OR HANDLES - RUSTED PEDESTAL
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	STOVE, 2 LOCKERS, 4 MISC. TABLES
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 108

VIEW W.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 14

ROOM NO: 109 LAST KNOWN USE: TOILET SQUARE FEET: 254 CEILING HEIGHT: 9'-1-3/4" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions - METAL ☒ Other: TILE - N+W	☒ Good TILE ☒ Fair PLASTER ☐ Poor ☐ Destroyed	☒ 1909-1912 PLASTER ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present TILE	N+W - 12"x 5" BUFF TILES S+E - PLASTER - STRIP DESTROYED-E. GALVANIZED METAL TOILET PARTITIONS
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other FLY	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	DELAMINATING, WARPING W. END DESTROYED - EXPOSED WOOD FRAMING
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	4 WOOD PANELS
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☒ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1909-1912 RADIATOR ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	- E. WALL 1 SLOP SINK, 4 WASH SINKS - NO HANDLES 8 TOILETS, 5 URINALS
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. 109

VIEW E.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 146

ROOM NO: 110 LAST KNOWN USE: SHOWERS SQUARE FEET: 890 CEILING HEIGHT: 18'-6" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	NOT USIBLE - EBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
WALLS:	☒ Plaster N & E ☐ Gypsum Board ☒ Partitions METAL ☒ Other: BUFF TILE	☒ Good TILE ☐ Fair ☒ Poor PLASTER ☐ Destroyed	☒ 1909-1912 E & N ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present W & S	3 METAL PARTITIONS - SHOWER AREAS SOME RUSTING PLASTER - OVER 50% DESTROYED COLUMNS (2) - EXPOSED T.C. BLOCK
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	T.C. EXPOSED ALMOST COMPLETELY
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	4 WOOD PANELS SPLITTING AT BOTTOM RAIL
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 4 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	CEILING MOUNTED
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☒ Vents/Fans ☐ Sink/Toilet/Urinal ☒ Other: SHOWER HDS.	☐ Intact ☐ Destroyed 2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed 32 Intact 5 Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	WINDOW FANS - E. WINDOW ARCHES STALL-LESS SHOWERS
MISCELLANEOUS:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	13 METAL LOCKERS - RUSTING
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 110

VIEW E. FROM ENTRY

VIEW W. - SHOWERS

PHOTOGRAPHS: ROOM NO. 110

LOCKERS

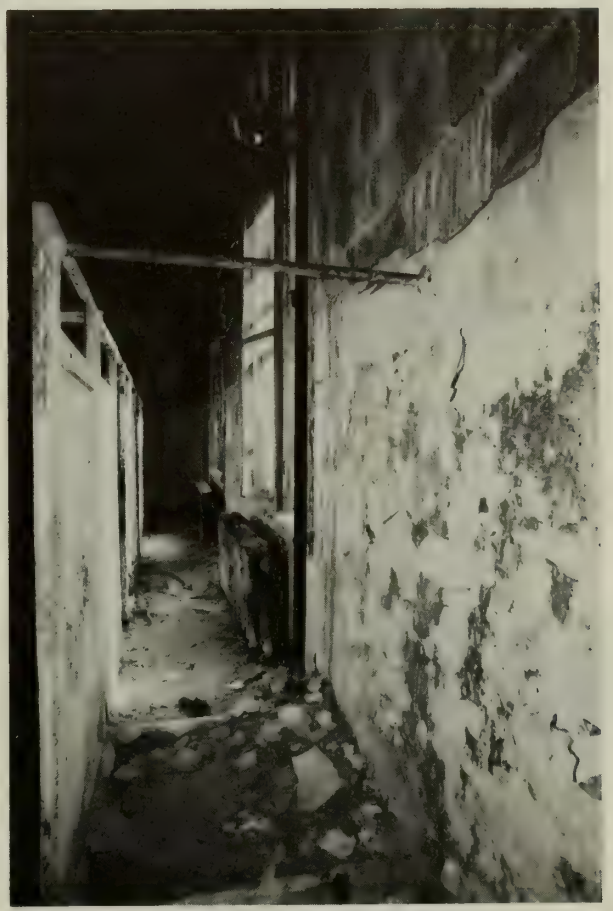

VIEW N. ALONG E. WALL

ROOM NO: 111 LAST KNOWN USE: CIRCULATION SQUARE FEET: 552 CEILING HEIGHT: 19'-9" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	10½" h. - CEMENT PLASTER
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions GRILLE ☒ Other: TILE	☒ Good TILE ☐ Fair ☒ Poor METAL CORRODED ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	N & E - BUFF TILE - 12" X 5" - LOW WALL N - GRILLE ABOVE TILE TO CEILING S - PLASTER + METAL PARTITION W - PLY ON WOOD STUD - GRILLE ABOVE
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	OVER 50% T.C. BLOCK EXPOSED
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☒ Other:	☒ Good S + E ☐ Fair ☐ Poor ☒ Destroyed W	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	WOOD PANELED TO RMS. 109 & 110 S - DOUBLE DOOR - WOOD & SCREEN WOOD FRAMED SCREENS ABOVE TO CEILING W - SLIDING PLY DOOR N - WOOD DOOR TO REFRIG. UNIT
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	GREEN METAL
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	GENERATOR ENCLOSED IN WIRE CAGE - N. WALL
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 111

VIEW SW

VIEW SE

VIEW NW

ROOM NO: 111A LAST KNOWN USE: REFRIG.(?) SQUARE FEET: 130 CEILING HEIGHT: 7'-5" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	RED TILE 6"X9"
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	6" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	CRACKS IN N + E WALLS
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	WOOD STRIP WATER STAINING
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	THICK WOOD INSULATED DOOR - REFRIGERATION TYPE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	'VAPORTIGHT' CAST METAL GUARD
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 111A

VIEW N. FROM DOOR

ROOM NO: 112 LAST KNOWN USE: ALIEN DINING ROOM SQUARE FEET: 6,258 CEILING HEIGHT: 18'-1" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	HEAVY DEBRIS VEGETATION -
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions PLY ☒ Other: TILE	☒ Good TILE ☒ Fair PLY PARTITIONS ☒ Poor PLASTER ☐ Destroyed	☒ 1909-1912 W ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present E-S+N	PLASTER MISSING FROM MAJORITY OF COLUMNS ABOVE METAL CASINGS 12"x5" BUFF TILE - N - DOOR HT.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☒ Other 5 SKYLIGHTS	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	T.C. AND LATH EXPOSED - 70% PLASTER PORTIONS REMAIN ON UNDERSIDE OF SKYLIGHT SEPARATORS DESTROYED IN WEST SECTION MAJORITY OF SKYLIGHT GLASS DESTROYED
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☒ Other: GRILLE	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	7 OPENINGS - SEE ROOMS 103, 102, 106, 113, 114 + 119
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 6 Intact 8 Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	W+N WALLS REPLACED IN '24
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☒ Most ☐ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 112

VIEW E.

VIEW SE

VIEW E.

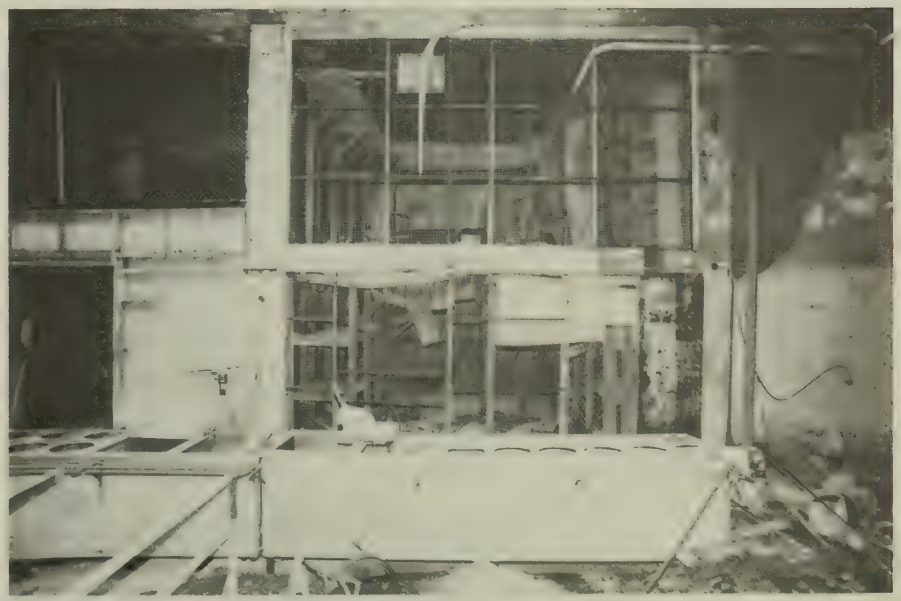

E. END WALL

PHOTOGRAPHS:

ROOM NO. 112

SKYLIGHT

PHOTOGRAPHS: ROOM NO. 112

VIEW NE

VIEW SW

VIEW NW

SKYLIGHTS - LOOKING SOUTH

ROOM NO: 113 LAST KNOWN USE: DETAINEE DINING RM. SQUARE FEET: 5,462. CEILING HEIGHT: 18'-6" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS COVERED - OVER 90%
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: TILE	☒ Good TILE - S, E ☒ Fair METAL ☒ Poor PLASTER ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present TILE	TILE - METAL GRILLE ABOVE WALL TO CEILING METAL CASINGS ON COLUMNS PLASTER - N. WALL - 95% DESTROYED
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	OVER 50% DESTROYED T.C. BLOCK FAILING - PIECES ON FLOOR
DOORS/ OPENINGS:	☒ Wood/Glass Paneled E ☒ Wood Veneer S ☒ Galvanized Metal N ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 GM ☒ 1939-Present VENEER	E - TO RM. 126 - S - TO RM. 112 - 1 WIRE GLASS PANE N - 2 - METAL PLATE OVER WOOD - UPPER LIGHT INFILLED W/ WOOD
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 19 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	SUSPENDED ON DROP CORD OR CHAIN VARYING LENGTH
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	3 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 113

VIEW S.E.

VIEW E.

VIEW SW

N. WALL DOOR TO RM. 123

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: 114 LAST KNOWN USE: COMMISSARY STORE RM. SQUARE FEET: 3,163 CEILING HEIGHT: 18'-4" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	CEMENT PLASTER - 7'-7" h.
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions WOOD ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	METAL CASING AROUND COLUMNS - 7'-7" S.+E. - PORTIONS OF T.C. BLOCK EXPOSED 40% DESTROYED WOOD PARTITIONS - SEE 114A
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	30% DESTROYED - SE CORNER AND ALONG E. WALL
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer - E ☐ Galvanized Metal ☒ Other: SLIDING FREIGHT	☐ Good ☒ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 S ☐ 1913-1923 ☒ 1924-1938 '35-VENEER ☐ 1939-Present	VENEER - SPLIT/WARP, DRY ROT S. - GALVANIZED M. FREIGHT DOOR
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 8 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	CEILING MOUNT TO CONDUIT
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	3 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 114

VIEW N.

VIEW S.E.

VIEW N. ALONG E. WALL

VIEW SW. – DOOR TO C-4

ROOM NO: 114A LAST KNOWN USE: OFFICE SQUARE FEET: 144 CEILING HEIGHT: 18'-4" DATE: 8/7/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
WALLS:	☒ Plaster N+W ☐ Gypsum Board ☐ Partitions ☒ Other: WOOD+GLASS	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	PP — ADDED IN 1916 E/S WALLS TONGUE-IN GROOVE PANELING WD. FRAMED GLASS ABOVE COUNTER HT. E. - CASEMENT WINDOW
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	OPEN TO ROOM 114
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	1 OBSCURE GLASS PANE - "OFFICE" STENCILED ON - ABOVE 3 WD. PANELS
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	CEILING MOUNT — OF ROOM 114
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	W. WALL
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 114A

VIEW OF EXTERIOR

INTERIOR - VIEW W.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: 115 LAST KNOWN USE: ? SQUARE FEET: 136 CEILING HEIGHT: 10'-4" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WHITE HEX DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-7" CORNERS CURVED
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	W. - AREA OF EXPOSED LATH POWDERING PLASTER PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SMALL SPOT OF EXPOSED T.C. BLOCK
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed 1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CEILING MOUNTED
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NOT HOOKED UP
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	2 IRON COTS
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 115

VIEW W.

ROOM NO: 116 LAST KNOWN USE: LOCKER RM. SQUARE FEET: 168 CEILING HEIGHT: 18'-4" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Concrete Other:	Good Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	MUDDY DEBRIS
BASE:	Wood Tile X Tile Wainscot Other:	Good X Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	W. WALL - 50% INTACT CHIPPING - STAINING - E.
WALLS:	X Plaster Gypsum Board Partitions Other:	Good Fair X Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	W. WALL - 90% GONE - EXPOSED T.C.
CEILING:	X Plaster Acoustic panels Cove Other	Good Fair X Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	80% DESTROYED
DOORS/ OPENINGS:	Wood/Glass Panelled Wood Veneer X Galvanized Metal Other:	X Good Fair Poor Destroyed	1909-1912 1913-1923 X 1924-1938 1939-Present	GALVANIZED M. OVER WOOD SOLID DOOR - MISSING KNOB PP
LIGHTING:	Incandescent/Type A X Incandescent/Type B Incandescent/Type C Other:	Intact / Destroyed 1 Intact / Destroyed Intact / Destroyed Intact / Destroyed	Pre-1924 X Post-1924 In Question	CEILING MOUNTED
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans X Sink/Toilet/Urinal Other:	1 Intact / Destroyed Intact / Destroyed 1 Intact / Destroyed Intact / Destroyed	X 1909-1912 1913-1923 X 1924-1938 SINK '24 1939-Present	1 SLOP SINK
MISCELLANEOUS:		Good Fair Poor Destroyed	1909-1912 1913-1923 1924-1938 1939-Present	ROUND MIRROR WOODEN 4-DOOR CLOSET
SUMMARY:		Good Fair X Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS:

ROOM NO. 116

VIEW W.

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: 117 LAST KNOWN USE: OFFICE SQUARE FEET: 441 CEILING HEIGHT: DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete ☒ Other: WOOD	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS ROTTED AREAS- YIELDS TO STEP
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS 10" h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	W. - 50% INTACT N. - 50% DESTROYED PLUS FLAKING SHEETS N. WINDOW - WOOD INFILLED
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	70% DESTROYED - EXPOSED T.C.
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	1 GLASS OVER 3 WOOD PANELS DOUBLE DR. - 3 LT./TRANSOM GALVANIZED METAL ON ROOM SIDE PP - MIN. RUSTING
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	CEILING MOUNT
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	1 ON W. - 1 ON N.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 117

W. WALL

VIEW S.E.

PHOTOGRAPHS:

ROOM NO. 117

N. WINDOW - INFILL

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: 118 LAST KNOWN USE: ? SQUARE FEET: 275 CEILING HEIGHT: 18'-2" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 S [ ] 1939-Present	(S WALL BUILT IN 1924) NE CORNER - 50% GONE
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED T.C. & UNDERCOAT PLASTER
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	3 OPENINGS - DOUBLE DOORS W. - 1 DOOR MISSING N. & E. - SAME - SOLID E. - RT. DOOR - CAFE TYPE
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed 1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CEILING MOUNT - CENTER
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	2 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 118

VIEW NE

VIEW SW

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 17?

ROOM NO: 119 LAST KNOWN USE: ? SQUARE FEET: 902 CEILING HEIGHT: 18'-2" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	HEAVY DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	CEMENT PLASTER - 7'-7" h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	S. WALL ADDED IN 1924 S. - PLASTER DESTROYED W. - FAIR N & E - GOOD - PP COLUMNS - METAL CASINGS - 7'-7" h.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	OVER 70% DESTROYED
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneers ☒ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☒ 1939-Present	W - G.M. - LEFT DOOR OF DOUBLE - CAFE - W/ SHELF - CORRODING S - WARPED, DELAMINATING (WAS DOUBLE DOOR BELOW WINDOW ON EAST WALL - FILLED IN - 1934)
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact 9 Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	9 DROP CORDS REMAIN
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	W.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 119

VIEW NE

S. WALL

VIEW N.W.

W. DOUBLE DOOR

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: 120 LAST KNOWN USE: ? SQUARE FEET: 354 CEILING HEIGHT: 18'-5" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	CEMENT PLASTER WAINSCOT 7'-7" h. ON S, E, PART OF N.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NE CORNER - T.C. EXPOSED PLASTER INTACT ELSEWHERE PP
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NE CORNER — 3 SQ FT. GONE
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ? ☐ 1939-Present	GRILLE OVER METAL LOUVERED UPPER PANEL - BRASS HINGES
LIGHTING:	☒ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☒ 1 Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	SUSPENDED BULB W/ BRASS HOOD INTACT — GLOBE MISSING
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	N.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	SOFA, TABLE
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 120

VIEW N.E.

VIEW S.W.

ELLIS ISLAND EXISTING CONDITION SURVEY BAGGAGE & DORMITORY page: 176

ROOM NO: 121 LAST KNOWN USE: STAIR HALL SQUARE FEET: 448 CEILING HEIGHT: DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☒ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	VERY FEW MISSING TILES - E.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	SE CORNER - FLAKING W. WINDOW INFILL - LAYERS FLAKING
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	OVER 50% DESTROYED
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer S. ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	SOME WARPING AT BASE WOOD INFILL AROUND OPENING FOR NEW DOOR
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	CEILING MOUNT
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	1 - W. 1 - N.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 121

VIEW N.W.

VIEW NE. - 503

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: 122 LAST KNOWN USE: DRILL RM. SQUARE FEET: 4,440. CEILING HEIGHT: 18'-10" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	50% VISIBLE - MINIMAL CRACKING WOOD FLOOR - UPPER LEVEL OF SW ENCLOSURE
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	LIMESTONE BASE ON S. & PART OF E. (ORIGINAL EXTERIOR)
WALLS:	☐ Plaster ☐ Gypsum Board ☒ Partitions WOOD & GRILLE ☒ Other: BRICK	☒ Good BRICK ☒ Fair GRILLES ☐ Poor G ☐ Destroyed	☒ 1909-1912 S. & E. ☒ 1913-1923 N. & W. ☐ 1924-1938 ☒ 1939-Present PART. & GRILLE	S. & PART E. - ORIGINAL EXT. BRICK WALLS E. WINDOW OPENING FILLED IN - DOOR E. PARTITION - VERTICAL PAINTED PLANK PARTITION PERP. TO E. - PLYWOOD & STUD DIAMOND WIRE GRILLE - ACROSS N. & SW CORNER
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	PARGED CONCRETE & BEAMS SPOT FLAKING & CRACKING OF FINISH RE-BARS EXPOSED IN SMALL AREA
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☒ Other: GRILLE	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	N. - DOUBLE EXT. WOOD - 1 WIRE GLASS - 1 INFILLED W/ WOOD - LOWER G.M. PANELS W. - DOUBLE DOORS - LOWER G.M. PANELS E. - G.M. IN PREVIOUS WINDOW OPENING GRILLE DRS. TO ENCLOSURES - UPPER DECK - WOOD DOOR
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☒ Incandescent/Type C ☐ Other:	0 Intact ☐ Destroyed 18 Intact ☐ Destroyed 1 Intact ☐ Destroyed Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	15 - CEILING MOUNTED RLM 3 - CHAIN SUSPENDED 1 - 'VAPORTIGHT' - CAST METAL GUARD
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☒ Intact ☐ Destroyed Intact ☐ Destroyed Intact ☐ Destroyed Intact ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	2 SECTIONAL ON N. WALL CEILING HUNG PARALLEL PIPE CLUSTERS ALONG W & N WALLS
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	IRON COTS STACKED IN SW CAGE WOOD STEPS TO SECOND LEVEL OF WIRE ENCLOSURE - "PLUMBER'S SHOP" SIGN
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 1913-14 ☒ 1913-1923 ADDITION ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 122

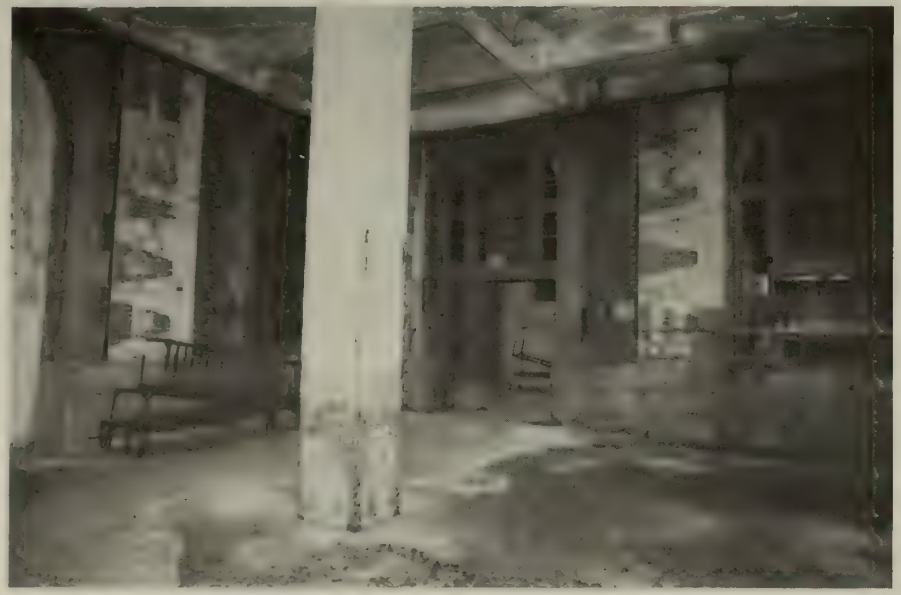

S.E. CORNER

N.W. CORNER

E. WALL - INFILLED WINDOW

VIEW W. FROM DOORWAY TO RM. 123

PHOTOGRAPHS: ROOM NO. 122

VIEW N.

VIEW S. OF UPPER DECK - SW CORNER

VIEW N. FROM INSIDE MESH ENCLOSURE OF SW CORNER

PHOTOGRAPHS:

ROOM NO. 122

WOOD STAIR TO UPPER DECK

LOWER LEVEL MESH DOOR

WOOD DOOR AT UPPER DECK

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 182

ROOM NO: 123 LAST KNOWN USE: REC. PORCH SQUARE FEET: 3,505 CEILING HEIGHT: 18'-10" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS - 30% VISIBLE
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	LIMESTONE BASE OF S ORIGINAL EXTERIOR WALL
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions ☒ Other: BRICK	☒ Good ☒ Fair PLASTER ☐ Poor ☐ Destroyed	☒ 1909-1912 S ☒ 1913-1923 N ☐ 1924-1938 ☒ 1939-Present E & W	BRICK - N & S W & E - BOARD & BATTEN NE RAMP WALL - PLASTER CAST IRON COLUMNS - CORROSION
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	PARGED CONCRETE + STEEL BEAMS FLAKING
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	RAMP - DOUBLE DR. - UPPER PANELS FILLED IN W/ WOOD - 4 - 12 LIGHT PIVOTED TRANSOM WINDOWS
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 11 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	3 RLM's CHAIN SUSPENDED - N. END 8 RLM - CEILING MOUNTED
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☒ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☒ Intact ☐ Destroyed 2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	PARALLEL PIPE CLUSTERS - CEILING SUSPENDED ALONG N. & PART E. WALLS VENTILATOR FANS
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 123

VIEW S.W.

VIEW N.E.

VIEW OF W. PARTITION

E. WALL PARTITION

PHOTOGRAPHS:

ROOM NO. 123

S. WALL

S. WALL AT ENTRY TO RM. 122

ROOM NO: 124 LAST KNOWN USE: RAMP SQUARE FEET: 145 CEILING HEIGHT: 18'-10" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	CONCRETE WITH CAP OF STEEL ANGLE IRON HORIZONTAL LINE FROM TOP OF RAMP
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	CEMENT PLASTER WEST WALL - FINISH HAS DETACHED FROM TERRA COTTA BLOCK - BELOW DOOR HT.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	SMALL CRACK - WATER STAINING
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other: OVER WOOD	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	WARPED – W. SIDE OF DOUBLE DOOR OFF HINGE SURFACE CORRODED WOOD INFILL COPPER PANELS
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact 2 Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	1 RLM - CEILING MOUNTED 2 HOLES
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 1913-14 ☐ 1924-1938 ADDITION ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 124

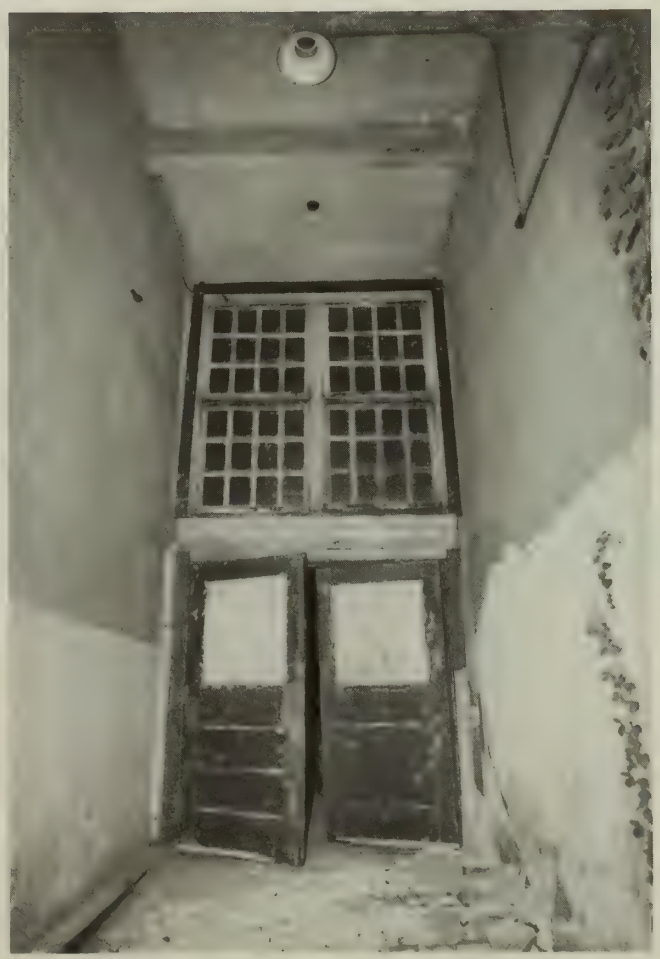

VIEW S.

ROOM NO: 125 LAST KNOWN USE: REC. PORCH SQUARE FEET: 4,092 CEILING HEIGHT: 18'-10" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS E. END VISIBLE
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 S ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	LIMESTONE BASE - S.
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions WOOD ☒ Other: BRICK	☒ Good BRICK & WOOD ☒ Fair PLASTER ☐ Poor ☐ Destroyed	☒ 1909-1912 S ☒ 1913-1923 N & E ☐ 1924-1938 ☒ 1939-Present W.	NE CORNER - PLASTER - POWDERY AT OPENINGS W - WOOD & STUD
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	DAMAGE ALONG N. WALL - FLAKING OF FINISH AT COLUMN JUNCTURES AND EXPOSING R-BARS
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	S - DOUBLE - SURFACE CORRODED - RT. SIDE OFF HINGES - UPPER PANEL - WOOD INFILL E. - DOUBLE
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☒ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 13 Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	CHAIN SUSPENDED - VARYING LENGTHS (2- CEILING MOUNTED) 1 VAPOR TIGHT W/ CAST METAL GUARD
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	PARALLEL PIPE CLUSTERS - CEILING MOUNT - N.E. & PART W.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	WALL GRAPHICS - SHIP NAVIGATIONAL CHART AND COMPASS PAINTED ON PLASTER - S. WALL - SIGNAL FLAGS & PENNANTS
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 125

VIEW S.W.

S. WALL TOWARD E.

VIEW TOWARD S.E.

VIEW N.E.

PHOTOGRAPHS: ROOM NO. 125

VIEW N.E.

N. WALL

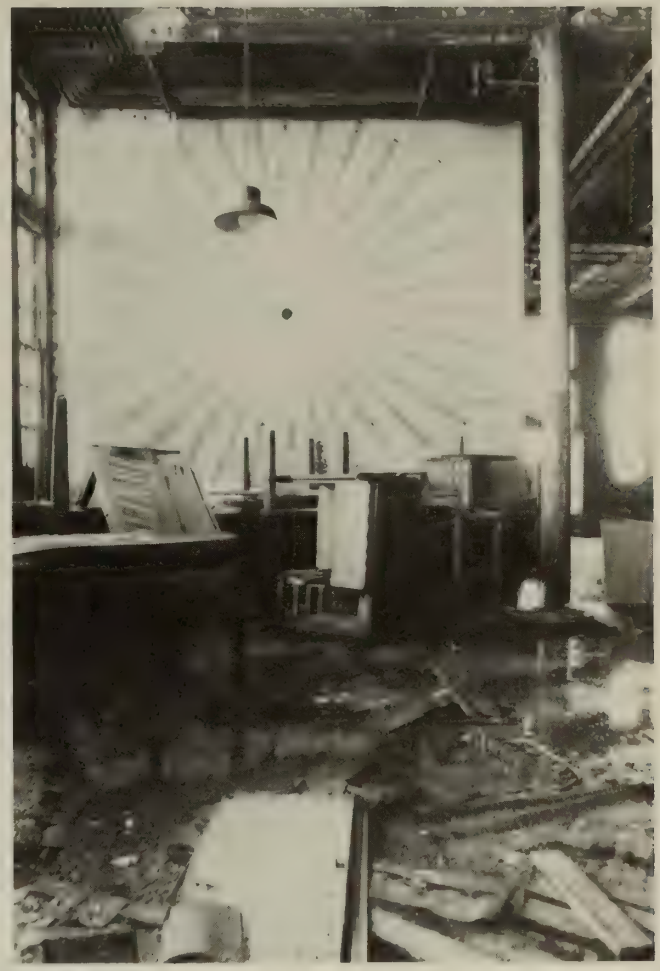

W. WALL OF RM. 126

PHOTOGRAPHS:

ROOM NO. 125

S. WALL - DOOR TO RM. 113

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 191

ROOM NO: 126 LAST KNOWN USE: RAMP SQUARE FEET: 145 CEILING HEIGHT: 18'-10" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS STEPS AT END HAVE DETACHED 2 WIDE CRACKS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	CONCRETE LEDGES CAPPED BY CORRODED STEEL ANGLE IRON
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	CEMENT PLASTER HORIZONTAL LINE AT LOWER PART OF WALLS – 2 DIF. APPLICATIONS = DIF. COLORS CRACKING
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other: OVER WOOD	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	OFF HINGE - WARPED BADLY CORRODED SURFACE - PITTED
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact 2 Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	1 RLM - CEILING MOUNTED 2 HOLES
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 1913-14 ADDITION ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 126

VIEW S.

VIEW S. FROM EXTERIOR

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 193

ROOM NO: 127 LAST KNOWN USE: ARMORY (?) SQUARE FEET: 363 CEILING HEIGHT: 18'-10" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile Vinyl Concrete X Other: WOOD	Good Fair Poor X Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	ROTTED THROUGH
BASE:	X Wood Tile Tile Wainscot Other:	Good Fair Poor X Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	DISINTEGRATED
WALLS:	X Plaster Gypsum Board Partitions Other:	Good Fair X Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	N & E – EXPOSED T.C. BLOCK S & W – CRUMBLING AT BASE PICTURE MOLDING (WOOD) - W & S WALLS APPROX. 15' HT.
CEILING:	X Plaster Acoustic panels Cove Other	X Good Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	FLAKING ABOVE HEAT PIPES - N & E
DOORS/ OPENINGS:	Wood/Glass Panelled Wood Veneer X Galvanized Metal Other:	Good Fair X Poor Destroyed	1909-1912 1913-1923 X 1924-1938 1939-Present	SURFACE CORRODED UPPER PANE - GLASS
LIGHTING:	Incandescent/Type A X Incandescent/Type B Incandescent/Type C Other:	Intact 2 Destroyed Intact 2 Destroyed Intact Destroyed Intact Destroyed	Pre-1924 X Post-1924 In Question	WHITE METAL RLM WITH BLUE GLASS GLOBE
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans X Sink/Toilet/Urinal Other:	Intact Destroyed Intact Destroyed Intact 1 Destroyed Intact Destroyed	1909-1912 X 1913-1923 1924-1938 X 1939-Present	PARALLEL PIPE CLUSTERS – CEILING HUNG - N & E WALL-MOUNTED SINK - S. WALL
MISCELLANEOUS:		Good Fair Poor Destroyed	1909-1912 1913-1923 1924-1938 1939-Present	MISC. KITCHEN EQUIPMENT METAL TABLES, BASIN UTENSILS
SUMMARY:		Good Fair X Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS:

ROOM NO. 127

VIEW S.W.

VIEW N.E.

ROOM NO: 128 LAST KNOWN USE: TOILET SQUARE FEET: 445 CEILING HEIGHT: 18'-4½" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 1935 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Partitions METAL ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NE + E - DESTROYED S - LARGE AREAS OF FINISH LAYER GONE PARTITIONS - HEAVILY CORRODED
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	EXPOSED T.C. BLOCK OVER 80% PLASTER GONE
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	4 WOOD PANELS NO HANDLE OR LOCK 3-LIGHT TRANSOM
LIGHTING: ?	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact 2 Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	2 SUSPENDED CAMPS - 1 BRASS HOOD INTACT
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☒ ~~Sink/Toilet/Urinal~~ ☒ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present 1940	1 SECTIONAL 4 SINKS, 12 TOILETS, 4 URINALS 1 SLOP SINK
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 128

VIEW S.W.

VIEW N.E.

VIEW E.

ELLIS ISLAND **EXISTING CONDITION SURVEY** **BAGGAGE & DORMITORY** page: 197

ROOM NO: 129 LAST KNOWN USE: CLOSET UNDER STAIR SQUARE FEET: 40 CEILING HEIGHT: UNDER 502 DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NO
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	PP
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	SLOPES
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	WALL MOUNTED - LAMP
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. 129

N.- DOOR TO CLOSET

356 | 26,006 / 15 of 34
DSC | JUL 88

Exhibit 18

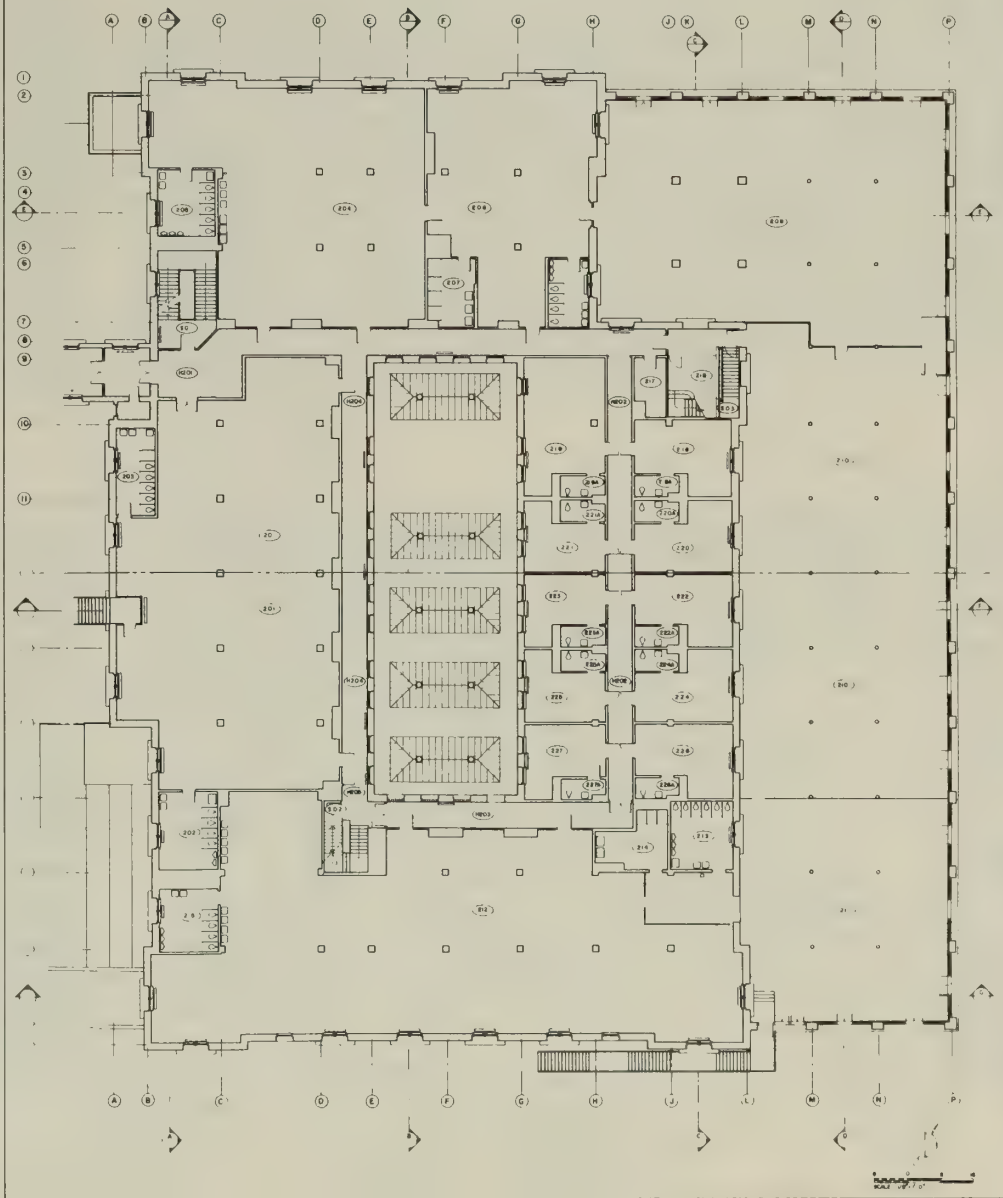

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD

80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | shl | REVISIONS | date init

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAGGAGE & DORMITORY
2nd FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET
OF

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 200

ROOM NO: 201 LAST KNOWN USE: INTERVIEW ROOM SQUARE FEET: 4,517 CEILING HEIGHT: 12' DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7' h. FEW MISSING ON COLUMNS
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [X] Other: ACOUSTIC TILE	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	S & W - PLASTER DETERIORATING MOST ACOUSTIC TILE FALLEN OFF ON S & W
CEILING:	[X] Plaster [X] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	MOST ACOUSTIC PANELS FALLEN OFF PLASTER DESTROYED ALONG W. & SE WALL AND AROUND 2 SW COLUMNS
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	W. — 1935 N (2) & W. — METAL COVERED WOOD - 1 WIRE-GLASS LT. OVER 3 RECESSED PANELS
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	2 Intact / 7 Destroyed [ ] Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	2 GLOBES INTACT REST - CHAINS & HOODS
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	4 Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SECTIONAL
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MATTRESSES / COTS
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 201

VIEW NE

VIEW NW

VIEW SW

S. WALL - WOOD VESTIBULE FOR EXTERIOR STAIR

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 202

ROOM NO: 202 LAST KNOWN USE: TOILET SQUARE FEET: 256 CEILING HEIGHT: 12' DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions MARBLE [ ] Other:	[ ] Good [X] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N+S DESTROYED W. — BUCKLING - TO SCRATCH COAT
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DESTROYED SW ALONG WALL + NW CORNER SCRATCH COAT EXPOSED
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	PP CORRODED SURFACE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	CEILING MOUNTED BULB
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: 1 SLOP SINK	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed 1931	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	4 LEG SECTIONAL 1 WALL METAL VENT - E. ~1931 2 SINKS (NO HARDWARE) 4 TOILETS 2 URINALS - 1931
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 202

VIEW S.E.

VIEW S.W.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 204

ROOM NO: 203 LAST KNOWN USE: TOILET ADDED - 1924 SQUARE FEET: 196 CEILING HEIGHT: 12' DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	MISSING - SW CORNER 7' h.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions MARBLE [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 S [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	6 TOILET PARTITIONS - METAL LEGS 50% T.C. BLOCK EXPOSED BUCKLED
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	50% DESTROYED INCLUDING HANGING FRAME REMAINDER - OUTER LAYER GONE
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	6 PANEL - WOOD TOILET STALL DOORS - VENEER VENEER WARPED, SOME BROKEN
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L. - PORCELAIN MOUNT
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: SLOP SINK	1 [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed 1 [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	S. WALL - 6 LEG SECTIONAL 7 TOILETS, 2 PEDESTAL SINKS
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 203

VIEW W.

VIEW E.

TOILET DOOR

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 206

ROOM NO: 204 LAST KNOWN USE: DORMITORY SQUARE FEET: 1,245 CEILING HEIGHT: 11'-11" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Concrete Other:	Good Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	DEBRIS
BASE:	Wood Tile X Tile Wainscot Other:	X Good Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	7'-1"h. FEW MISSING - W.
WALLS:	X Plaster Gypsum Board Partitions Other:	Good X Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	MAJORITY W. - EXPOSED T.C.
CEILING:	X Plaster Acoustic panels Cove Other	Good X Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	SMALL COVE TO CEILING EXPOSED HANGERS ALONG W. WALL
DOORS/ OPENINGS:	Wood/Glass Panelled Wood Veneer X Galvanized Metal Other: OVER WD.	Good X Fair Poor Destroyed	1909-1912 1913-1923 X 1924-1938 1939-Present	(4) 3 WOOD PANELS - 1 LIGHT PP N+E - 1935
LIGHTING:	Incandescent/Type A Incandescent/Type B X Incandescent/Type C Other:	Intact / Destroyed Intact / Destroyed 4 Intact / Destroyed Intact / X Destroyed	Pre-1924 X Post-1924 In Question	10 CEILING MOUNT SOCKETS NO LAMPS 4 METAL DIRECTIONAL SHADES AT PERIMETER
HEATING/ VENTILATION PLUMBING:	X Radiators X Vents/Fans X Sink/Toilet/Urinal X Other: 3 SLOP SINKS 1- DRINKING FOUNTAIN	4 Intact / Destroyed Intact / Destroyed X Intact / Destroyed X Intact / Destroyed	X 1909-1912 1913-1923 X 1924-1938 1939-Present	1931 - 3 SINKS w/ PEDESTAL (PORCELAIN) 3 DEEP SLOP SINKS - NO FAUCETS 1934 - 1 VENT - N. WALL - SQ. METAL GRATE
MISCELLANEOUS:		Good Fair Poor Destroyed	1909-1912 1913-1923 1924-1938 1939-Present	
SUMMARY:		X Good Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / Minor / Negligible

PHOTOGRAPHS:

ROOM NO. 204

VIEW S.

S.E. CORNER

VIEW S.W.

VIEW E.

PHOTOGRAPHS:

ROOM NO. 204

VIEW NW CORNER

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 209

ROOM NO: 205 LAST KNOWN USE: TOILET SQUARE FEET: 188 CEILING HEIGHT: 11'-11" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	DEBRIS - 1 FLOOR DRAIN HEX 1930 RENEWAL OF TILE
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S WALL - MISSING 40%
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions MARBLE [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. - EXPOSED T.C. 5 TOILET PARTITIONS
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED LATH + HANGERS
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 C.M.L.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: SLOP SINK	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [1] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	4 LEG SECTIONAL - S. WALL 1931 FIXTURES - 2 PEDESTAL SINKS, (1 DESTROYED) 5 TOILETS, 3 URINALS 1 SLOP SINK - CORRODING
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 205

VIEW S.E.

VIEW NW

TOILET STALL

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 211

ROOM NO: 206 LAST KNOWN USE: DETENTION SQUARE FEET: 1,853 CEILING HEIGHT: 11'-11" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	50% VISIBLE MINOR CRACKING
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7' ½" h. CHIPPING. N. SECTION & 5' SECTION ON W. WALL - TILES GONE
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DESTROYED ALONG W. & N WALL EXPOSED T.C. BLOCK S & E. - MINIMUM PEELING
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	ALONG W & N WALLS - LATH HANGING + FRAME EXPOSED
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	S. - 1935 3 WOOD PANELS - UPPER LIGHT VENEER WORN - DELAMINATING
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	1 Intact / 10 Destroyed [ ] Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	1 INTACT GLOBE REST - GLOBES BROKEN - CHAINS + HOOKS REMAIN
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [X] Other: WATER FOUNTAIN	3 Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	6 LEG SECTIONAL S. WALL PORCELAIN FOUNTAIN - NO HANDLE OR SPOUT
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 206

VIEW N.

VIEW S.W.

VIEW N.W.

VIEW E.

ROOM NO: 207 LAST KNOWN USE: WASH ROOM 1934 SQUARE FEET: 183 CEILING HEIGHT: 11'-11" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	1934 - 7'-½" (N+W)
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	1934 - N+W WALLS BUILT POWDERY ON W. WALL
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	LARGE OBLONG OF PLASTER GONE - EXPOSED LATH
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	SINGLE GLASS LIGHT
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	C.M.L.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: SHOWERS	[ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	FIXTURES-1931 GRILLE- E. WALL 3 DEEP PORCELAIN WASH SINKS (DOUBLE) NO FAUCETS GALV. METAL ENCLOSED SHOWERS
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	(NUMBER STENCILED OVER DOOR - "BD 211")
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 207

VIEW N.W.

VIEW E.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 215

ROOM NO: 208 LAST KNOWN USE: TOILET (ORIGINAL) SQUARE FEET: 156 CEILING HEIGHT: 11'-11" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	DEBRIS RETILED IN 1931
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	7'-½" h. SECTION MISSING UNDER N. WINDOW
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions MARBLE [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	TOILET PARTITIONS - 1931 (4) N. WALL - DESTROYED PLASTER
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	REPLASTERED 1931 75% DESTROYED - N. SIDE - HANGING METAL LATH
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: / SLOP SINK	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [X] 1939-Present VENT	4 LEG SECTIONAL - N. WALL CORRODED 1 VENT - CEILING - WOOOD LOUVERS FIXTURES - 1931 - 4 TOILETS, 3 URINALS, 3 PEDESTAL SINKS 1 SLOP SINK
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 208

VIEW E.

VIEW N.W.

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 217

ROOM NO: 209 LAST KNOWN USE: REC. PORCH 1913-14 ADDITION SQUARE FEET: 4,590. CEILING HEIGHT: 16'-2" DATE: 8/8/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	9"x6" RED QUARRY TILE DEPOSITS OF DISSOLVED LIME FROM CEILING HARDENED
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	COPPER FLASHING - ALL WALLS (PERIMETER BRICK)
WALLS:	[ ] Plaster [ ] Gypsum Board [X] Partitions WOOD-E. [X] Other: BRICK	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [X] 1939-Present	PP - PARTITION - E. BRICK - S. PART E - ORIGINAL EXTERIOR W & N - 1913-14 ADDITION SQUARE COLUMNS - S. END - CORNER ANGLE IRONS
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PARGED CONCETE - WOOD FORMED E-BARS EXPOSED & CONCRETE CHIPPED OFF LAST S. I-BEAMS - LARGER & EXPOSED (ORIGINAL)
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	S. - 3 WOOD PANELS - UPPER LIGHT
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L. - 14
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WALL-BASE MOUNTED PARALLEL PIPE CLUSTERS -
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 209

VIEW S.

VIEW E. - ORIGINAL EXTERIOR WALL

VIEW N.

VIEW E. - PARTITION

PHOTOGRAPHS:

ROOM NO. 209

VIEW SW

VIEW NW

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 220

ROOM NO: 210 LAST KNOWN USE: REC. PORCH 1913-14 ADDITION SQUARE FEET: 5,457 CEILING HEIGHT: 16'-2" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	9"X6" RED QUARRY
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
WALLS:	[ ] Plaster [ ] Gypsum Board [X] Partitions - WOOD [X] Other: BRICK	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [X] 1939-Present	ROUND COLUMNS - SURFACE CORRODED W. & E. - HORIZONTAL WOOD BOARD N. & S. - BRICK NW WOOD ENCLOSURE - "BD215"
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WOOD - FORMED CONCRETE WITH A PARGING OF CEMENT PLASTER SOME SPALLING - BEAMS EXPOSED AT EACH PIPE HANGER
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [X] Other: SOLID WOOD	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	S. & W. - WOOD PARTITION DOOR W. - PLY VENEER - NO OPENINGS GRAFITTI SCRATCHED IN - ILLEGIBLE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L. 3 WITH METAL STRAP GUARDS
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N & S PERIMETER PARALLEL 8-PIPE CLUSTERS - WALL MOUNTED
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	GRAFITTI ON W. DOOR LINE FACE + CURSIVE ENGLISH
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 210

VIEW S.E.

VIEW E.

VIEW N.E. - PARTITION

VIEW N.E.

PHOTOGRAPHS: ROOM NO. 210

VIEW W.

VIEW W. FROM E. END

WOOD ENCLOSURE - NW CORNER

ELLIS ISLAND **EXISTING CONDITION SURVEY** **BAGGAGE & DORMITORY** page: 223

ROOM NO: 211 LAST KNOWN USE: REC. PORCH 1913-14 ADDITION SQUARE FEET: 2,597 CEILING HEIGHT: 16'-2" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	9"X6" RED QUARRY STAINING WATER - NW CORNER
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
WALLS:	[ ] Plaster [ ] Gypsum Board [X] Partitions WOOD [X] Other: BRICK	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [X] 1939-Present W.	W. - WOOD PARTITION N, E, S - BRICK (S.-ORIGINAL) E. - BREAK IN MORTAR ALONG LINTEL LINE - PIER CRACKING BELOW LINE
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	FORMED CONCRETE - PARGED W/ CEMENT PLASTER S. - EXPOSED RE-BARS - SPALLING BEAM CORROSION AT PIPE HANGERS
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: SOLID	[X] Good W. - [ ] Fair [X] Poor - E. [X] Destroyed - S	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	W. - SOLID - 3" THK - PLANK E. - 4 LIGHT - 2 WOOD PANELS - 1 MISSING - RAW WOOD S. - G.M. - DESTROYED
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	9 C.M. SOCKETS - METAL 5 METAL STRAP GUARDS INTACT OVER SOCKETS
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N, E + S - WALL MOUNTED - PARALLEL 8-PIPE CLUSTERS NW CORNER - BROKEN PIPES
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	GRAFITTI - S WALL ON QUOINS
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 211

S. WALL

NE CORNER

VIEW S.E.

VIEW NW

PHOTOGRAPHS:

ROOM NO. 211

WEST PARTITION WALL

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 226

ROOM NO: 212 LAST KNOWN USE: DETENTION SQUARE FEET: 6,101 CEILING HEIGHT: 12' DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7'-½" h. LARGE SECTIONS MISSING- N. S & E
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions WOOD VENEER [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	T.C. BLOCK EXPOSED ON E. S. & NE WOOD VENEER & GLASS ENCLOSURE AT N. DOOR - WARPED - POOR
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SW CORNER DESTROYED - AND ALONG E. WALL
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal N [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	W.-(2) N.- METAL PANEL OVER WOOD UPPER WIRE GLASS S.- METAL COVERED WOOD - 3 RECESSED PANELS - GRILLE - METAL DISINTEGRATED N.- DOOR ON FLOOR - CORRODED TOTALLY
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	26 Intact / 4 Destroyed [ ] Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CHAIN SUSPENDED WHITE GLOBES BRASS GLOBE HOODS REMAIN WHERE GLOBE DESTROYED
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	8 Intact / [ ] Destroyed [ ] Intact / [ ] Destroyed 8 Intact / 1 Destroyed [ ] Intact / [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 1931 [ ] 1939-Present	6 LEG SECTIONAL - 1-N., 1-S., 6-E. S.- 8 PEDESTAL SINKS, 1 ON FLOOR BROKEN
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 212

ENTRY - VIEW S.E.

VIEW N.

VIEW OF N. END

VIEW S.E. CORNER

PHOTOGRAPHS: ROOM NO. 212

VIEW W.

ROOM NO: 213 LAST KNOWN USE: TOILET (ORIGINAL) SQUARE FEET: 240 CEILING HEIGHT: 12' DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	DEBRIS RETILED - 1931 - WHITE HEX
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	N. WALL - DESTROYED RETILED - 1931
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions MARBLE [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	REPLASTERED - 1931 DESTROYED TO T.C. - N. + PART W. 6 PARTITIONS - METAL LEGS + ROD
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	OVER 50% DESTROYED REPLASTERED - 1931
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE - (REMOVED)
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: 1 SLOP SINK	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [1] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 - 1931 [ ] 1939-Present	N. + PEDESTAL 2 SINKS, 6 TOILETS, 3 URINALS (FLOOR TYPE)
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 213

NE CORNER

S. WALL

SW CORNER - MARBLE PARTITIONS

ROOM NO: 214 LAST KNOWN USE: SHOWER & LAUNDRY SQUARE FEET: 188 CEILING HEIGHT: 12' DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	1934 - NEW LAUNDRY & SHOWER RM.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions METAL [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	SHOWER PARTITIONS - 3 UNIT ENCLOSED W. - EXPOSED T.C. - REMAINDER PEELING
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SECTION OVER SHOWER - DESTROYED (15%) REST PEELING
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
LIGHTING:	[X] Incandescent/Type A 1 Intact 1 Destroyed [ ] Incandescent/Type B [ ] Intact [ ] Destroyed [ ] Incandescent/Type C [ ] Intact [ ] Destroyed [ ] Other: [ ] Intact [ ] Destroyed		[ ] Pre-1924 [X] Post-1924 [ ] In Question	1 GLOBE INTACT - 1 DESTROYED DROP CORDS
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: SHOWER	[ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	3 STALL SHOWER UNIT - 1934 2 DOUBLE PEDESTAL DEEP WASH SINKS WALL VENT - W. CEILING VENT - S.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 214

S.W. CORNER

S. END WALL

ROOM NO: 215 LAST KNOWN USE: TOILET (ORIGINAL) SQUARE FEET: 205 CEILING HEIGHT: 11'-11" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	DEBRIS WHITE HEX RETILED - 1931
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	7'-½" h. 5 MISSING TILES - S. WALL RETILED - 1931
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions MARBLE [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	S. - T.C. & BASE COAT EXPOSED 4 TOILET PARTITIONS - WOOD ENDS, METAL LEGS & ROD
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	REPLASTERED - 1931 SW CORNER - DESTROYED - 3' AREA BULGING - EXPOSED BASE COAT
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DOOR OPENING MOVED FROM E. WALL TO N. IN 1934 NO DOOR REMAINS
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	GLOBE GONE - CHAIN & HOOD INTACT
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SECTIONAL - S. WALL 2 PEDESTAL SINKS - 1 ON FLOOR 3 WALL URINALS, 4 TOILETS
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 215

S. WALL FROM DOORWAY

NW CORNER

TOILET PARTITIONS

ROOM NO: 216 LAST KNOWN USE: PASSAGE & LANDING SQUARE FEET: 238 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Concrete Other:	X Good Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	HEX
BASE:	Wood Tile X Tile Wainscot - S+W Other:	X Good Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	5'-1"
WALLS:	X Plaster Gypsum Board X Partitions WIRE MESH Other:	Good X Fair Poor Destroyed	X 1909-1912 X 1913-1923 1924-1938 1939-Present	PP WIRE MESH & PIPE - CORRODED ON N AND AT WEST TO ENCLOSE STAIR
CEILING:	X Plaster Acoustic panels Cove Other	X Good Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	PP
DOORS/ OPENINGS:	X Wood/Glass Panelled Wood Veneer X Galvanized Metal N. X Other: WIRE MESH	Good Fair X Poor Destroyed	1909-1912 X 1913-1923 X 1924-1938 1939-Present	N. - G.M. - UPPER GRILLE PANEL S. - 1 OF 3 WOOD PANELS GONE MESH OFF HINGES - CORRODED
LIGHTING:	X Incandescent/Type A Incandescent/Type B Incandescent/Type C Other:	Intact 2 Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	Pre-1924 X Post-1924 In Question	
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans Sink/Toilet/Urinal Other:	X Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	4 LEG SECTIONAL - W.
MISCELLANEOUS:		Good Fair Poor Destroyed	1909-1912 1913-1923 1924-1938 1939-Present	
SUMMARY:		Good X Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS:

ROOM NO. 216

W. WALL - WIRE MESH ENCLOSURE

N. WALL

NE - STAIR (503)

ROOM NO: 217 LAST KNOWN USE: SUPPLY CLOS. SQUARE FEET: 112 CEILING HEIGHT: 12' DATE: 8/23/04

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP VERTICAL PIPES - E. WALL
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SW CORNER - OPENING
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	4 WOOD PANELS
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [X] Other: SLOPSINK	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	CORRODED - HARDWARE INTACT
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	ARMOIRE
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 217

ROOM NO: 218 LAST KNOWN USE: FAMILY RM. SQUARE FEET: 353 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NE CORNER - EXPOSED T.C. N. - WINDOW
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DESTROYED ALONG N.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	UPPER GRILLE - GONE SOLID WOOD
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CHAIN & HOOD
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	4 LEG SECTIONAL - N. VENT TO N. WALL - 218A
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISC. COTS, CHAIRS
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 218

VIEW SOUTH

NORTH WALL

ROOM NO: 218A LAST KNOWN USE: TOILET SQUARE FEET: 53 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	2 LT. WINDOW WITH INSIDE GRILLE - N.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	1 VENT - N. WALL - 1-SINK (1930'S) 1-TOILET
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 218A

S.E. CORNER

ELLIS ISLAND **EXISTING CONDITION SURVEY** **BAGGAGE & DORMITORY** page: 243

ROOM NO: 219 LAST KNOWN USE: FAMILY ROOM SQUARE FEET: 576 CEILING HEIGHT: (2' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX FLOOR DRAIN NEAR DOOR
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. - 75% DESTROYED REST - O.K. - SOME STAINING 5'-1" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. - DESTROYED, EXPOSED T.C. REST - FLAKING
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HANGING LATH - EXPOSED METAL HANGERS
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	GONE
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [2] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CHAINS & BRASS HOODS
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[2] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. WALL - SECTIONAL VENT IN WAINSCOT (S. WALL OF 219A)
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 219

WEST WALL

LOOKING EAST

ELLIS ISLAND **EXISTING CONDITION SURVEY** **BAGGAGE & DORMITORY** page: 245

ROOM NO: 219A LAST KNOWN USE: TOILET SQUARE FEET: 53 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N. - WINDOW W/ GRILLE
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/~~Fans~~ [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	1 WALL VENT - S. WALL 1 TOILET 1930'S SINK - SQ. PEDESTAL
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

ELLIS ISLAND EXISTING CONDITION SURVEY BAGGAGE & DORMITORY page: 246

ROOM NO: 220 LAST KNOWN USE: FAMILY ROOM SQUARE FEET: 323 CEILING HEIGHT: 12' DATE: 8/23/04

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS HEX FLOOR SLOPES TO DRAIN
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING SOME IN NW CORNER 5'-1" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PAIR - DOUBLE-HUNG WINDOWS - N. WALL - 4/1 WITH 2-LIGHT TRANSOMS EXPOSED T.C. - N. WALL
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	WIRE GRILLE OVER UPPER OPENING - REMOVED
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CHAIN + BRASS HOOD
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	4 LEG SECTIONAL - N. N. WALL OF 220A
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS:

ROOM NO. 220

VIEW S.W.

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 248

ROOM NO: 220A LAST KNOWN USE: TOILET SQUARE FEET: 53 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. WALL - WINDOW TO HALL W/ WIRE GRILLE ON INSIDE 2 LIGHTS
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	OUTLET W/ 2 PRONGED PLUG 1 BULB
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [/] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [X] 1939-Present	1 VENT IN N. WALL 1 TOILET 1 SINK - PIPE LEGS - 1940's
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 220A

VIEW S.W.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 250

ROOM NO: 221 LAST KNOWN USE: SQUARE FEET: 261 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" H.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	2 SECTIONS - SOUTHERN END EXPOSED LATH
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	UPPER GRILLE MISSING
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CHAIN + BRASS HOOD
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. WALL - 4 LEG SECTIONAL
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 221

VIEW NW

VIEW SOUTH

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 252

ROOM NO: 221A LAST KNOWN USE: TOILET SQUARE FEET: 53 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	CRACK IN SW CORNER 5'-1" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N. — 2 LT. WINDOW WITH INSIDE GRILLE
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	1 SQ. PEDESTAL SINK 1 TOILET
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	" BD 248" STENCILED OVER DOOR
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 221A

S.W. CORNER

ELLIS ISLAND EXISTING CONDITION SURVEY BAGGAGE & DORMITORY page: 254

ROOM NO: 222 LAST KNOWN USE: FAMILY ROOM DORM SQUARE FEET: 323 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX FLOOR SLOPES TO DRAIN
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	T.C. & BROWNCOAT EXPOSED ON N. WALL PAIR OF 4/1 WINDOWS W/ 2 LT. TRANSOMS - N.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED LATH & FRAME - N. END
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	UPPER GRILLE MISSING
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [3] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	3 SUSPENDED HOODS ON CHAINS
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N. - SECTIONAL - 4 LEG WALL VENT ON N. WALL OF 222A
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 222

VIEW S.E.

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 256

ROOM NO: 222A LAST KNOWN USE: TOILET SQUARE FEET: 53 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	2-LT. PIVOTED WINDOW ON S. WALL W/ GRILLE
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NE CORNER - EXPOSED LATH
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	WALL OUTLET W/ LAMP
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	1 SQ. PEDESTAL SINK - 1930'S 1 TOILET
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MIRROR
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 222A

VIEW S.E.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: 223 LAST KNOWN USE: FAMILY ROOM SQUARE FEET: 262 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" FLOOR DRAIN
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED BROWN COAT - TOP OF S & W WALL
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SW CORNER - DISINTEGRATED TO FRAMEWORK - 10%
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	UPPER GRILLE INTACT SOLID WOOD DOOR
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [1] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	4 LEG. - S. WALL 1 WALL VENT - S. WALL OF 223A
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS:

ROOM NO. 223

VIEW S.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 260

ROOM NO: 223A LAST KNOWN USE: TOILET SQUARE FEET: CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX F
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	WALL VENT - S. WALL 1 SINK, 1 TOILET 1940's
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor

ROOM NO: 224 LAST KNOWN USE: FAMILY ROOM SQUARE FEET: 325 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" MISSING BY N. WALL WINDOW
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N. - T.C. BLOCK EXPOSED
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	FRAME EXPOSED AT N. END
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	GRILLE REMOVED FROM OPENING
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	1 SUSPENDED HOOD ON CHAIN 1 C.M. SOCKET
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	4 LEDS - N. WALLVENT (N. WALL OF 224A)
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 224

VIEW S.W.

VIEW NORTH

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 263

ROOM NO: 224A LAST KNOWN USE: TOILET SQUARE FEET: 53 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. WALL - WINDOW (2 LT.) WITH GRILLE ON INSIDE
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	C. M. SOCKET
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	1 SQ. PEDESTAL SINK - 1930'S 1 TOILET
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 224A

VIEW S.W.

ELLIS ISLAND **EXISTING CONDITION SURVEY** **BAGGAGE & DORMITORY** page: 265

ROOM NO: 225 LAST KNOWN USE: FAMILY ROOM SQUARE FEET: 262 CEILING HEIGHT: 12' DATE: 8/23/04

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DISCOLORATION ON S. WALL 5'-1"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. WALL DESTROYED TO T.C. REST - PP S. WINDOWS - 1/1 WOOD DOUBLE-HUNG
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. HALF DESTROYED - EXPOSED FRAME & NE CORNER - BROWN COAT
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SOLID WOOD UPPER GRILLE MISSING
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	BRASS HOOD ON CHAIN
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. WALL - 4 LEG - CORRODED 1 - SQ. PEDESTAL SINK 1 TOILET
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 225

VIEW N.W.

VIEW SOUTH

ROOM NO: 225A LAST KNOWN USE: TOILET SQUARE FEET: 53' CEILING HEIGHT: 12' DATE: 8/23/04

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N. WALL - WINDOW (2 LT.) W/ WIRE GRILLE INSIDE
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	2 VENTS - S. WALL 1 SQ. PEDESTAL SINK, 1 TOILET 1930's
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MIRROR
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 225A

VIEW S.W.

ELLIS ISLAND **EXISTING CONDITION SURVEY** **BAGGAGE & DORMITORY** page: 269

ROOM NO: 226 LAST KNOWN USE: FAMILY ROOM SQUARE FEET: 335 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Concrete Other:	X Good Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	HEX.
BASE:	Wood Tile X Tile Wainscot Other:	Good X Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	5'-1" h. NW CORNER - SOME MISSING TILE
WALLS:	X Plaster Gypsum Board Partitions Other:	Good X Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	EXPOSED T.C. - LARGE AREA - N. SOME AT NE & NW CORNERS
CEILING:	X Plaster Acoustic panels Cove Other	Good Fair X Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	NORTH HALF DESTROYED EXPOSED FRAME
DOORS/ OPENINGS:	Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	1909-1912 1913-1923 X 1924-1938 1939-Present	GRILLE REMOVED
LIGHTING:	Incandescent/Type A X Incandescent/Type B Incandescent/Type C Other:	Intact Destroyed 2 Intact Destroyed Intact Destroyed Intact Destroyed	Pre-1924 Post-1924 In Question	2 - RLM - 1 ON DROP CORD 1 ON CHAIN
HEATING/ VENTILATION PLUMBING:	X Radiators X Vents/Fans Sink/Toilet/Urinal Other:	1 Intact Destroyed X Intact Destroyed Intact Destroyed Intact Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	N. WALL - 4 LEGS. 2 VENTS (N. WALL OF 226A) WALL
MISCELLANEOUS:		Good Fair Poor Destroyed	1909-1912 1913-1923 1924-1938 1939-Present	
SUMMARY:		Good X Fair Poor Destroyed	X 1909-1912 1913-1923 1924-1938 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS:

ROOM NO. 226

VIEW S.E.

VIEW N.

ELLIS ISLAND **EXISTING CONDITION SURVEY** **BAGGAGE & DORMITORY** page: 271

ROOM NO: 226A LAST KNOWN USE: TOILET SQUARE FEET: 53 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	2-LT. PIVOTED WINDOW W/ GRILLE S. WALL TO HALL
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M. OUTLET
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed 2 Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	2-N. WALL VENTS 1-SQ. PEDESTAL SINK 1 TOILET
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 226A

VIEW S.E.

ROOM NO: 227 LAST KNOWN USE: FAMILY ROOM SQUARE FEET: 274 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" S. - FEW TILES MISSING DISCOLORED
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. & SW DESTROYED, EXPOSED T.C. FLAKING & SPALLING
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED METAL FRAMEWORK
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	MISSING GRILLE
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CHAIN SUSPENDED HOOD
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. WALL - 4 LEG.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 227

VIEW S.

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 275

ROOM NO: 227A LAST KNOWN USE: TOILET SQUARE FEET: 53 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	1 SQ. PED. SINK - 1930's 1 TOILET
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 227A

VIEW SE.

ROOM NO: H201 LAST KNOWN USE: HALLWAY SQUARE FEET: 887 CEILING HEIGHT: 12' DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX. DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot 5'-½" [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	E. - TILES MISSING ALONG WINDOW SILL LINE AND AT FLOOR GREEN DISCOLORATION & CHIPPED N. - BASE & CAP TILE MISSING
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SOUTHERN END - N, S, + 50% E. DESTROYED - EXP. T.C. E. - ALL EXPOSED T.C. BLOCK - SOME BLOCK POPPED OFF N. END - EXPOSED T.C. ON W. WALL
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED METAL FRAME AND BROWN COAT
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal OVER WOOD [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	W. WALL - (3) 1935 - 3 WOOD PANELS - UPPER LIGHT - WIRE GLASS SEE RMS. 201, 217, 216, 501
LIGHTING:	[X] Incandescent/Type A [X] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [5] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	HOODS ON CHAINS - GLOBES GONE 1 RLM AT S. END
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[2] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	CORRODED - E. & W. WALL
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H201

VIEW S.

S. END - SW CORNER

S. END - NE CORNER

PHOTOGRAPHS:

ROOM NO. H201

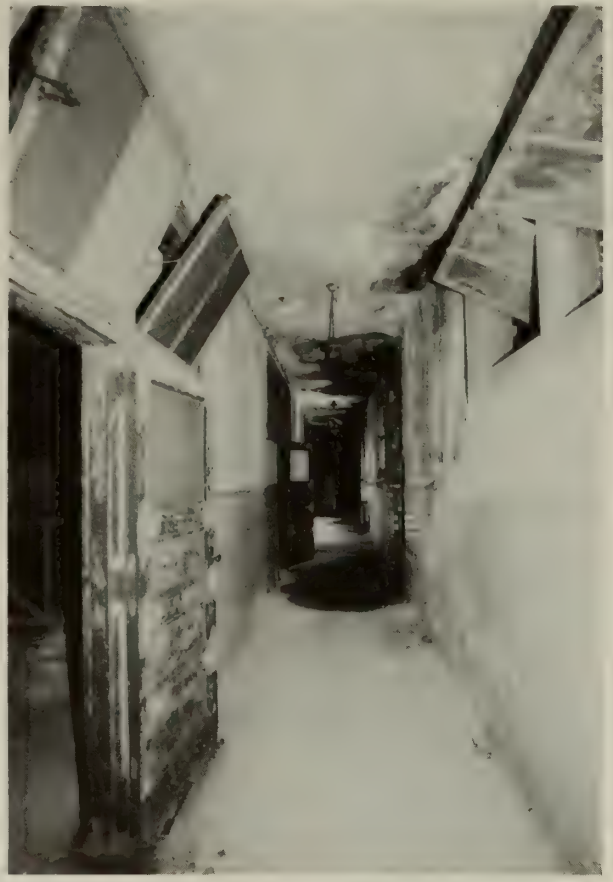

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 280

ROOM NO: H202 LAST KNOWN USE: HALLWAY SQUARE FEET: 6360 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MIN. EXPOSED T.C. ALONG TOP S. WALL
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	E END DESTROYED W. END POOR - EXPOSED BROWNCOAT
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: E. END	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SEE RMS. 218-227 WOOD DOUBLE SWING BRS. - METAL SHEETS APPLIED
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L. - (5)
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	FIRE HOSE - S. WALL
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H202

VIEW W. NEAR ROOM 221

VIEW W. NEAR 227

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 282

ROOM NO: H203 LAST KNOWN USE: SQUARE FEET: 357 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS - POOLS OF WATER
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" E. - DISCOLORED W. - MISSING 30% TILES
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N. - EXPOSED T.C. W. - DESTROYED - BLOCKS OUT - 1 WINDOW ON FLOOR S. - EXPOSED LATH
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED METAL FRAME
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	W. - (TO H202) G.M. - CORRODED DOUBLE DOOR S - DOUBLE - G.M. - CENTER LIGHTS
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L. (3) 1 WALL MOUNT OVER S. DOORS
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	W.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H203

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: H204 LAST KNOWN USE: HALLWAY SQUARE FEET: 576 CEILING HEIGHT: 12' DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" N.- LARGE SECTIONS DESTROYED - BUCKLING S.- DISCOLORATION
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N + SW - DESTROYED, EXPOSED T.C. - SOME BLOCK OUT S.-OUT
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	METAL FRAMEWORK ALSO FAILING
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	S.-(2) TO RM. 201 3 WOOD PANEL - UPPER GLASS 1 MISSING BOTTOM PANEL E- SEE H205
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	(6) C.M.L.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[3] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N. WALL - 4 LEG.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H204

VIEW E.

E. END DOOR

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 286

ROOM NO: H205 LAST KNOWN USE: HALL - STAIR CIRCULATION SQUARE FEET: 83 CEILING HEIGHT: 12' DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed - W.	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WIRE MESH PARTITION - E.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	FRAME EXPOSED
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal N. W. [X] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed W.	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [X] 1939-Present	FOLDING GATE IN WIRE MESH PARTITION TO STAIR 3.- SCREENED DOOR TO SO2-DOWN N+W - DOUBLE DRS. W/ WIRE GLASS SM. LT.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	NONE
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H205

E. WALL - FOLDING GATE TO SO2

S. DOOR TO SO2 - DOWN

356	26,006 / 16 of 34
DSC	JUL 88

Exhibit 19

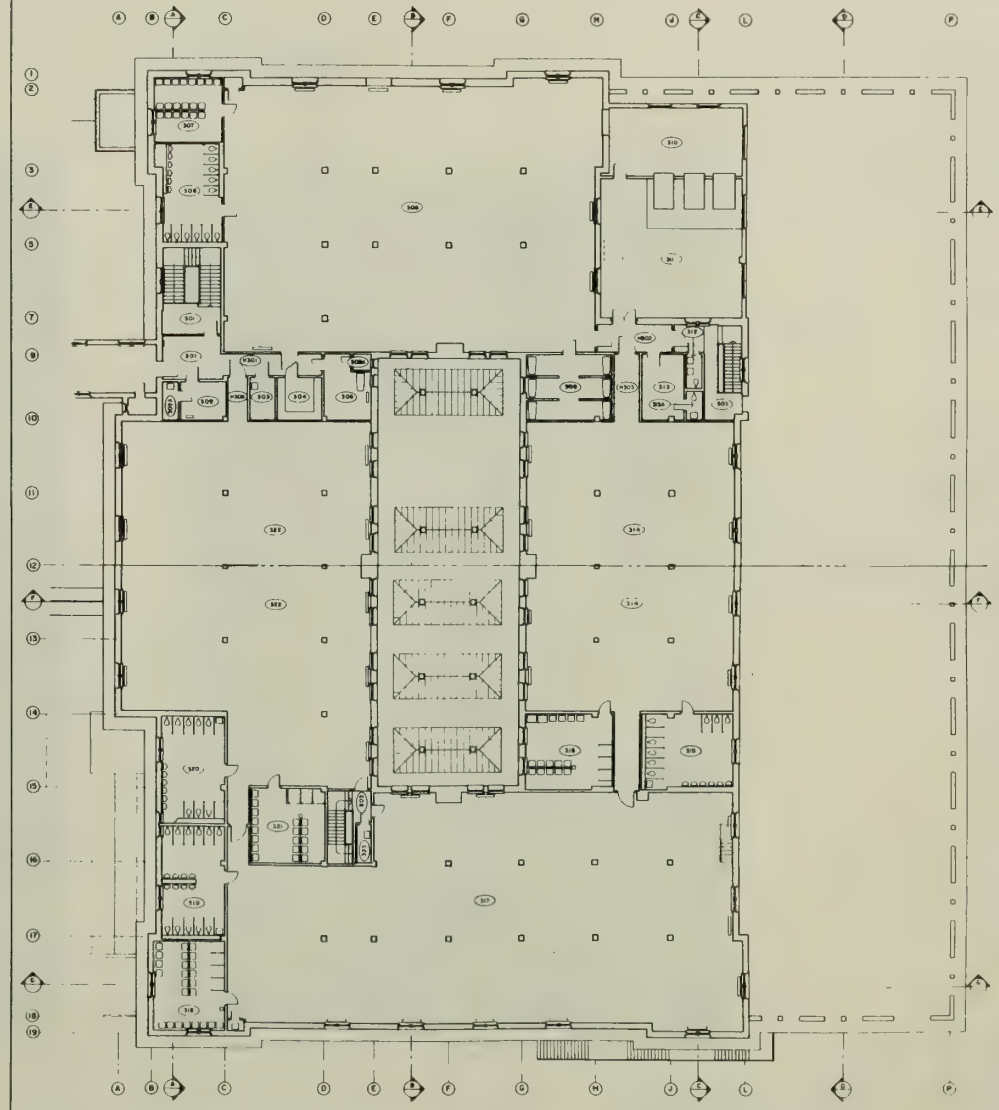

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3860

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk	shl	REVISIONS	date	ini

DESIGNED	DATE
DRAWN	TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAGGAGE & DORMITORY
3rd FLOOR PLAN

SUB SHEET NO	DRAWING NO
	PKG NO / SHEET

ROOM NO: 301 LAST KNOWN USE: ENTRY SQUARE FEET: 149 CEILING HEIGHT: 15'-9" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX. 75% DEBRIS COVERED
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1" S.-GREEN DISCOLOR.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DESTROYED ON 3/3 OF S. & W. WALL LADDER ON S.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HATCHWAY MISSING AT TOP OF LADDER - S. WALL - AREA AROUND IT - DESTROYED 1 SKYLIGHT INTACT
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[X] Good W. [ ] Fair [X] Poor (2) [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [X] 1939-Present W.	W.-SMALL LIGHT S+E - CORRODED S.-UPPER GLASS CT. GONE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	NONE
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. WALL LADDER - TO ROOF CORRODED
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 301

VIEW NW

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 291

ROOM NO: 302 LAST KNOWN USE: SOLITARY SQUARE FEET: 98 CEILING HEIGHT: 15'8" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7'
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SMALL CRACK - LITTLE PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	METAL SKYLIGHT - INTACT
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 '35 [ ] 1939-Present	WIRE GLASS - CORRODED - RAGGED BOTTOM RAIL
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	1 - WALL MOUNT BULB PORCELAIN"
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	2 LOCKERS - 1 WOOD CLOSET "BD 306" STENCILED OVER DOOR TO TOILET (302A)
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 302

VIEW NW

E. WALL

ROOM NO: 302A LAST KNOWN USE: TOILET SQUARE FEET: 33 CEILING HEIGHT: 15'-8" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7'
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S. - POOR - EXPOSED T.C. WET WALL
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP - SKYLIGHT
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WIRE GLASS PANE RAGGED, CORRODED BASE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	WALL - WIRES MOUNT GONE
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 302A

ROOM NO: 303 LAST KNOWN USE: MAINTEN. CLOSET SQUARE FEET: 56 CEILING HEIGHT: 15'-8" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	CEMENT PLASTER WAINSCOT - (7') WITH BASE (2 1/2")
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SKYLIGHT SHARED W/ RM. 305 PP
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 '35 [ ] 1939-Present	CORRODED - 1
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [1] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	WALL MOUNT DANGLING
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	1 SLOP SINK FAUCETS (MISSING) WERE PIPE MOUNTED TO FLOOR
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 304

ROOM NO: 304 LAST KNOWN USE: BLANKET STORAGE SQUARE FEET: 110 CEILING HEIGHT: 15'-8" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	CEMENT PLASTER WAINSCOT- 7'
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP-N.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SKYLIGHT SMALL AREA - EXP. LATH NEAR SKYLT.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 '35 [ ] 1939-Present	OVERALL CORROSION OF SURFACE 1
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	C.M.L. -1
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WOOD SHELVES LINE WALLS WOOD BINS
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 304

ROOM NO: 305 LAST KNOWN USE: BATH / NURSERY SQUARE FEET: 60 CEILING HEIGHT: 15'-10" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7' MISSING TILES - N. & W. DISCOLORED
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NE CORNER & N. + W OF 305A EXPOSED T.C.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	25% - DESTROYED TO METAL FRAME
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 '35 [ ] 1939-Present	CORRODED
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	1-C.M.L.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [X] Other: BATH TUB	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [X] 1924-1938 [ ] 1939-Present	TUB ON 4 CAST IRON LEGS FAUCETS GONE ON WOOD PLATFORM
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 305

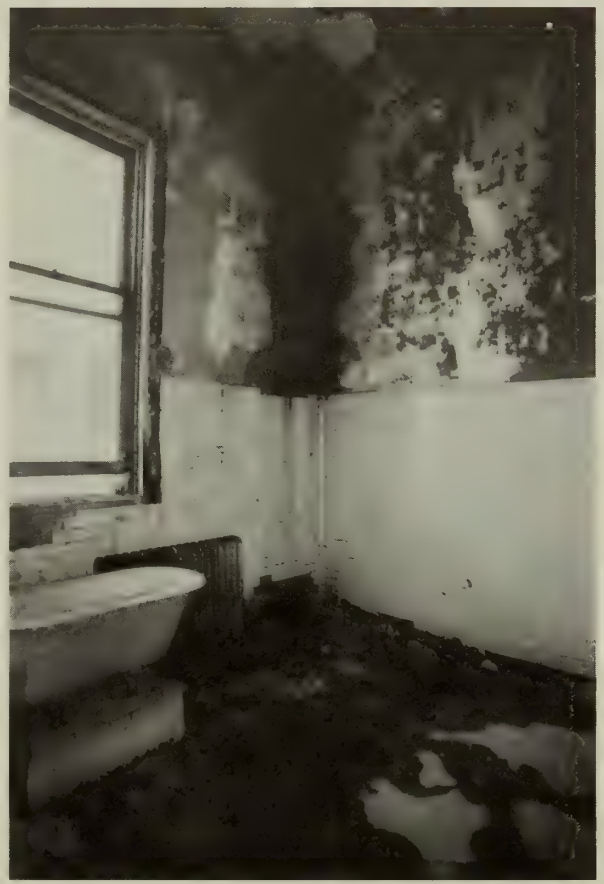

ROOM NO: 305A LAST KNOWN USE: TOILET SQUARE FEET: 120 CEILING HEIGHT: 15'-9" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7'- MISSING TILES - N & E DISCOLORED
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N+W - EXPOSED T.C.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 135 [ ] 1939-Present	OBSCURE GLASS PANE BASE CORRODED AWAY
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [/] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	LOW TO FLOOR TOILET SEAT DESTROYED CRACKED
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NW CORNER VERTICAL PIPE THROUGH FLOOR
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 305A

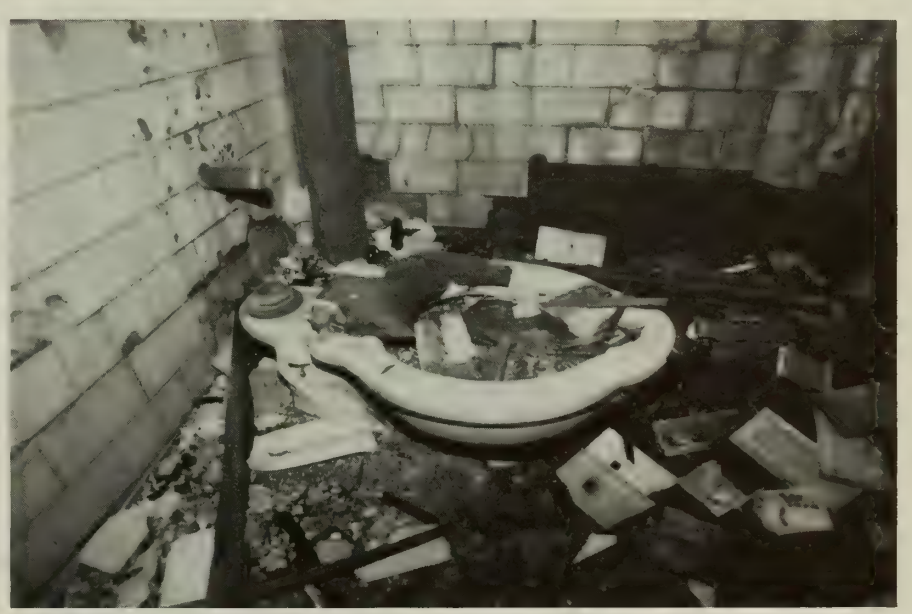

ROOM NO: 306 LAST KNOWN USE: DORM DETENTION SQUARE FEET: 5,809 CEILING HEIGHT: 15'-9" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Concrete Other:	X Good Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	2" HEX 50% DEBRIS
BASE:	Wood X Tile Tile Wainscot Other:	X Good Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	7'-1" h. AREA OF MISSING TILES - E BELOW WINDOW
WALLS:	X Plaster Gypsum Board Partitions Other:	Good X Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	EXPOSED T.C. - W. WALL, N. - 30% WHE. - AROUND WINDOWS N. ARCH WINDOW BOARDED OVER (DOOR)
CEILING:	X Plaster Acoustic panels Cove Other	Good X Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	NE CORNER - DESTROYED AND AREAS (3) AROUND CEILING VENT GRILLES
DOORS/ OPENINGS:	Wood/Glass Panelled Wood Veneer X Galvanized Metal Other:	Good Fair X Poor Destroyed	1909-1912 1913-1923 X 1924-1938 '35 1939-Present	GLASS UPPER PANES CORRODED SURFACE (5) SEE 307, 308, H301, 309, H302
LIGHTING:	Incandescent/Type A Incandescent/Type B Incandescent/Type C X Other:	Intact / Destroyed Intact / Destroyed Intact / Destroyed Intact / Destroyed	Pre-1924 Post-1924 In Question	34 - C.M.L. 3 ROWS. N TO S. - EVIDENCE OF WHITE PAINTED CIRCLES AROUND LAMPS PRIOR TO LAST PAINTING
HEATING/ VENTILATION PLUMBING:	X Radiators X Vents/Fans Sink/Toilet/Urinal X Other: SLOP SINK	9 Intact / Destroyed Intact / Destroyed Intact / Destroyed 1 Intact / Destroyed	1909-1912 X 1913-1923 X 1924-1938 1939-Present	4'-5' DIAM. DUCT ALONG E. WALL TO CEILING - 1934 SW CORNER - SMALL CLOSET w/ SLOP SINK
MISCELLANEOUS:		Good Fair Poor Destroyed	1909-1912 1913-1923 1924-1938 1939-Present	
SUMMARY:		Good X Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS:

ROOM NO. 306

PHOTOGRAPHS:

ROOM NO. 306

ELLIS ISLAND EXISTING CONDITION SURVEY BAGGAGE & DORMITORY

ROOM NO: 307 LAST KNOWN USE: WASH ROOM SQUARE FEET: 253 CEILING HEIGHT: 15'-8½" DATE: 8/13/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7' h. SECTION OF TILE MISSING - W. AT TOP AND AT BASE
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	W. WALL - OVER 75% GONE
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED LATH ALONG W. WALL 18" WIDTH
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 '35 [ ] 1939-Present	CORRODED UPPER WIRE GLASS PANE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 C.M.L.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[2] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [20] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [X] 1924-1938 [ ] 1939-Present	WALL-MOUNTED OVER WINDOWS - S & W 8 SQ. PORCELAIN PEDESTAL - W. WALL 20 - BACK TO BACK - METAL LEGS
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	1. WATER FOUNTAIN - N. WALL
SUMMARY:		[ ] Good [X] Fair [ ] Poor	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS:

ROOM NO. 307

ELLIS ISLAND EXISTING CONDITION SURVEY BAGGAGE & DORMITORY

ROOM NO: 308 LAST KNOWN USE: TOILET SQUARE FEET: CEILING HEIGHT: 15'-9" DATE: (INACCESSIBLE)

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☐ Fair ☐ Poor	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Minor ☐ Negligible

ROOM NO: 309 LAST KNOWN USE: BATH SQUARE FEET: 324 CEILING HEIGHT: 15'-9" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX - 2" DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7'h. S. - MISSING TILES, VERY DISCOLORED ALSO S.W + SE CORNERS N. - GOOD
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7'h. TILE PARTITIONS BETWEEN BATH TUBS S., SW + SE - EXPOSED T.C. - 25% GONE PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	20% DESTROYED - S. END 1 - SKYLT. - INTACT
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 '35 [ ] 1939-Present	HEAVY CORROSION - WIRE GLASS - UPPER PANE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	C.M.L. - 6
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [X] Other: BATHTUBS	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [X] 1924-1938 [ ] 1939-Present	1 - 6 LEG. SECTIONAL - E. 6 BATHTUBS - 2 E. TUBS WITH SHOWER HEADS + CURTAIN RODS
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	6 MARBLE SEATS - 1 NEAR EARTH BATHTUB - W/ PIPE LEG
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 309

ROOM NO: 310 LAST KNOWN USE: DISINFECTING ROOM SQUARE FEET: 527 CEILING HEIGHT: SHED 17'-2" - 15'-7" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	7' h. N. END NOT VISIBLE CHIPPING - W.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [X] Other: BRICK - S.	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 S. [X] 1924-1938 [ ] 1939-Present	N. - EXPOSED T.C. SURFACE SPALL PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	SHED ROOF - SLOPES FROM S. METAL BEAMS PP
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	NO PANELS - E. S. - DOUBLE DOORS W/ 6 LT. TRANSOM -
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	2 - LAMPS ON DROP CORDS
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE VISIBLE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	STACKED HIGH W/ MATTRESSES + COTS
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 310

VIEW N.

W. WALL

VIEW S.

ROOM NO: 311 LAST KNOWN USE: DISINFECTING ROOM SQUARE FEET: 527 CEILING HEIGHT: SHED 17'-2" - 15'-7" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☒ Tile Wainscot N+W ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	7' N+W. - CHIPPING
WALLS:	☒ Plaster N+W ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☒ 1913-1923 S+E ☒ 1924-1938 ☐ 1939-Present	S+E - ORIGINAL BRICK EXTERIOR OF 3RD FLOOR N. - EXPOSED T.C., W. - EXPOSED BRICK PP
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other WOOD	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	SHED ROOF - SLOPE DOWN FR. S. STEEL BEAMS - 1 TRUSS S. END - HATCH TO ROOF W/ LADDER FROM SUSPENDED PLATFORM
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☒ Fair E. ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	SOLID - NO PANELS DOUBLE DRS. — RUST AT EDGES
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	LAMPS ON DROP CORDS - 2
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	NONE VISIBLE
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	3 DISINFECTOR MACHINES 2 LEVER LOADING - SET IN RECESSED PIT
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 311

DISINFECTING MACHINES

ROOM NO: 312 LAST KNOWN USE: WASHROOM SQUARE FEET: 31 CEILING HEIGHT: 15'-10" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	LITTLE PD
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SMALL SKYLT.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	BROKEN WIRE-GLASS LT. OVER 1 PANEL
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	1 - WALL-MOUNTED BULB
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: SLOP SINK	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present ?	1 TOILET, 1 WALL MT. SINK, 1 SLOP SINK W/ BACK SPLASH
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. 312

VIEW E.

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 317

ROOM NO: 313 LAST KNOWN USE: SQUARE FEET: 1600 CEILING HEIGHT: 15'-10" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SKYLT. - GOOD PP AROUND IT
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	GLASS PANE - BROKEN OUT CORRODED - PANEL MOULDING PULLED OUT -
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	1 - C.M.L.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	1 - 4 LEG
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PILED HIGH W/ MATTRESSES DOOR LOCKED
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 313

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 319

ROOM NO: 314 LAST KNOWN USE: DORMITORY SQUARE FEET: 3,540 CEILING HEIGHT: 15'-9" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS CRACK FROM N. WALL
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7' h. GREEN DISCOLOR. — SW CORNER
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N+S, SW CORNER - EXPOSED T.C.+ BROWN COAT COLUMNS — SOME SPALL
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	AREAS AROUND VENT GRILLES DESTROYED S. PERIMETER & N. SECTION - EXP. TO HANGING FRAME
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 '35 [ ] 1939-Present	WIREGLASS LT. - CORRODED
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [6] Intact [2] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	3 ROWS OF C.M.L - 5 - CENTER, 10 ON EITHER SIDE 6 INTACT DIRECTIONAL METAL SHADES AT WALL PERIMETER - CORRODED
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[8] Intact [ ] Destroyed [ ] Intact [2] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	VENT GRILLES FALLEN OUT
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 314

S.W.

SE

NW

NE

ELLIS ISLAND **EXISTING CONDITION SURVEY** **BAGGAGE & DORMITORY** page: 321

ROOM NO: 315 LAST KNOWN USE: TOILET SQUARE FEET: 372 CEILING HEIGHT: 15'-9" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Concrete Other:	X Good Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	LAYER OF PLASTER DUST
BASE:	Wood Tile X Tile Wainscot Other:	X Good Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	7' h. N. – FEW MISSING TILES
WALLS:	X Plaster Gypsum Board X Partitions METAL Other:	X Good X Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	N. – SOME EXP. T.C. + BROWN COAT 9 GALV. METAL TOILET PARTITIONS NO DOORS – PP
CEILING:	X Plaster Acoustic panels Cove Other	X Good Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	ALONG N. – EXP. LATH ABOVE RADIATOR PP – SOME SPALL
DOORS/ OPENINGS:	Wood/Glass Panelled Wood Veneer X Galvanized Metal Other:	Good Fair X Poor Destroyed	1909-1912 1913-1923 X 1924-1938 '35 1939-Present	HEAVY CORRODED WIRE GLASS PANE
LIGHTING:	Incandescent/Type A Incandescent/Type B Incandescent/Type C X Other:	Intact / Destroyed Intact / Destroyed Intact / Destroyed Intact / Destroyed	Pre-1924 X Post-1924 In Question	2 CMU. – CLEAN LINE OF WHITE PAINTED CIRCLES (APPROX. 3½'D.) AROUND BULBS
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans X Sink/Toilet/Urinal X Other: SLOP SINK	1 Intact / Destroyed Intact / Destroyed 15 Intact / 1 Destroyed Intact / Destroyed	1909-1912 X 1913-1923 X 1924-1938 '33 1939-Present	WALL-MOUNTED ABOVE WINDOW.-N. 9 TOILET, +1 DESTROYED 6 FLOOR TYPE URINALS 1 SLOP SINK
MISCELLANEOUS:		Good Fair Poor Destroyed	1909-1912 1913-1923 1924-1938 1939-Present	
SUMMARY:		X Good Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS:

ROOM NO. 315

S. WALL

NE CORNER

ROOM NO: 316 LAST KNOWN USE: WASHRM. SQUARE FEET: 381 CEILING HEIGHT: 15'-9" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7'h. S.- 50% DESTROYED WINDOW METAL CORROSION CAUSING STREAKING DISCOLOR.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions G.M. [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S.- ALL EXPOSED T.C. SW & SE CORNERS - TO BROWN COAT REST- GOOD - PP 3 SHOWER PARTITIONS
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S - EXPOSED METAL FRAME 3'-4' WIDTH PP (DARK GREEN - WHITE CIRCLES AROUND C.M.L.)
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	WIRE GLASS PANE CORRODED
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	C.M.L. - 2
HEATING/ VENTILATION PLUMBING:	[X] Radiators S. [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: SHOWERS	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed 15 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WALL-MTED RADIATOR ABOVE WINDOW 5- SQ. PEDESTAL SINKS - W. 10 - BACK TO BACK METAL LEGS 3 SHOWER HEADS - N.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PEDESTAL DRINKING FOUNTAIN
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 316

VIEW NW

VIEW SE

ROOM NO: 317 LAST KNOWN USE: DORMITORY SQUARE FEET: 6,316 CEILING HEIGHT: 15'-9" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	AREA - W. - DESTROYED N. - FEW MISSING TILES - AT BASE E. - DISCOLOR., CRACK COLUMNS - CHIPPING
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	W. - AROUND WINDOWS - EXP. T.C. N. - EXP. T.C. AROUND DOOR E. - EXP. T.C. + BROWN COAT
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DESTROYED AROUND VENT GRILLES AND AREAS ALONG E. + W. - OVER WINDOWS
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	CORRODED (5) SE CORNER CLOSET DR. - W/ TRANSOM BROKEN LT. IN DOOR SEE RMS. 318, 319, H304
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [5] Intact [3] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	3 ROWS OF C.M.L. - EVIDENCE OF PAINTED CIRCLES AROUND @ 41 TOTAL 5 - PERIMETER DIRECTIONAL METAL SHADE
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[10] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEAVILY CORRODED - ESP. ON W.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WOOD STEPS ALONG N. WALL FOR ROOF DECK ACCESS THROUGH WINDOW
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 317

VIEW N.

VIEW SE

VIEW NE

VIEW SW - WEST WINDOWS

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 327

ROOM NO: 318 LAST KNOWN USE: WASH RM. SQUARE FEET: 371 CEILING HEIGHT: 15'-9" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7' h. S.- 75% DESTROYED + DISCOLOR. W.- 10% MISSING, DISCOLOR.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions METAL [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S+E- EXP. T.C.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	ALONG E. + S.- EXPOSED LATH
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	WIRE GLASS PANE CORRODED
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	1- C.M.L.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: SHOWERS	1 [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 24 [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [X] 1924-1938 [ ] 1939-Present	1 WALL MTED RAD ABOVE WINDOW- S. 12 SINKS BACK TO BACK- METAL LEGS 4- S. WALL, 8- E. WALL 4 SHOWER HEADS (2 MISSING)
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	1- WALL-MOUNTED DRINKING FOUNTAIN
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 318

N. WALL

VIEW SW

E. WALL

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 329

ROOM NO: 319 LAST KNOWN USE: TOILET SQUARE FEET: 386 CEILING HEIGHT: 15'-9" DATE: 8/15/04

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S.- FEW CAP TILES MISSING
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions METAL & TILE [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S & SW - EXPOSED SCRATCH COAT 10 - PARTITIONS - CORRODED LEGS PP TILE URINAL PARTITION
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S.- SMALL AREA LATH EXP. OVER RADIATOR
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	CRACKED WIRE GLASS MEDIUM CORROSION
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	2-C.M.L.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: SLOP SINK	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed 18 Intact [ ] Destroyed 1 Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [X] 1924-1938 [ ] 1939-Present	WALL MTED RAD OVER WINDOW 11 TOILETS, 8 FLOOR TYPE URINALS 1 SLOP SINK
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 319

VIEW W.

S. WALL

NE CORNER

ROOM NO: 320 LAST KNOWN USE: TOILET SQUARE FEET: 375 CEILING HEIGHT: 15'-9" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Concrete Other:	X Good Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	
BASE:	Wood Tile X Tile Wainscot Other:	X Good Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	7' h.
WALLS:	X Plaster Gypsum Board X Partitions METAL Other:	Good X Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	S. - EXP. T.C. + BROWN COAT MOST E, W + ALL N. - GOOD 9 TOILET PARTITIONS - CORRODED LEGS PP
CEILING:	X Plaster Acoustic panels Cove Other	X Good Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	PP
DOORS/ OPENINGS:	Wood/Glass Panelled Wood Veneer X Galvanized Metal Other:	Good X Fair Poor Destroyed	1909-1912 1913-1923 X 1924-1938 1939-Present	GLASS PANE - PAINTED SOME RUST AT BASE AND PANEL MOULDINGS
LIGHTING:	Incandescent/Type A Incandescent/Type B Incandescent/Type C X Other:	Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	Pre-1924 X Post-1924 In Question	2 - C.M.L.
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans X Sink/Toilet/Urinal Other:	1 Intact Destroyed Intact Destroyed 15 Intact 1 Destroyed Intact Destroyed	1909-1912 X 1913-1923 X 1924-1938 1939-Present	WALL-MTED. OVER S. WINDOW 9 TOILETS - 1 DESTROYED 6 FLOOR TYPE URINALS
MISCELLANEOUS:		Good Fair Poor Destroyed	1909-1912 1913-1923 1924-1938 1939-Present	
SUMMARY:		X Good Fair Poor Destroyed	1909-1912 X 1913-1923 1924-1938 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS:

ROOM NO. 320

VIEW NW

VIEW SE

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 333

ROOM NO: 321 LAST KNOWN USE: WASH/ SHOWER RM. SQUARE FEET: 324 CEILING HEIGHT: 15'-8½" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7' h.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions METAL [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MIN. OUTER PAINT LAYER PEELING 3 SHOWER PART. - PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SKYLIGHT PP AROUND IT & INSIDE SKYLT. FASCIA
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	WIRE GLASS PANEL PITTING - CORRODED BASE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	4 - C.M.L.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: SHOWERS	2 [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 18 [ ] Intact [ ] Destroyed 3 [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WALL MT. - E. WALL RAD. 8 SQ. PED. SINKS - S. 10 BACK TO BACK ON METAL LEGS 3 SHOWER HEADS
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: 322 LAST KNOWN USE: DORMITORY SQUARE FEET: 4,884 CEILING HEIGHT: 15'-8½" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS 2" HEX
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7'h. NE - 15% DESTROYED SW & NW CORNERS - GREEN DISCOLOR. MOST - O.K.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	S, N, SW CORNER - EXP. T.C. NE - WATER DRIPPING OVER WALL
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	AREAS AROUND 3 VENT GRILLES - DESTROYED ALONG W & S WALLS - EXPOSED METAL FRAME
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	HEAVILY CORRODED, PITTING
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 3 Intact 6 Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	3 ROWS - C.M.L. - 4 CENTER - 13 ON BOTH SIDES - (30 TOTAL) 9 PERIMETER DIRECTIONAL METAL SHADES (WALL WASHERS)
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	9 Intact [ ] Destroyed 3 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	VENT GRILLES INTACT BUT CORRODED - AREA AROUND DESTROYED
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO.

VIEW SE

VIEW NW

VIEW NE

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: H301 LAST KNOWN USE: SQUARE FEET: 120 CEILING HEIGHT: 15'-9" DATE: 8/13/04

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-1"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SOME PLASTER SPALLING
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	"
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 '35 [ ] 1939-Present	SURFACES HEAVILY CORRODED SOME BASES CORRODED AWAY
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1-CML
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H301

337

VIEW N.

337

VIEW S.

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 338

ROOM NO: H302 LAST KNOWN USE: HALL SQUARE FEET: 118 CEILING HEIGHT: 15'-9" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5' AREA TO RM. 311 - MISSING TILES CHIPPING, DISCOLOR.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	W. - 75% DESTROYED EXP. T.C. EXP. BRICK AROUND DOOR TO 311
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SURFACE SPALLING - W.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 '35 [ ] 1939-Present	HEAVY CORROSION BROKEN UPPER LTS.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	BULB ON DROP CORD
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H302

VIEW N.

VIEW S.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: H303 LAST KNOWN USE: HALL SQUARE FEET: 118 CEILING HEIGHT: 15'-9" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	HEX. DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7'
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	CORRODED
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	C.M. - WALL DIRECTED METAL SHADE
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H 303

VIEW E:

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY

ROOM NO: H304 LAST KNOWN USE: HALL SQUARE FEET: 110 CEILING HEIGHT: 15'-9" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DESTROYED AROUND VENT REGISTER
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	2 PANEL - CORRODED
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	C.M. - DIRECTIONAL METAL SHADE
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	VENT GRILLE INTACT - SHAFTWAY DESTROYED
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H304

VIEW E.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 344

ROOM NO: H305 LAST KNOWN USE: HALL SQUARE FEET: 98 CEILING HEIGHT: 15'-8½" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PP
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	2 PANEL - CORRODED AT BASE + EDGES
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	NONE
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H305

VIEW W.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 346

ROOM NO: H306 LAST KNOWN USE: HALL SQUARE FEET: 52 CEILING HEIGHT: 15'-9" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	7'
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	pp
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	pp
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	CORRODED OVERALL
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	NONE
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	NONE
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H306

VIEW W.

ELLIS ISLAND EXISTING CONDITION SURVEY — BAGGAGE & DORMITORY — page: 348

ROOM NO: H307 LAST KNOWN USE: PASSAGE TO ROOF PORCH SQUARE FEET: 184 CEILING HEIGHT: 15'-10" DATE: 8/15/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5' h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N. AND AROUND N. DOOR - EXP. BROWN COAT SPALLING
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SURFACE SPALL PP
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed N.	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 '35 [ ] 1939-Present	ROOM DRS. - CORRODED DR. TO ROOF - ON FLOOR
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	1 - CML
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	1 [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. H307

VIEW S.

VIEW W.

NE - DOORWAY TO ROOF PORCH

ROOM NO: S01 LAST KNOWN USE: Staircase SQUARE FEET: CEILING HEIGHT: DATE: 8/15/84

DESCRIPTION:

General: Rectangular southwest corner stair with open well. Stair serves all three floor with three runs and two landings per floor. Stair structure is cast iron with wrought iron balustrade and wood handrails. An octagonal cast-iron newel post is at the foot of the stair and square posts are at each landing.

Floor: All treads are slate with cast-iron risers (7-1/8"). Top riser on third floor is white marble. Landings at each floor are hexagonal tile.

Base: Cast-iron channel wall string. Tile wainscot at south, west and north walls.

Walls: Plaster on terra-cotta block. Partition of diamond wire mesh extends from stair handrail along runs from second to third floor.

Ceiling: Plaster over terra cotta at third floor ceiling. Plaster on lath on underside of stairs between stringers.

Doors/Openings: Galvanized metal door with single wire glass light at second and third floor landings.

Lighting: Destroyed.

Heating: One sectional radiator at third floor landing.

Floor: Covered in debris. Risers are corroded with metal flaking off.

Base: Tile in good condition. Metal elements are corroded.

Walls: Poor condition. A portion of plaster is destroyed exposing metal studs on the east wall of the third floor landing. Plaster is flaking on the south wall and is destroyed below the windows exposing terra-cotta block.

Ceiling: Plaster and lath is destroyed on underside of stair. Ceiling is in fair condition with a hole in the southeast corner.

Doors/Openings: Some surface corrosion at base and edges.

SUMMARY:

	Good
	Fair
X	Poor
	Destroyed

X	1909-1912
	1913-1923
	1924-1938
	1939-Present

ARCHITECTURAL SIGNIFICANCE:

	Most
X	Some
	Minor
	Negligible

PHOTOGRAPHS:

ROOM NO. 501

VIEW S.W. - FOOT OF STAIR

VIEW E. FROM LANDING UP TO SECOND FLOOR.

VIEW W. FROM SECOND FLOOR LANDING.

PHOTOGRAPHS:

ROOM NO. 501

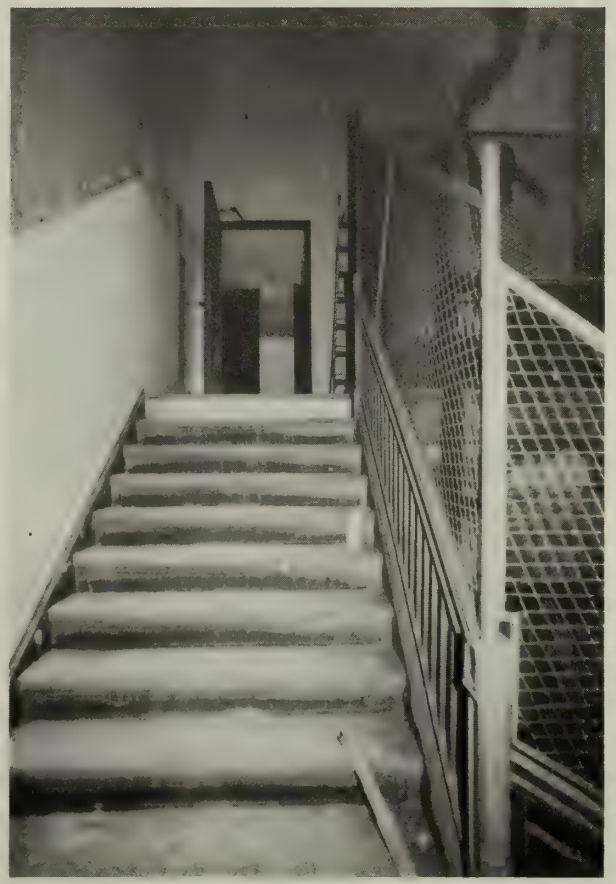

VIEW E. UP TO THIRD FLOOR LANDING.

VIEW W. FROM THIRD FLOOR LANDING.

THIRD FLOOR LANDING - VIEW SE.

ROOM NO: S02 LAST KNOWN USE: Staircase SQUARE FEET: CEILING HEIGHT: DATE: 8/15/84

DESCRIPTION:

General: Enclosed stair in southeastern corner of building. Stair serves three floors with two landings and three runs per floor. Stair structure is cast iron with wrought iron balustrade, cast-iron newel post and wood handrails.

Floor: Treads are white marble and risers are of cast iron.

Base: Cast-iron channel wall string. Tile wainscot.

Walls: Plaster on metal studs on first floor enclosure walls. Plaster on terra-cotta on east and south walls of stair and on brick on the north and west walls.

Ceiling: Plaster on lath on underside of steps. Plaster on terra-cotta block on third floor ceiling. Metal framed skylight at center.

Doors/Openings: Galvanized metal at first floor landing and folding gate at second floor landing.

Lighting: Destroyed.

Floor: Marble is chipped and heavily worn in the center of the steps. Risers are corroded.

Base: Cast-iron string is heavily corroded. Wainscot is in good condition.

Walls: Poor condition. Plaster destroyed in northwest corner at first floor and spalling on east and north wall.

Ceiling: Poor condition. Terra-cotta block is exposed. Plaster lath destroyed on underside of steps.

Doors/Openings: Corroded surfaces. First floor door locked.

SUMMARY:						ARCHITECTURAL SIGNIFICANCE:	
		[ ]	Good	[X]	1909-1912		[ ] Most
		[ ]	Fair	[ ]	1913-1923		[ ] Some
		[X]	Poor	[ ]	1924-1938		[X] Minor
		[ ]	Destroyed	[ ]	1939-Present		[ ] Negligible

PHOTOGRAPHS:

ROOM NO. 502

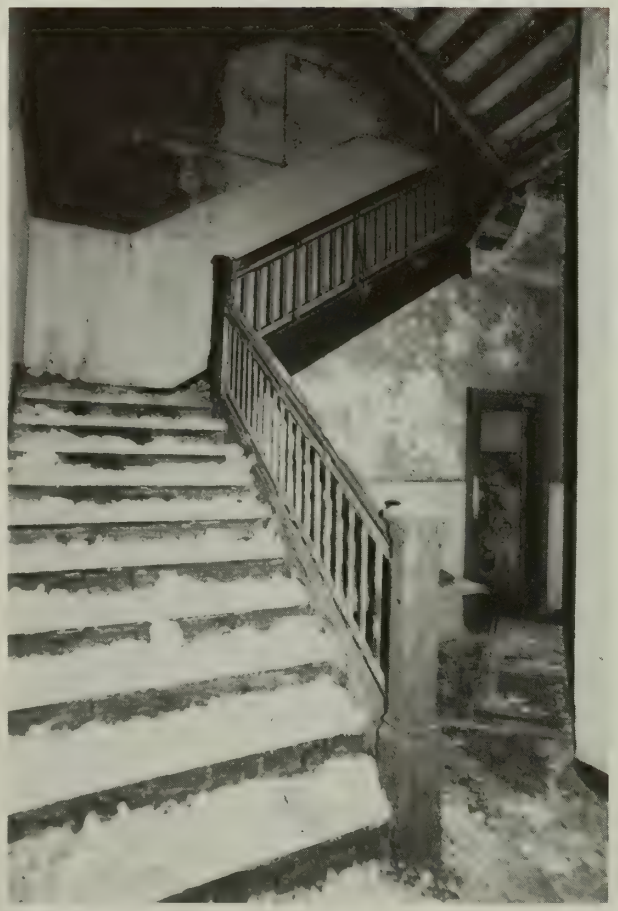

FOOT OF STAIR - VIEW N.

VIEW N.W.

VIEW E. FROM 1ST LANDING

PHOTOGRAPHS: ROOM NO. S02

VIEW SE FROM TOP

S.W. CORNER - THIRD FLOOR

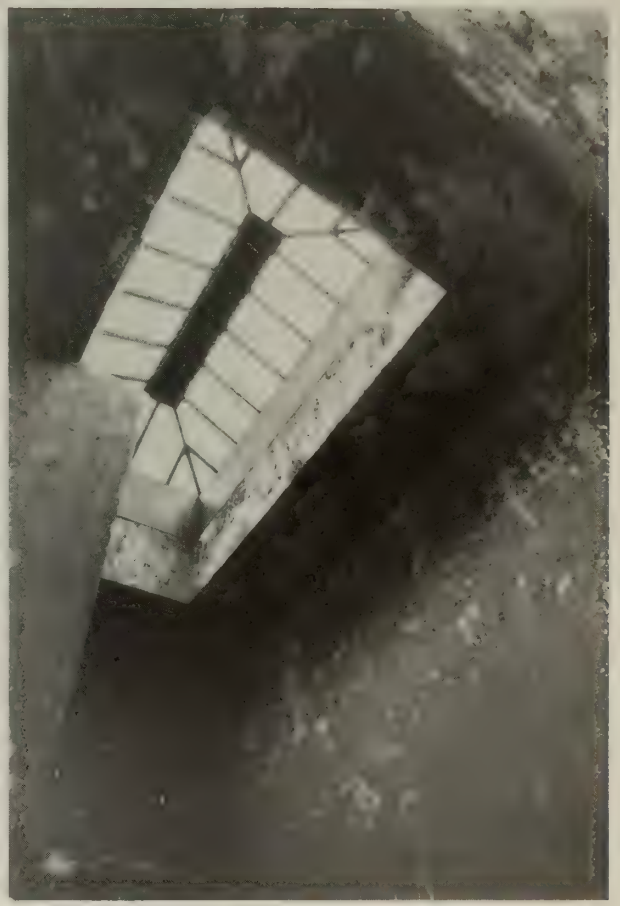

CEILING SKYLIGHT

ROOM NO: S03 LAST KNOWN USE: Staircase SQUARE FEET: CEILING HEIGHT: DATE: 8/15/84

DESCRIPTION:

General: Northwest corner stair with one landing and two runners per floor to the third floor. The stair structure is cast iron with wrought iron railings, a cast-iron newel post and wood handrail.

Floor: Landings and treads are slate. Risers are cast iron.

Base: Cast-iron channel wall string. Tile wainscot on outside wall.

Walls: Plaster on terra-cotta block. Diamond wire mesh partition enclosure at top of second floor landing.

Ceiling: Plaster on terra-cotta block.

Doors/Openings: Wire mesh door at top of steps to second floor.

Floor: Slate is worn and metal is flaking.

Base: Surface corrosion and flaking. Discoloration and cracking and some missing tile at base of wainscot.

Walls: Peeling paint. Area of exposed lath and undercoats of plaster on north wall.

Ceiling: Ceiling at third floor in good condition with some surface spalling. Plaster on lath on underside of stair is destroyed.

Doors/Openings: Surface corroded.

SUMMARY:						ARCHITECTURAL SIGNIFICANCE:	
		[ ]	Good	[X]	1909-1912		[ ] Most
		[X]	Fair	[ ]	1913-1923		[ ] Some
		[ ]	Poor	[ ]	1924-1938		[X] Minor
		[ ]	Destroyed	[ ]	1939-Present		[ ] Negligible

PHOTOGRAPHS:

ROOM NO. S03

FOOT OF STAIR - (ROOM 121)

VIEW N. FROM SECOND FLOOR LANDING

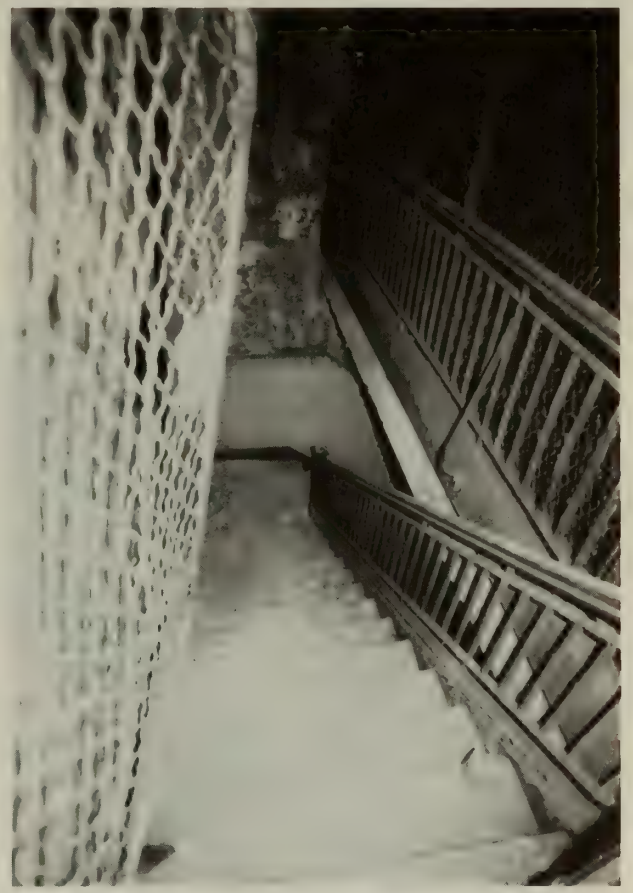

VIEW DOWN STAIR FROM WIRE MESH DOOR AT SECOND FLOOR

PHOTOGRAPHS:

ROOM NO. 503

VIEW NW UP TO THIRD FLOOR

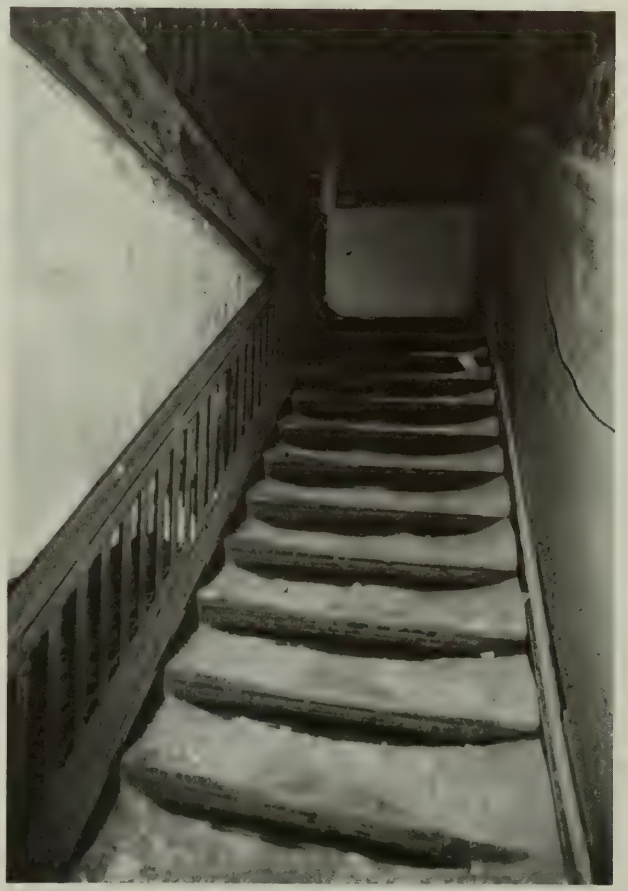

VIEW W. TO THIRD FLOOR

PHOTOGRAPHS:

ROOM NO. 503

VIEW E. FROM TOP OF STAIR
(H307)

BAKERY & CARPENTRY BUILDING

EXISTING CONDITIONS

- GOOD
- FAIR
- POOR
- DESTROYED

356 | 26,006 / 17 of 34
DSC | JUL 88

Exhibit 17

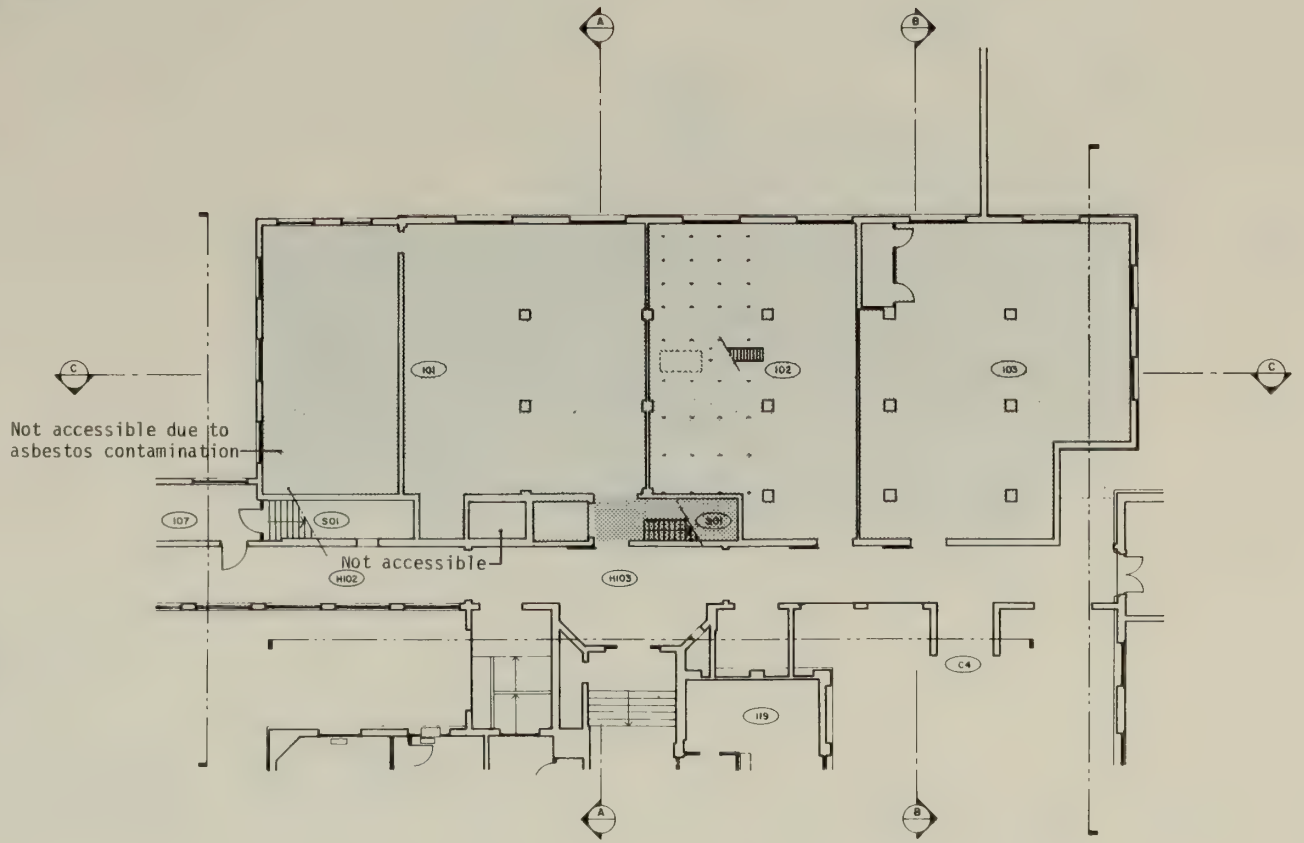

SCALE 1/8" = 1'-0"

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BETTER SLINDER BELLE / ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3860

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | ahl | REVISIONS | date | ini

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAKERY & CARPENTRY FIRST FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG. NO | SHEET OF

EXISTING CONDITIONS

GOOD
FAIR
POOR
DESTROYED

356 | 26,006 / 18 of 34
DSC | JUL 88

Exhibit 18

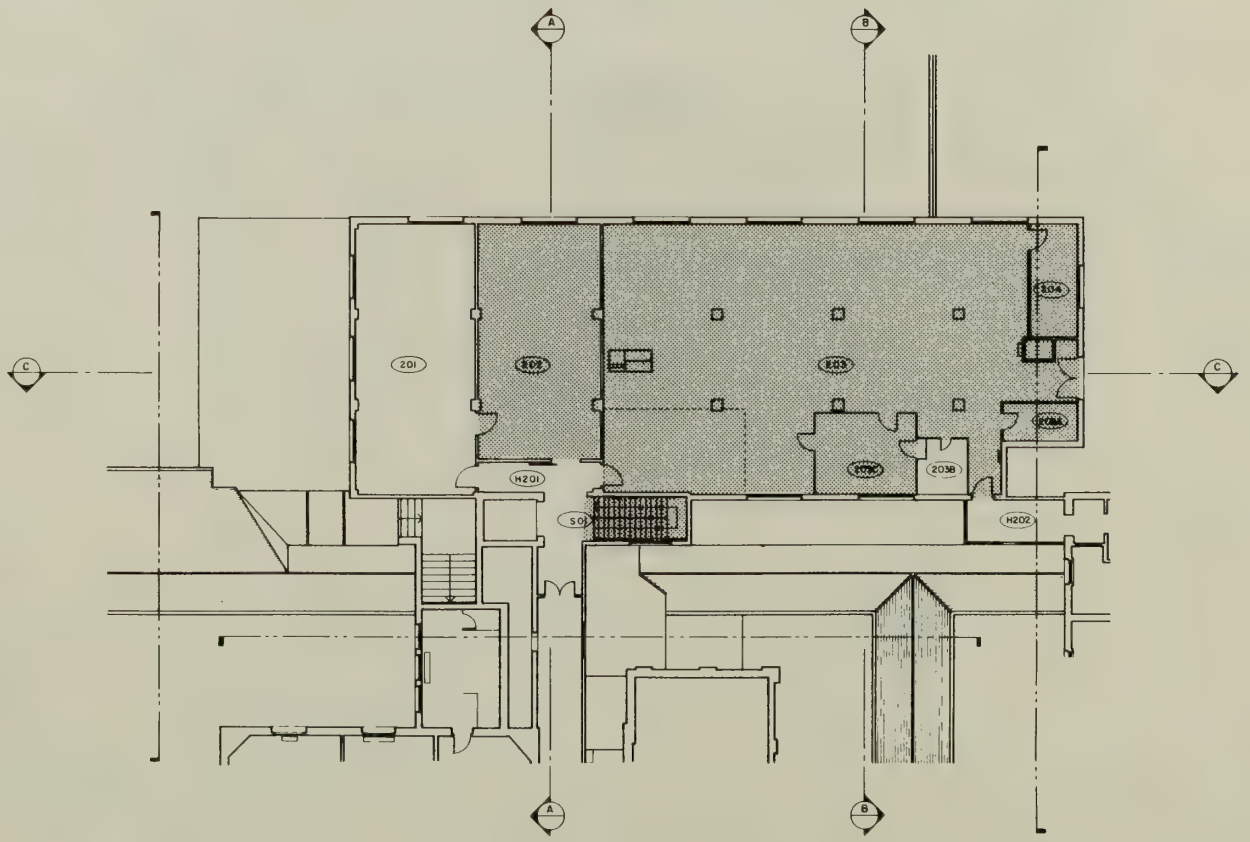

SCALE 1/8" = 1'-0"

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
60 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3660

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | ah | REVISIONS | date | ini

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAKERY & CARPENTRY SECOND FLOOR PLAN

SUB SHEET NO | DRAWING NO
PKG NO. | SHEET

ARCHITECTURAL SIGNIFICANCE

MOST
SOME
MINOR
NEGLIGIBLE

356 | 26,006 / 19 of 34
DSC | JUL 88

Exhibit 19

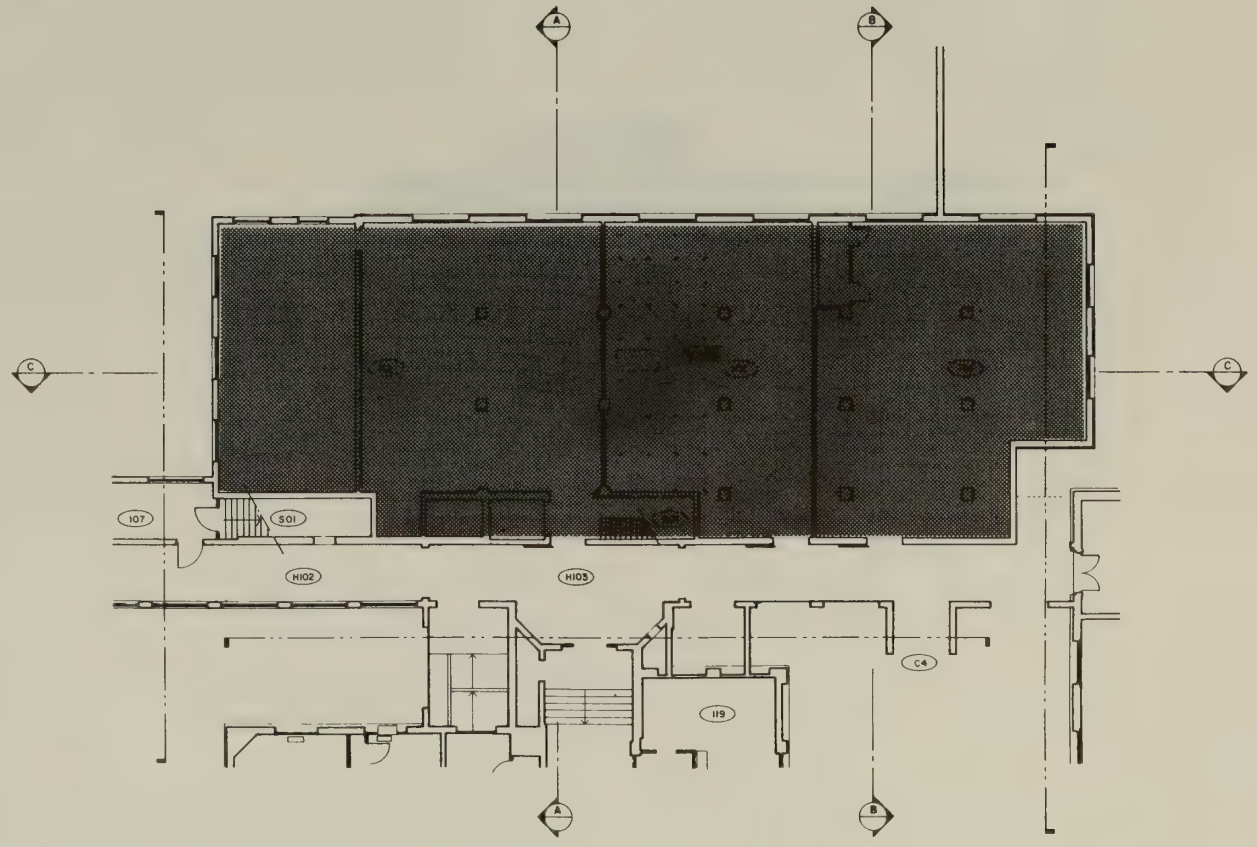

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
60 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3860

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | sht | REVISIONS | date | by

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN



TITLE OF SHEET
BAKERY & CARPENTRY
FIRST FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET
OF

Exhibit 20

ARCHITECTURAL SIGNIFICANCE

356 | 26,006 / 20 of 34
DSC | JUL 88

MOST
SOME
MINOR
NEGLIGIBLE

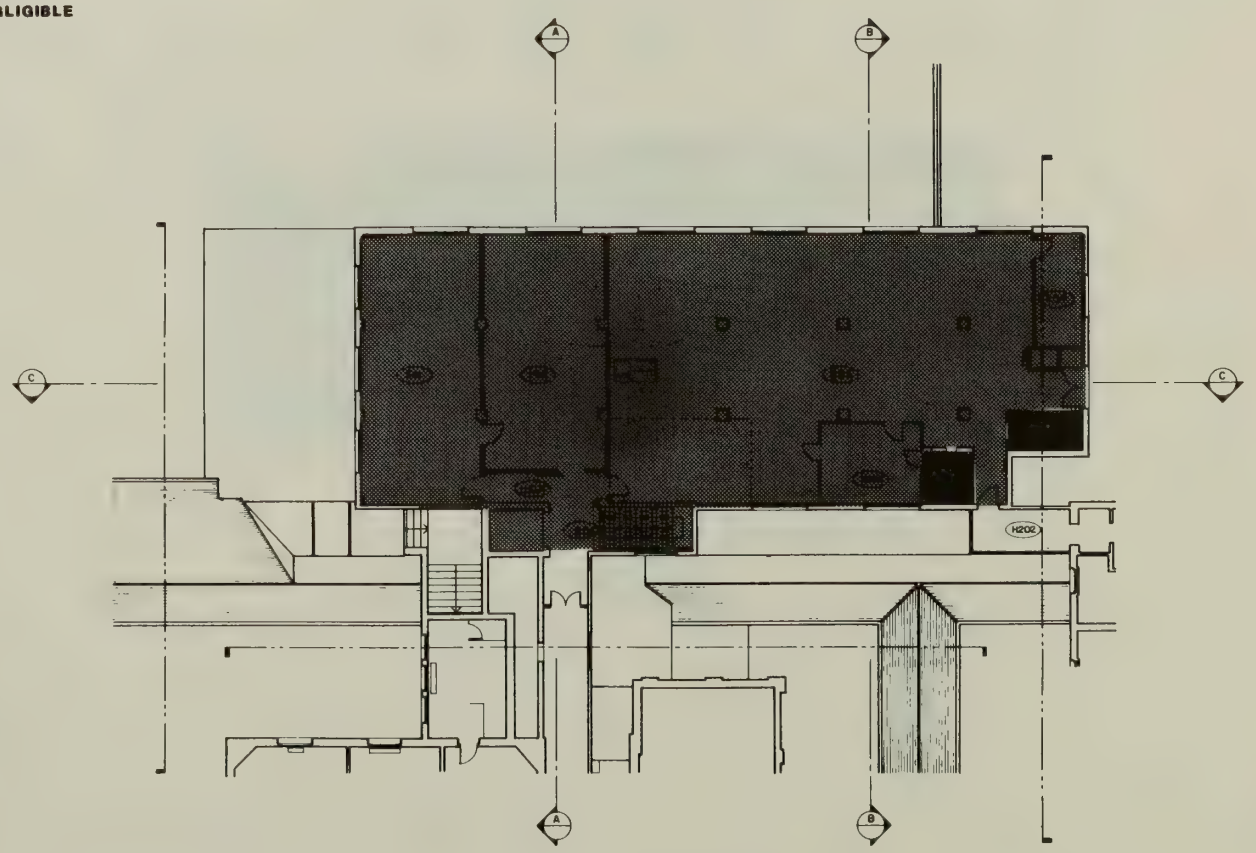

SCALE 1/8" = 1'-0"

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE / ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3660

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | drn | REVISIONS | date | by

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAKERY & CARPENTRY SECOND FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG. NO | SHEET OF

356 | 26,006 / 21 of 34
DSC | JUL 88

Exhibit 8

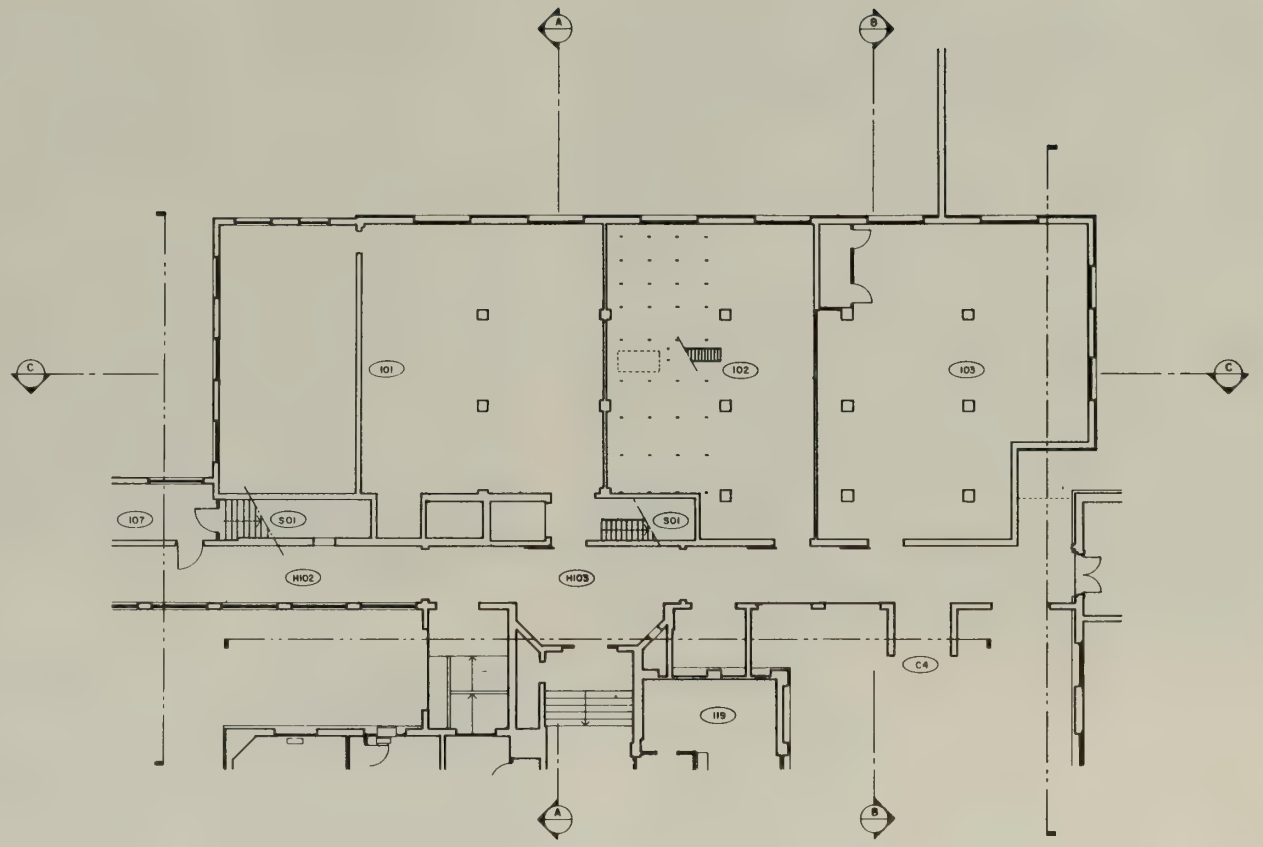

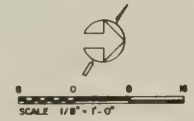

OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

SEYER SLINGER SELLS / ANDERSON NOTTER FINEGOLD
90 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3660

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk	qtd	REVISIONS	date

DESIGNED: | DATE:
DRAWN: | TECH REVIEW:

KEY PLAN



TITLE OF SHEET
BAKERY & CARPENTRY FIRST FLOOR PLAN

SUB SHEET NO. | DRAWING NO.
PKG. NO | SHEET OF

ELLIS ISLAND EXISTING CONDITION SURVEY BAKERY & CARPENTRY SHOP page: 365

ROOM NO: 101 LAST KNOWN USE: BAKE SHOP SQUARE FEET: 536 (195 - OVEN RM. X 341 - BAKE RM.) CEILING HEIGHT: 17'-7" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	DEBRIS
BASE:	☐ Wood ☐ Tile ☒ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	S.-ONLY - WHITE TILE W/ CAP APPROX. 8' - PAINTED
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	PP
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	SLIDING FREIGHT DOOR - E.
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	8 - C.M.L.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	CEILING HUNG - PARALLEL PIPE CLUSTERS - S, W & N
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	S. WALL - 3 OVEN HOODS "MIDDLEBY OVEN CO., N.Y."
SUMMARY:		☒ Good ☐ Fair ☐ Poor	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor

PHOTOGRAPHS:

ROOM NO. 101

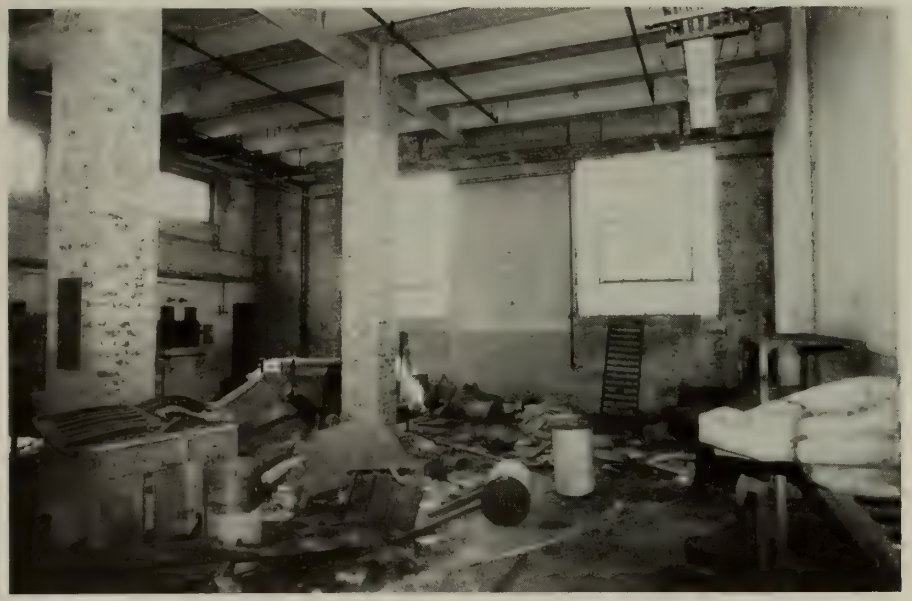

VIEW S.W.

S. WALL - OVEN LOADING HOOD

VIEW NW

ELLIS ISLAND EXISTING CONDITION SURVEY BAKERY & CARPENTRY SHOP page: 367

ROOM NO: 102 LAST KNOWN USE: LUMBER STORAGE SQUARE FEET: 1,254. CEILING HEIGHT: 17'-7" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	PP - SOME MIN. EFFLORES. - W.
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	PP DUCT
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☒ 1924-1938 ☐ 1939-Present ☐ In Question	DOUBLE DR. - OBSCURE GLASS 3 WD. PANELS WORN, PP
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	C.M.L.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	CEILING HUNG PARALLEL PIPE CLUSTERS - E & W
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	FRAME STORAGE RACKS (2 LEVELS) OF STUDS + PIPES WOOD LADDER AT CENTER
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: AT RIGHT : VIEW S.E , VIEW W.

ROOM NO. 102

VIEW NE TOWARD DOOR

VIEW S.

ELLIS ISLAND EXISTING CONDITION SURVEY BAKERY & CARPENTRY SHOP page: 369

ROOM NO: 103 LAST KNOWN USE: STORAGE SQUARE FEET: 1,590. CEILING HEIGHT: 17'-7" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	—
WALLS:	☐ Plaster ☐ Gypsum Board ☒ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	PP - SOME EFFLORES. - W. SW CORNER - VERTICAL WOOD PLANK PARTITIONS - THICK WOOD DRS. - COOLER?
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	PP CEMENT PLASTER PARGING - CRACK
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☒ 1924-1938 ☐ 1939-Present ☐ In Question	3 PANELS - 1 WIRE GLASS
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact 5 Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	1 WHITE ENAMEL METAL RLM 5 DROP CORDS
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	CEILING HUNG - PARALLEL PIPE CLUSTERS - W, NNE.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	"BC 107" STENCILED OVER DOOR
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: **ROOM NO.** 103

VIEW S.W.

SW CORNER PARTITION

VIEW N.W.

VIEW E. TO ENTRY

PHOTOGRAPHS: ROOM NO. 103

VIEW E. FROM NW CORNER

Exhibit 9

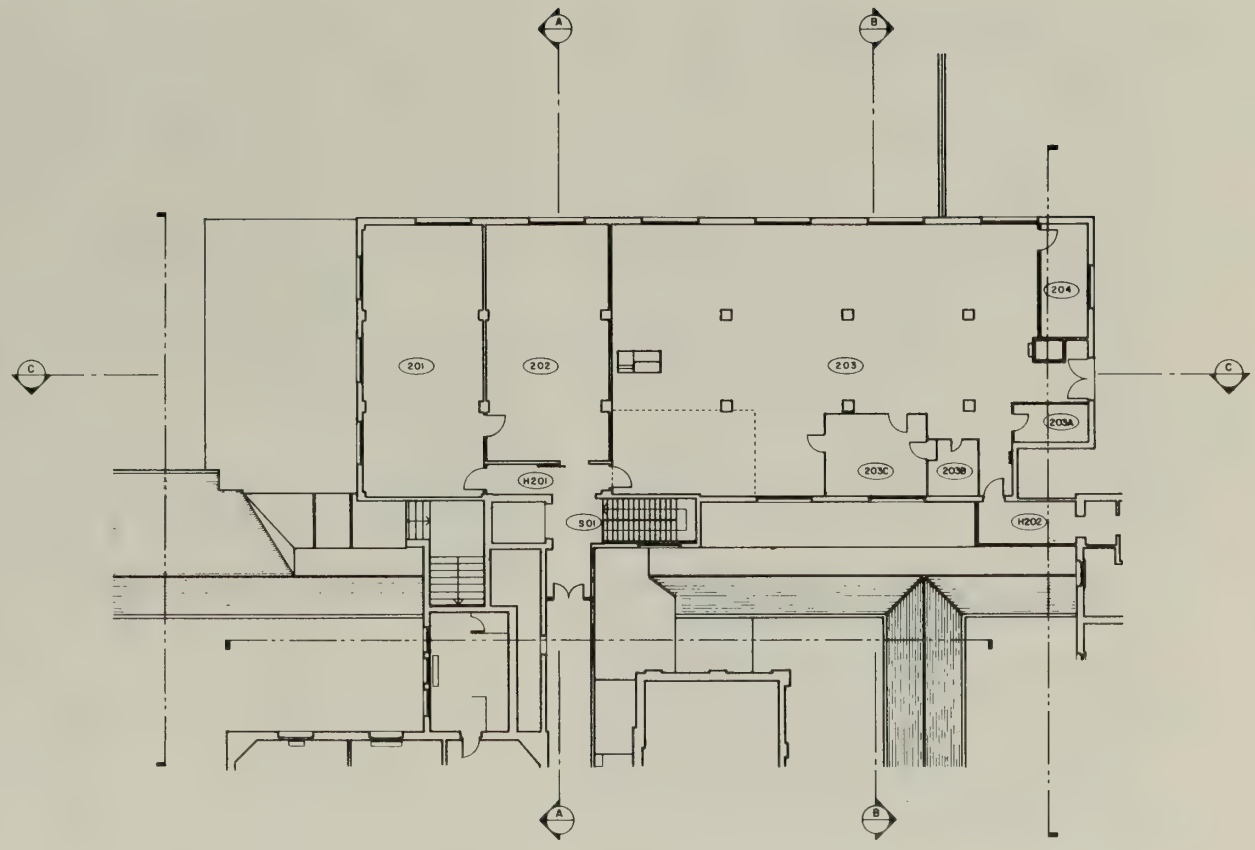

SCALE 1/8" = 1'-0"

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
SEYER BLINDER BELLE / ANDERSON NOTTER FINEGOLD
60 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3660

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | shl | REVISIONS | date | by

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
BAKERY & CARPENTRY SECOND FLOOR PLAN

SUB SHEET NO | DRAWING NO
PKG. NO | SHEET OF

ELLIS ISLAND EXISTING CONDITION SURVEY BAKERY & CARPENTRY SHOP page: 373

ROOM NO: 201 LAST KNOWN USE: PAINT SUPPLY SQUARE FEET: 663. CEILING HEIGHT: 13'-9" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	—
WALLS:	☒ Plaster N ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	PP
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	PARGED WOOD DECK - OVER E. END
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1915-1923 ? ☐ 1924-1938 ☐ 1939-Present ☐ In Question	N. DR. TO RM. 202 - POOR PP - UPPER WIRE GLASS DR. TO H201
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	6 - C.M.L.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☒ Vents/Fans ☐ Sink/Toilet/Urinal ☒ Other: SLOP SINK	5 ☐ Intact ☐ Destroyed 1 ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed 1 ☐ Intact ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☒ 1939-Present ? ☐ In Question	4 LEG SECTIONAL - S+W, E. 1 SLOP SINK - E. 1 - ROOF VENTILATOR
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	WOOD LADDER - N. TO STORAGE DECK WOOD SHELVES LINE N. WALL
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 201

VIEW NE.

VIEW SW

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAKERY & CARPENTRY SHOP — page: 375

ROOM NO: 202 LAST KNOWN USE: FLOUR STORAGE SQUARE FEET: 586. CEILING HEIGHT: 13'-9" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete ☒ Other: WOOD	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	WOOD STRIPS BULGING AT ENTRY
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	—
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK-W.	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	PLASTER - N, S & E PP W. - CRACK IN BRICK
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	FORMED CONCRETE OVER BEAMS
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☒ Fair E. ☒ Poor S. ☐ Destroyed	☐ 1915-1923 ☒ 1924-1938 ? ☐ 1939-Present ☐ In Question	E. - SLIDING FREIGHT DOOR S. - CORRODED, BROKEN GLASS LT.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ? ☐ In Question	CEILING MOUNTS - 6
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☒ Vents/Fans ☒ Sink/Toilet/Urinal ☒ Other: SHOWER	☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed 1 Intact ☐ Destroyed 1 Intact ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☒ 1939-Present ☐ In Question	ROUNDED PEDESTAL SINK ALUM. ENCLOSED SHOWER 1 - CEILING VENTILATOR
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 202

VIEW NE

VIEW SW

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAKERY & CARPENTRY SHOP — page: 377

ROOM NO: 203 LAST KNOWN USE: CARPENTER SHOP SQUARE FEET: 2,017. CEILING HEIGHT: 13'-9" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete ☒ Other: WOOD	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	WORN HATCH IN FLOOR TO RM. 10 - WOOD LADDER
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
WALLS:	☒ Plaster S, PART N. ☐ Gypsum Board ☒ Partitions WOOD ☒ Other: BRICK, E, W	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	CRACK ALONG CEILING - S. PP CONCRETE SQ. COLUMNS
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	PARGED - FORMED CONCRETE OVER BEAMS SE CORNER - WOOD DECK - STORAGE
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal S. ☐ Other:	☐ Good ☒ Fair ☒ Poor S. ☐ Destroyed	☐ 1915-1923 ☒ 1924-1938 ? ☐ 1939-Present ☐ In Question	WOOD + GLASS TO OFFICE (203A) GM TO RM. 204 - GLASS PANE MISSING
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed 2 Intact 12 Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ? ☐ In Question	DROP CORDS - 2 METAL SHADES INTACT
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☒ Vents/Fans ☒ Sink/Toilet/Urinal ☒ Other: SHOWER	5 Intact ☐ Destroyed 4 Intact ☐ Destroyed 1 Intact ☐ Destroyed 1 Intact ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☒ 1939-Present ☐ In Question	N. - ALUM. SHOWER ENCLOSURE 1 - BASIN TYPE SLOP SINK - S. 4 - ROOF VENTILATORS - OPEN CEILING
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	ALONG 203A - BELT-DRIVEN MACHINE CEILING HUNG ENGINE JIG-SAW, WORK TABLES, MISC. EQUIPMENT
SUMMARY:		☐ Good ☒ Fair ☐ Poor	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 203

VIEW NW

E. - OUTSIDE PARTITION - RM. 203A

NE CORNER

E. WALL

PHOTOGRAPHS: ROOM NO. 203

VIEW S.W.

S.W. CORNER

S.E. DOORWAY - WOOD DECK CEILING

HATCHWAY DOWN TO RM. 102

PHOTOGRAPHS:

ROOM NO. 203

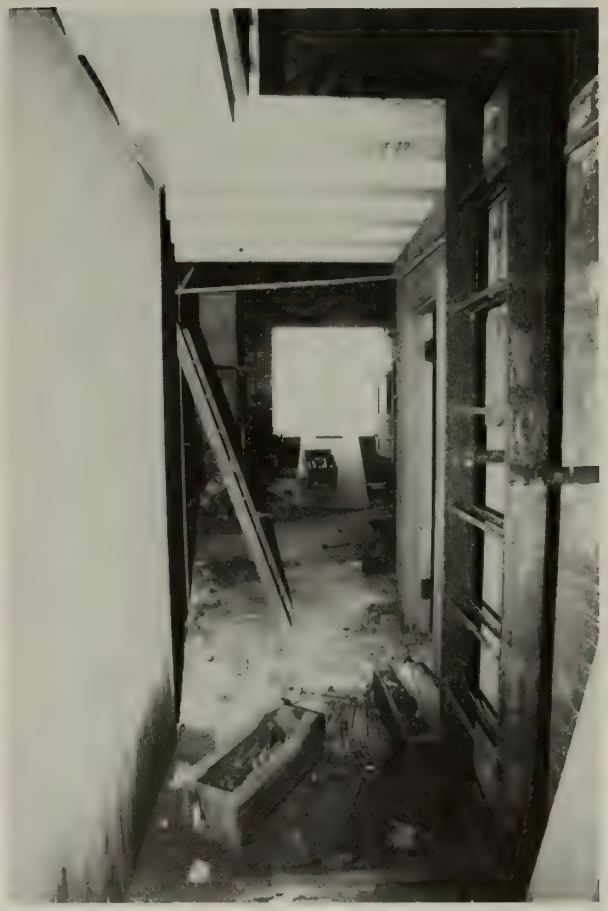

VIEW W.

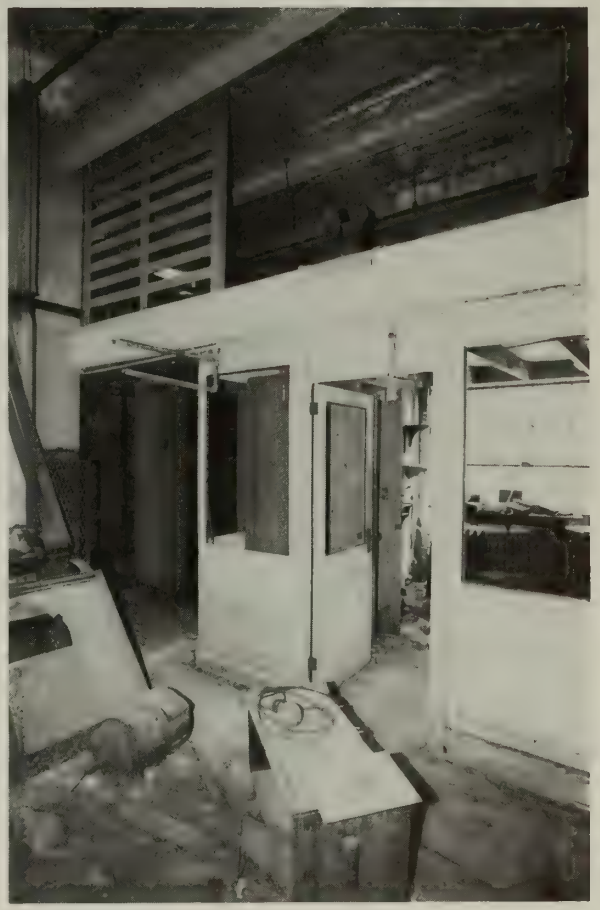

VIEW NE. - WOOD DECK

ELLIS ISLAND — EXISTING CONDITION SURVEY — BAKERY & CARPENTRY SHOP — page: 381

ROOM NO: 203A LAST KNOWN USE: HARDWARE SUPPLY CL. SQUARE FEET: 56. CEILING HEIGHT: 13'-9" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete ☒ Other: WOOD	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	—
WALLS:	☐ Plaster ☐ Gypsum Board ☒ Partitions WOOD ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 N+E ☒ 1924-1938 W+S ☐ 1939-Present ☐ In Question	BRICK - PP W.- 2-6/6 DOUBLE HUNG WINDOW - WIRE MESH ABOVE
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other WOOD	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☒ 1939-Present ☐ In Question	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☒ 1924-1938 ☐ 1939-Present ☐ In Question	DOOR KNOB MISSING GLASS - 2 WOOD PAN.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	1 - C.M.L.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	WOOD SHELVES - E, COUNTER W/ SHELVES - W. THICK PIGEON DROPPINGS
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☒ 1924-1938 ☐ 1939-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY BAKERY & CARPENTRY SHOP page: 383

ROOM NO: 203B LAST KNOWN USE: HARDWARE STORAGE SQUARE FEET: 57. CEILING HEIGHT: 8'-3" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete ☒ Other: WOOD	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	—
WALLS:	☐ Plaster ☐ Gypsum Board ☒ Partitions WOOD ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 E. ☒ 1924-1938 N, W, S ☐ 1939-Present ☐ In Question	N, W, S - WOOD (TONGUE-N-GROOVE) PARTITIONS E - BRICK
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other WOOD	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☒ 1939-Present ☐ In Question	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☒ 1924-1938 ☐ 1939-Present ☐ In Question	5 WD. PANELS NO KNOB - STRAP
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	CEILING MT. OUTLET
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	WOOD OPEN SHELVING ON N, E, S
SUMMARY:		☒ Good ☐ Fair ☐ Poor	☐ 1915-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor

PHOTOGRAPHS:

ROOM NO. 203B

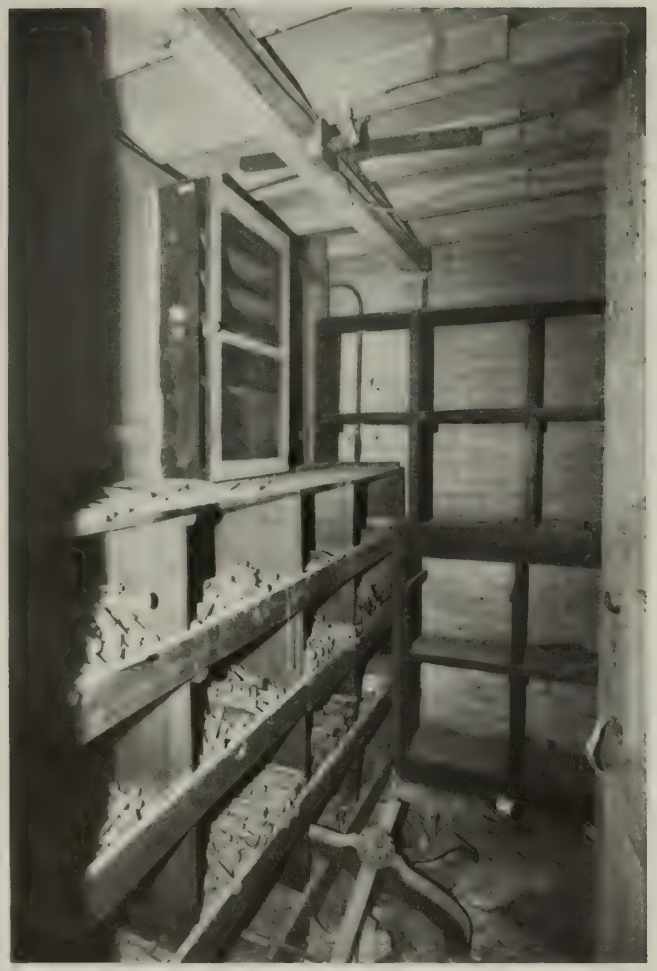

VIEW NE FROM DOOR

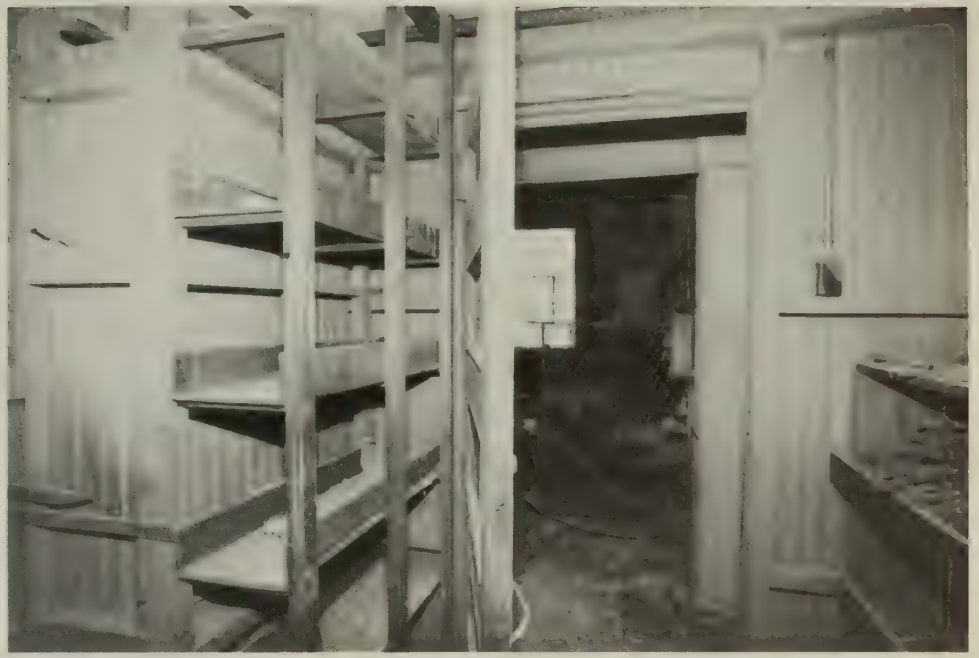

VIEW W.

ELLIS ISLAND EXISTING CONDITION SURVEY BAKERY & CARPENTRY SHOP page: 385

ROOM NO: 203C LAST KNOWN USE: OFFICE SQUARE FEET: 167. CEILING HEIGHT: 8'-3" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete ☒ Other: WOOD	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
WALLS:	☐ Plaster ☐ Gypsum Board ☒ Partitions WOOD ☒ Other: BRICK-E.	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 E. ☒ 1924-1938 N ☒ 1939-Present W,S ☐ In Question	N.-VERTICAL WOOD PANELING (T-IN-G) S & W - WOOD PANEL & GLASS - ALL GLASS MISSING N - STATIONARY 6 LT. WINDOW
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other WOOD	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☒ 1939-Present ☐ In Question	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☒ 1939-Present ☐ In Question	1-W, 1-S. - MISSING GLASS PANE 2-CLOSET DOORS - N. 1-2 WD. PANELS, 1-VERTICAL T-IN-G.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	1 - C.M.L. - CONDUIT FED
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☒ 1939-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 203C

NW CORNER

SE CORNER

NE CORNER

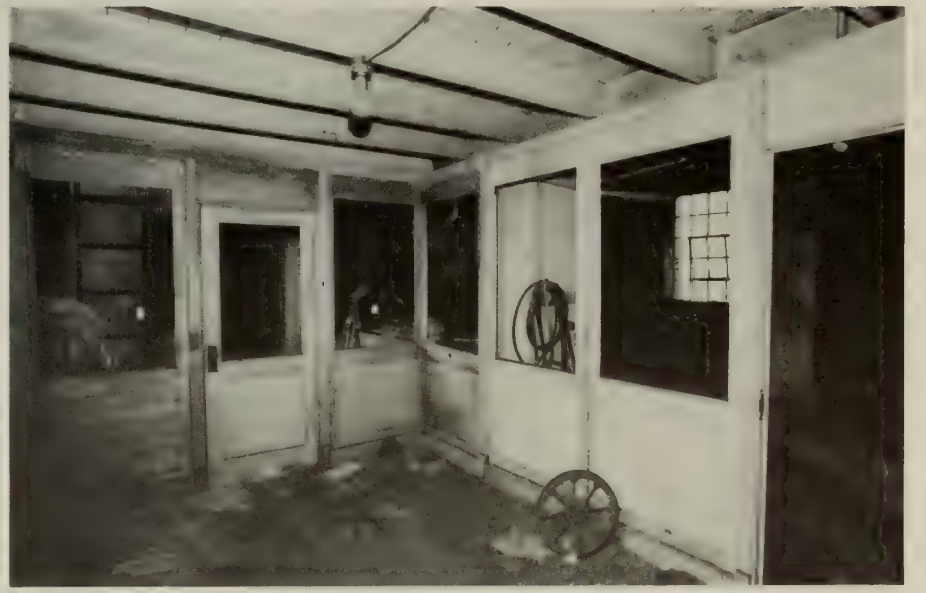

SW

ELLIS ISLAND EXISTING CONDITION SURVEY BAKERY & CARPENTRY SHOP

ROOM NO: H201 LAST KNOWN USE: HALL SQUARE FEET: 74. CEILING HEIGHT: 13'-9" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK - E.	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	PP
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	PP
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	W. - SLIDING FREIGHT DOOR N & S E. - OPEN TO H201 (K&L)
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	DROP CORD FROM PORCELAIN MT.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
SUMMARY:		☒ Good ☐ Fair ☐ Poor	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor

PHOTOGRAPHS:

ROOM NO. H201

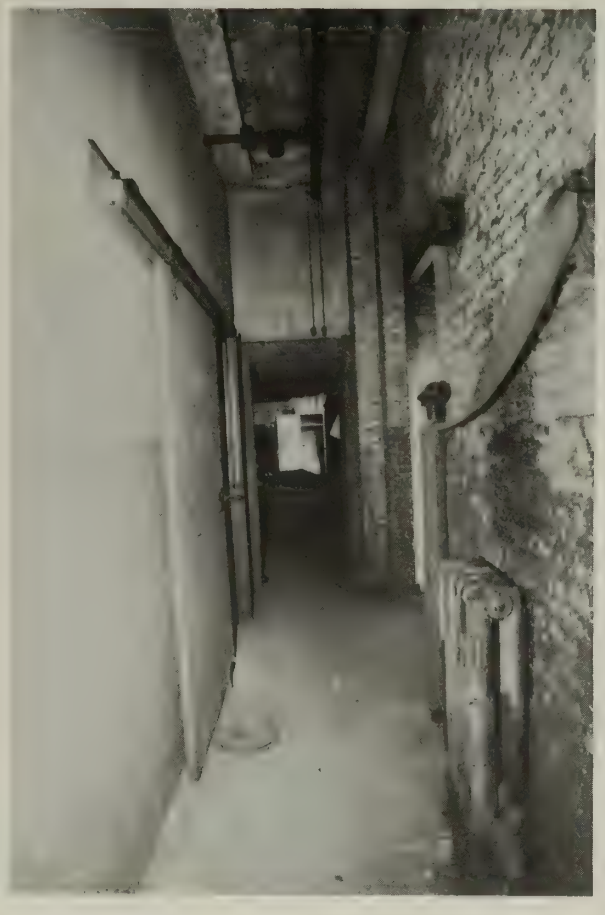

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY BAKERY & CARPENTRY SHOP page: 389

ROOM NO: H202 LAST KNOWN USE: HALL TO POWERHOUSE SQUARE FEET: 84 CEILING HEIGHT: 10'-5" DATE: 9/11/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	—
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK - N.	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	SURFACE SPALL PP
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	C.M.L.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	W.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	E. - FIRE HOSE
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1915-1923 ☐ 1924-1938 ☐ 1939-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. H202

VIEW S. FROM POWERHOUSE

VIEW N.

S.E. CORNER - DOORWAY TO B+C AT RIGHT

ROOM NO: S01 LAST KNOWN USE: Stairway SQUARE FEET: CEILING HEIGHT: DATE: 9/11/84

DESCRIPTION:

General: Stair enclosure built out from east wall of bakery and carpentry shop with three landings, serving the first and second floors. Stair structure is cast iron with wrought iron railings and cast iron newels, wood handrail. Access to stair is from the second floor of H201- kitchen and laundry building, or on the first floor from corridor 5.

Floor: Concrete landings at second and first floor. Stair steps and landing are of cast iron with abrasive treads.

Base: Cast iron channel wall string.

Walls: Painted brick.

Ceiling: Formed concrete over beams.

Floor: Fair condition. Surface corroded and pitted.

Base: Surface corrosion and flaking.

Walls: Peeling paint and long vertical crack in north wall.

Ceiling: Fair condition. Areas of exposed reinforcing bars where concrete has spalled off.

SUMMARY:

- [ ] Good
- [X] Fair
- [ ] Poor
- [ ] Destroyed

- [X] 1915-1923
- [ ] 1924-1938
- [ ] 1939-Present
- [ ] In Question

ARCHITECTURAL SIGNIFICANCE:

- [ ] Most
- [ ] Some
- [X] Minor
- [ ] Negligible

PHOTOGRAPHS:

ROOM NO. S01

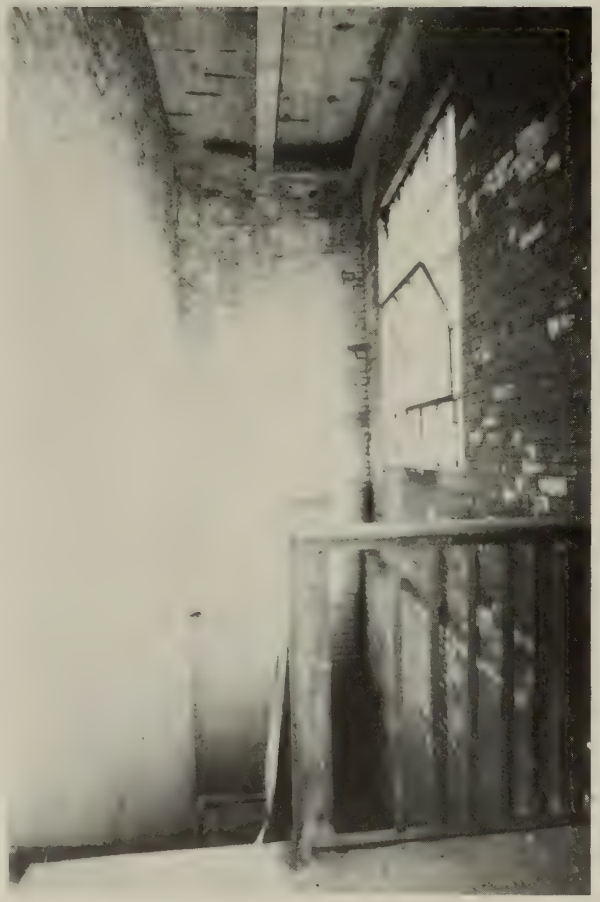

CORRIDORS & COVERED WAYS

EXHIBIT 3

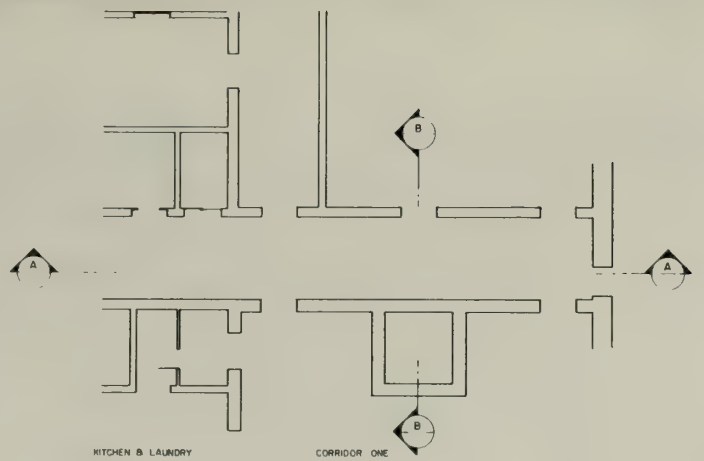

BASEMENT PLAN

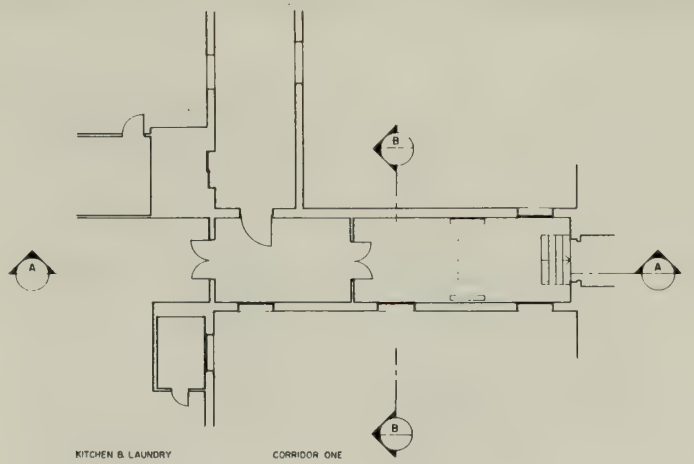

SECOND FLOOR PLAN

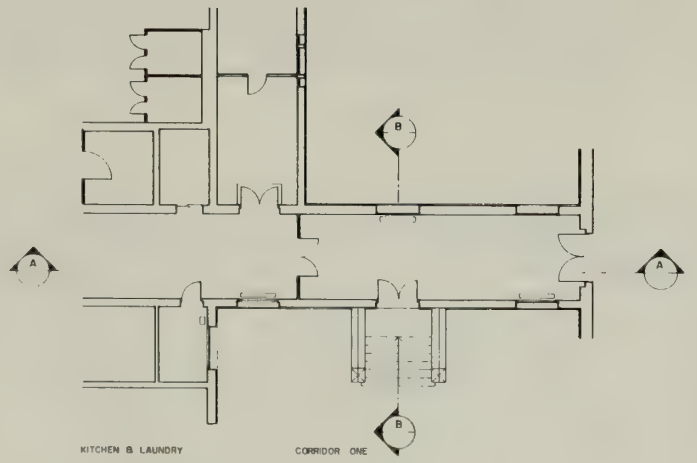

FIRST FLOOR PLAN

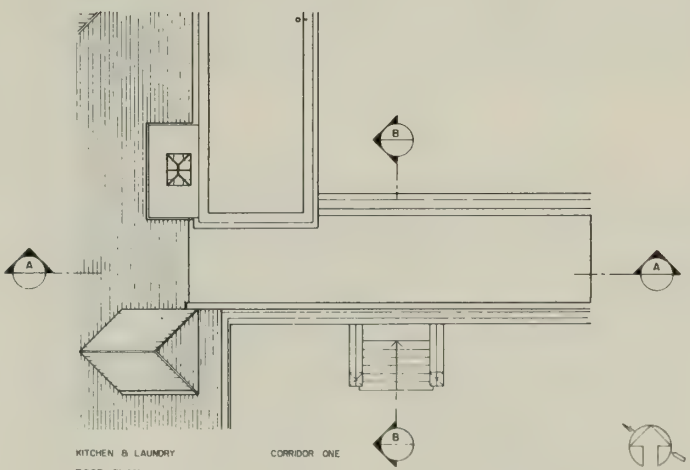

ROOF PLAN

SCALE 1/4" = 1'-0"

OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | sht | REVISIONS | date | ini

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
CORRIDOR ONE
PLANS

SUB SHEET NO | DRAWING NO

PKG NO | SHEET
OF

ROOM NO: 101 +201 LAST KNOWN USE: Hallway SQUARE FEET: 624 CEILING HEIGHT: 15'-10" DATE: 9/4/84

DESCRIPTION:

General: The first floor of the corridor is an undivided passageway and the second floor has a single partition. Both floors of the corridor are protected by wood railings along the center of the corridors with overhead plywood protection. A wooden ramp on the second floor covers the four steps up to the main building.

Floor: The first floor is finished with concrete and the second floor is tiled in 3/4" square white tile with an ornamental black fret pattern border.

Base: Cement plaster wainscot 5'-5" high on the first floor and tile wainscot on the second floor in 3/4" square white tile with an upper band of black tile and a band of red tile.

Walls: Plaster walls over terra-cotta block. Exposed stone quoining at east end on first floor. Plastered partition wall on second floor toward west end.

Ceiling: Plaster over terra-cotta block.

Doors/Openings: Wood double doors with one wire glass light over two wood panels each, at center entry on first floor and at west end on second floor. Galvanized metal double doors, each with small wire glass light, at west end to kitchen and laundry building and in partition wall on second floor.

Lighting: Not visible.

Floor: Generally good.

Base: Some vertical cracking in the first floor wainscot.

Walls: Over 80% of the finish is destroyed.

Ceiling: Very poor condition. Areas of exposed and falling metal lath.

Doors/Openings: Right door panels replaced with ply at entry door. Edges very worn and hardware missing. Edges corroded and hardware missing on galvanized doors.

SUMMARY:

- [ ] Good
- [ ] Fair
- [X] Poor
- [ ] Destroyed

- [ ] 1901

ARCHITECTURAL SIGNIFICANCE:

- [ ] Most
- [X] Some
- [ ] Minor
- [ ] Negligible

PHOTOGRAPHS: **ROOM NO.** 101

VIEW W. FROM MAIN BLDG. ENTRANCE

VIEW E.

VIEW W. FROM CENTER - ENTRY - LEFT.

VIEW E. FROM ENTRY (RIGHT)

PHOTOGRAPHS: ROOM NO. 201

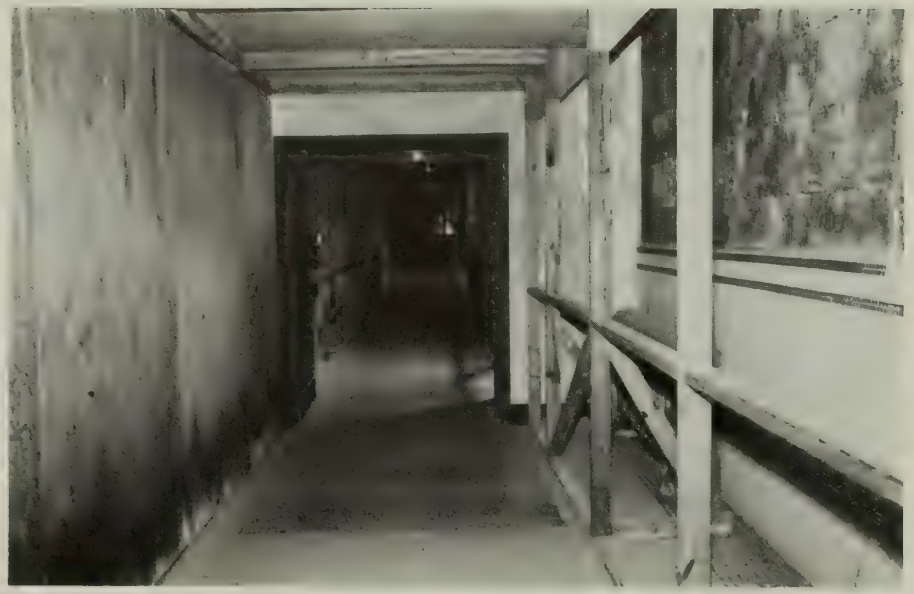

VIEW E. FROM ENTRY TO K&L BLDG.

VIEW W. FROM E. END

PHOTOGRAPHS:

ROOM NO. 201

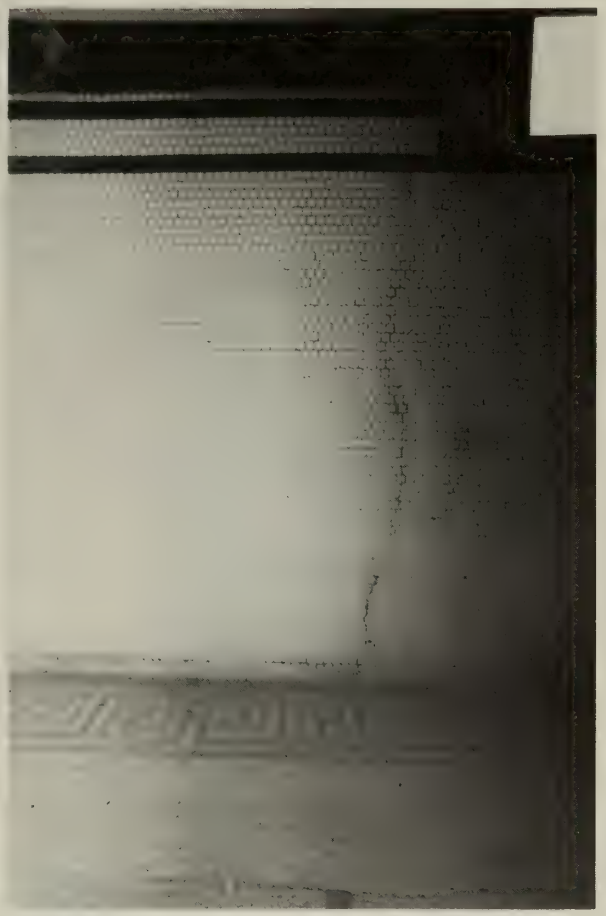

SQUARE TILE PATTERNS

EXISTING CONDITIONS

Exhibit 6

356 | 26,006 / 24 of 34
DSC | JUL 88

GOOD
FAIR
POOR

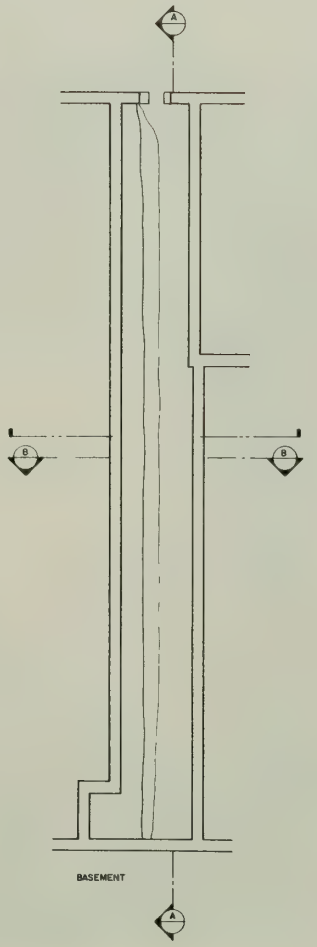

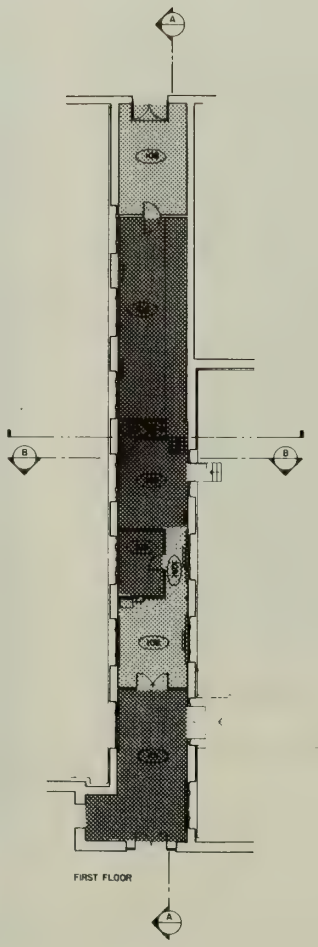

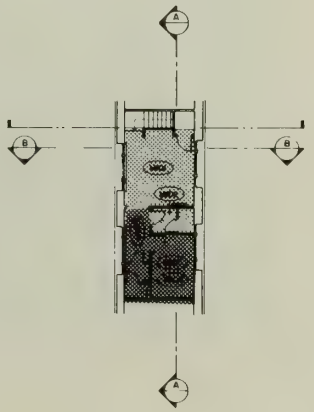

SCALE 1/8" = 1'-0"

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
60 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

REVISIONS

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
CORRIDOR 2
FLOOR PLANS

SUB SHEET NO | DRAWING NO

PKG NO | SHT OF

EXISTING CONDITIONS

Exhibit 7

356 | 26,006 / 25 of 34

DSC | JUL 88

GOOD

FAIR

POOR

DESTROYED

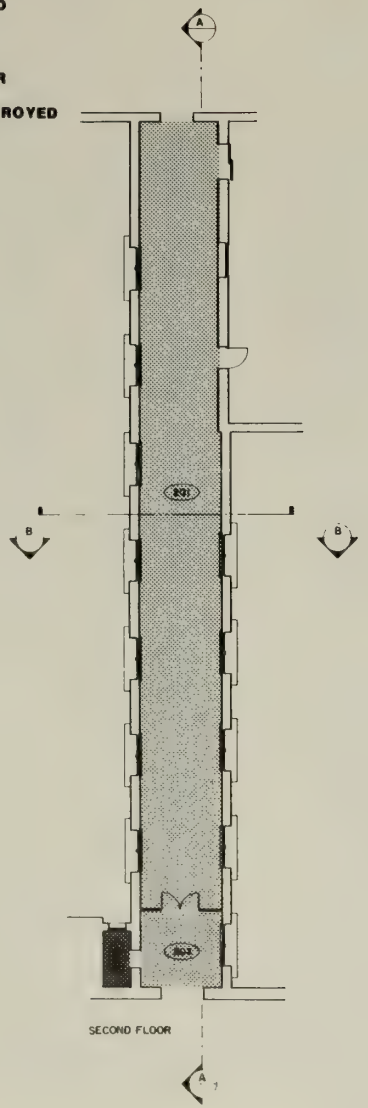

SECOND FLOOR

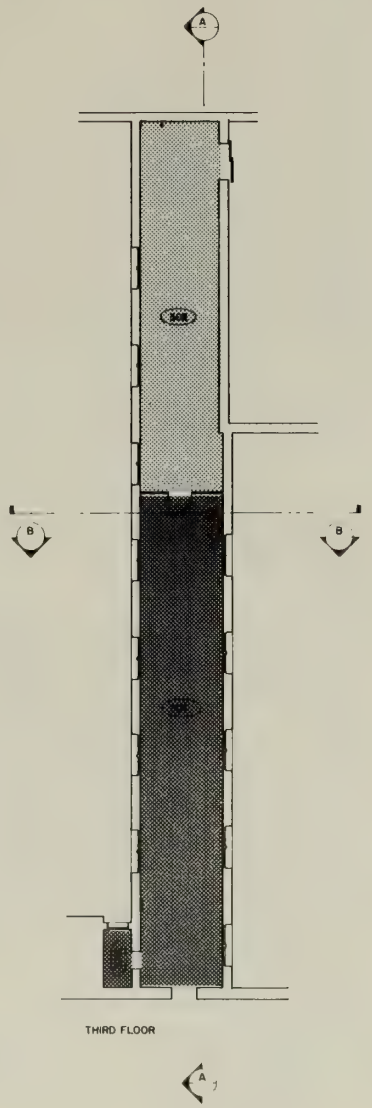

THIRD FLOOR

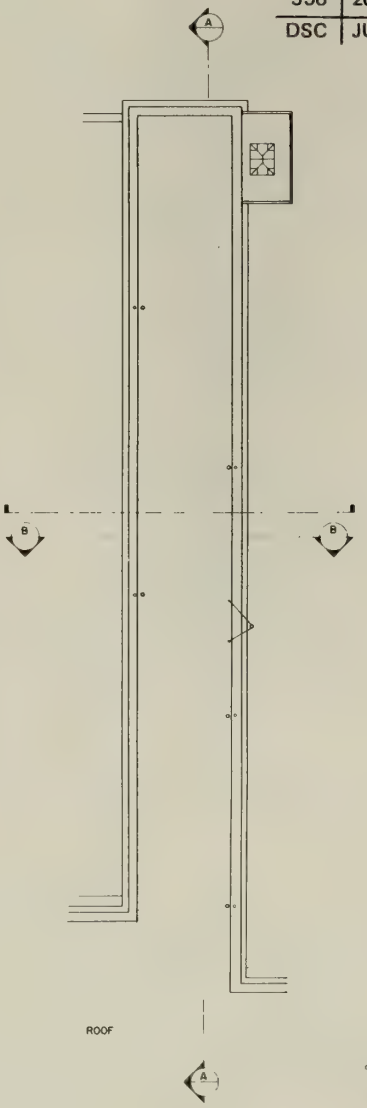

ROOF

8 0 8 16

SCALE 1/8" = 1'-0"

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD

80 FIFTH AVENUE
NEW YORK, NY 10114

(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY NATIONAL MONUMENT

NEW YORK / NEW JERSEY

mk | sht | REVISIONS | date | ini

DESIGNED | DATE

DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET

CORRIDOR 2
FLOOR PLANS

SUB SHEET NO | DRAWING NO

PKG NO | SHEET

OF

Exhibit 3

356 | 26,006 / 26 of 34
DSC | JUL 88

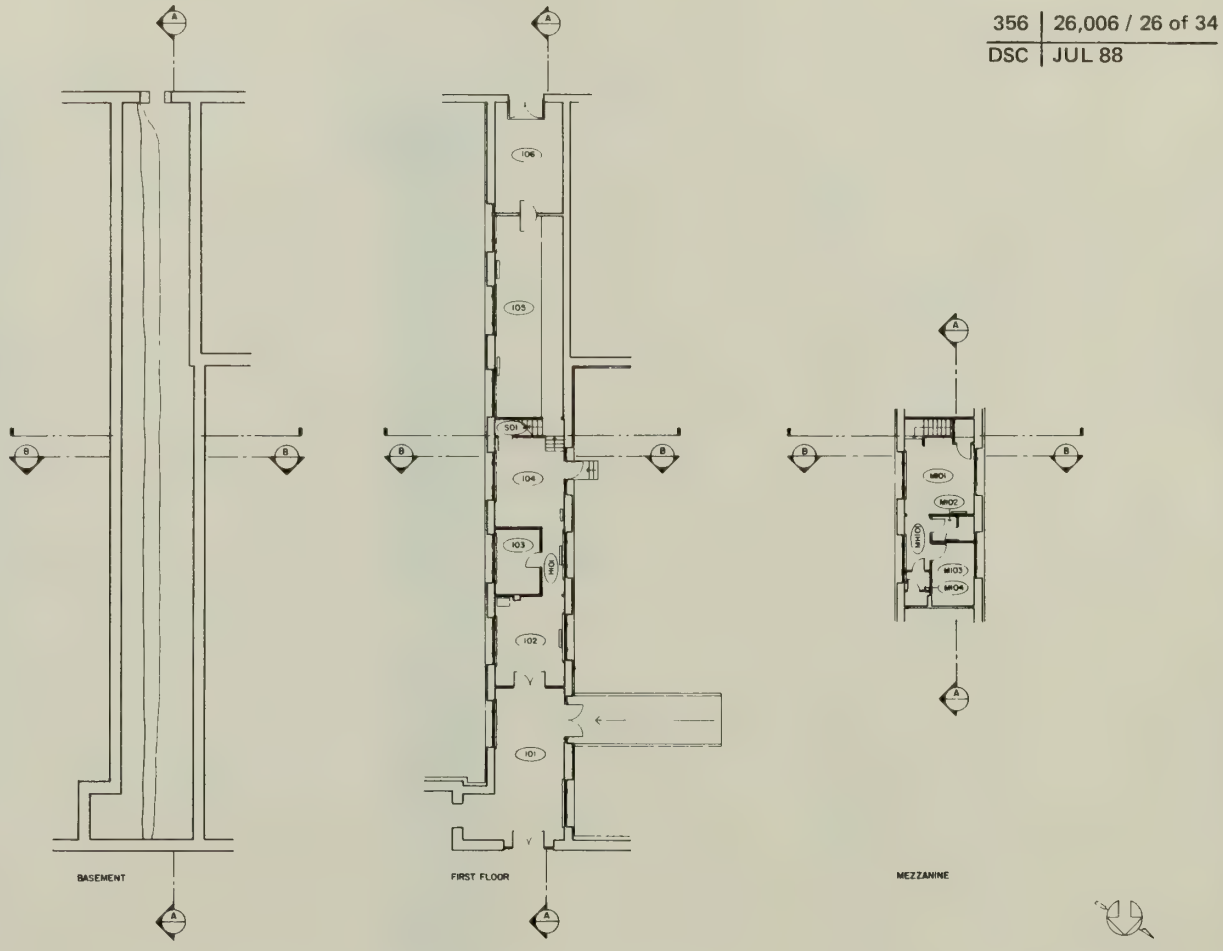

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
60 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3980

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | wh | REVISIONS | date | ini

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
CORRIDOR 2
FLOOR PLANS

SUB SHEET NO | DRAWING NO

PKG NO | SHEET OF

ELLIS ISLAND — EXISTING CONDITION SURVEY — CORRIDOR 2 — page: 401

ROOM NO: 101 LAST KNOWN USE: SQUARE FEET: 341. CEILING HEIGHT: 19'-0" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N.- DESTROYED W.- EXP. T.C. E.- GREEN DISCOLOR., CHIPPING
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	ALL EXP. T.C. EXCEPT S. WALL- GOOD
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PARGING FINISH GONE EXPOSED REINF. BARS IN CONCRETE
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	S+N- DOUBLE DR.- SMALL GLASS @ S. -MISSING HARDWARE W. - WIRE GLASS VENEER SEPARATING AT BASE
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	2 DROP CORDS - CEILING MT.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	1 - W.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	ASBESTOS COVERED PIPE - VERTICAL NEAR W. WALL
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 101

N. DOORS

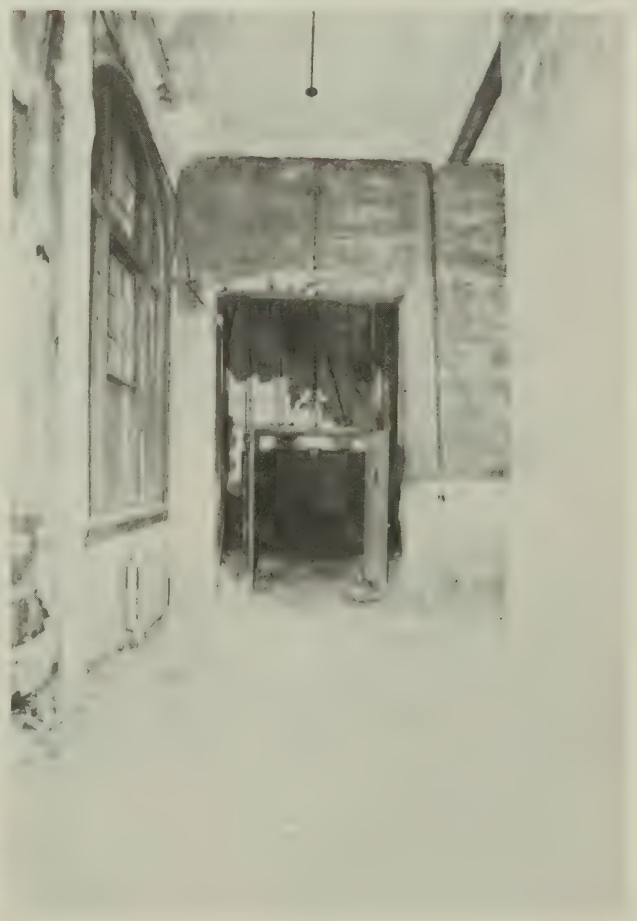

VIEW N.

VIEW S.W.

ELLIS ISLAND — EXISTING CONDITION SURVEY — CORRIDOR 2 — page: 403

ROOM NO: 102 LAST KNOWN USE: SQUARE FEET: 176. CEILING HEIGHT: 19'-0" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	DEBRIS OVER TILE
BASE:	☐ Wood ☐ Tile ☒ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 E+W ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	5'- E+W - PAINTED E.- MISSING TILES
WALLS:	☒ Plaster N, E, W ☒ Gypsum Board S. ☐ Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 E+W, N ☐ 1913-1923 ☒ 1924-1938 S. ☐ 1939-Present	W.- EXP. TO T.C. E.- FLAKING N+S- PP
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	EXP. REINF. CONCRETE
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	1- N.- DOUBLE DR.- W/ SMALL WIRE GLASS PANES NO HARDWARE, PP
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	RLM W/ WHITE GLOBE
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☒ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	SINK- SQ. PEDESTAL - S.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 102

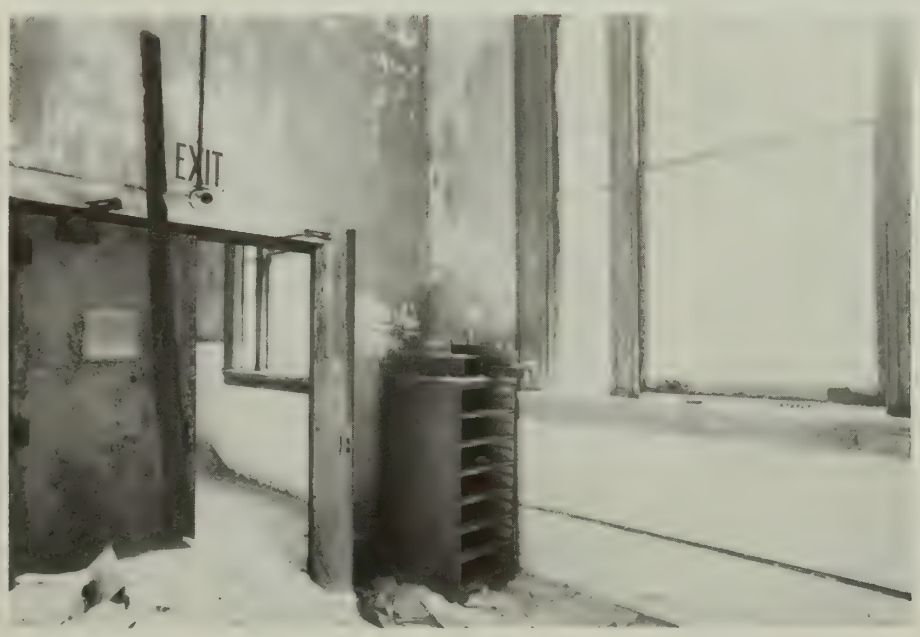

NE CORNER

S. WALL

ELLIS ISLAND — EXISTING CONDITION SURVEY — CORRIDOR 2 — page: 405

ROOM NO: 103 LAST KNOWN USE: SQUARE FEET: 84. CEILING HEIGHT: 9'-0" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[X] Wood SW [ ] Tile [X] Tile Wainscot E. [ ] Other:	[X] Good E. [ ] Fair [ ] Poor [X] Destroyed S+W	[X] 1909-1912 E. [ ] 1913-1923 [X] 1924-1938 W,S [ ] 1939-Present	E.- PAINTED TILE - PEELING N - NOT VISIBLE
WALLS:	[X] Plaster E. [X] Gypsum Board [ ] Partitions [ ] Other:	[X] Good PLASTER [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 E. [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other G. BOARD	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	EXPOSED WOOD FRAME CRUMBLING
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	5 PANEL - PP
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	SMALL FLARED SHADE - METAL C.M.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [X] Other: WASH BASIN	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	2-RD. FRONT LEGS
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 103

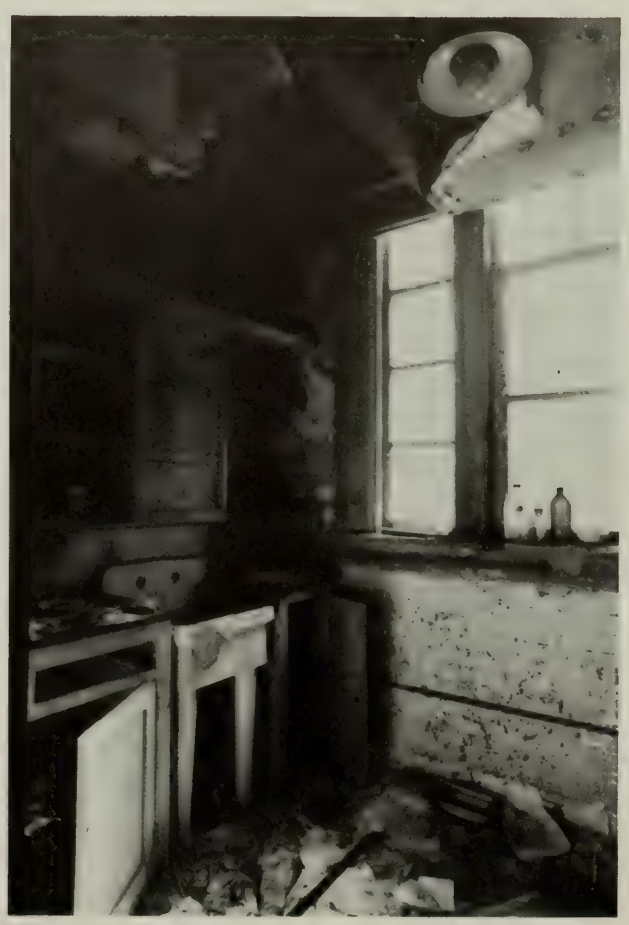

NE. CORNER

N. WALL

ELLIS ISLAND — EXISTING CONDITION SURVEY — CORRIDOR 2 — page: 407

ROOM NO: 104 LAST KNOWN USE: OFFICE SQUARE FEET: 176. CEILING HEIGHT: 9'-0" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile HEX - UNDER VINYL [X] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 TILE [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	4 WOOD STEPS - SW CORNER - UP TO RM 105 AREA OF CRUMBLED VINYL - EXPOSED TILE
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot E, W. [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING TILES BULGE IN E. WALL
WALLS:	[X] Plaster W + E [X] Gypsum Board S, N. [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 W, E. [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	EXP. T.C. N. - SECTION GONE
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other G.B.	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	OVER WOOD FRAMING OF MEZ
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	S. - TO CLOSET W. - STILES + TOP RAIL ONLY REMAIN
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [2] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	HANGING METAL MOUNTS
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	W.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 104

NE.

VIEWS.

ELLIS ISLAND **EXISTING CONDITION SURVEY** **CORRIDOR 2** **page:** 409

ROOM NO: 105 LAST KNOWN USE: SQUARE FEET: 389. CEILING HEIGHT: DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl OVER WOOD [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	FLOOR IS WOOD PLATFORM OVER ORIGINAL RAMPED FLOOR HOLES IN WOOD PLANK FLOORING VERY WEAK
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot E+W [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	MISSING TILES AREAS OF BULGING
WALLS:	[X] Plaster E, W [X] Gypsum Board N+S [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 E, W [ ] 1913-1923 [X] 1924-1938 N, S [ ] 1939-Present	W.- PLASTER DESTROYED FROM N. TO PAST EDGE OF K+L BLDG.- EXPOSING EXT. BRICK + QUOINING E- 50% EXP. T.C.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED CONCRETE SLAB
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	1- S.- UPPER GLASS, 2 WOOD PAN. SWINGING
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	1 Intact 2 Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	PIPE SUSPENDED 1 GLOBE INTACT, 2- HOODS
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	2 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	E.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	RAISED STEP PLATFORM
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 105

VIEW N.E.

VIEW S.

ROOM NO: 106 LAST KNOWN USE: SQUARE FEET: 214. CEILING HEIGHT: DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	FALSE PLATFORM OF WOOD
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot N,E,W [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	CRACKING AT NE CORNER SOME HOLES PAINTED SECTION — W.
WALLS:	[X] Plaster [X] Gypsum Board N. [ ] Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 N. [ ] 1939-Present	S & SE CORNER - DESTROYED W. - PP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	SPOT OF EXPOSED BROWN COAT
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[X] Good [X] Fair S. [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 N [ ] 1939-Present	S. - DOUBLE DR. - METAL BOTTOM PANELS OVER WOOD - 1 DR. - WIRE GLASS PANE, 1 - INFILLED W/ WOOD N - SWINGING - 1 GLASS, 2 WD. PAN.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	1 - SUSPENDED PIPE W/ BULB
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [X] 1939-Present	WINDOW FAN IN NE CORNER
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 106

VIEW S.W.

VIEW NE.

ELLIS ISLAND **EXISTING CONDITION SURVEY** **CORRIDOR 2** **page:** 413

ROOM NO: H101 LAST KNOWN USE: PASSAGE SQUARE FEET: 44. CEILING HEIGHT: 9'-0" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	DEBRIS OVER HEX TILE
BASE:	☒ Wood E ☐ Tile ☒ Tile Wainscot W. ☐ Other:	☐ Good ☒ Fair ☒ Poor WOOD ☐ Destroyed	☒ 1909-1912 TILE ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	SOME TILES MISSING WOOD - ROT.
WALLS:	☒ Plaster W. ☒ Gypsum Board E. ☐ Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☒ Destroyed W.	☒ 1909-1912 W. ☐ 1913-1923 ☒ 1924-1938 E. ☐ 1939-Present	W. - EXP. T.C. E. - PP - WALLPAPER UNDER
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other G. BOARD	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	PEELING LAMER AT W. SIDE
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	5 PANEL - E & S
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	W. - CORRODED
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☒ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

ELLIS ISLAND EXISTING CONDITION SURVEY CORRIDOR 2 page: 411

ROOM NO: M101 LAST KNOWN USE: SQUARE FEET: 147. CEILING HEIGHT: 9'-3" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Concrete ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	
WALLS:	☒ Plaster W,E ☒ Gypsum Board N,S ☐ Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 E+W ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	N+S - GOOD W - FAIR, OUTER COATS PEELING E - POOR, EXP. T.C.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	LARGE E/W CRACK EXPOSED BROWN COAT
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	1 - TO CLOSET - S. WALL 5 WD. PANEL
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	METAL SHADE - CEILING MOUNT
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	E.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	VERTICAL PIPES ALONG W. WALL THROUGH FLOOR
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. M101

SE CORNER

WEST WALL

N.W. CORNER

ELLIS ISLAND EXISTING CONDITION SURVEY CORRIDOR 2 page: 416

ROOM NO: M102 LAST KNOWN USE: TOILET SQUARE FEET: 28. CEILING HEIGHT: 9'-3" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Concrete ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	
WALLS:	☒ Plaster W. ☒ Gypsum Board S, E. ☒ Partitions WOOD ☐ Other:	☒ Good ☐ Fair ☒ Poor PLASTER ☐ Destroyed	☒ 1909-1912 W. ☐ 1913-1923 ☒ 1924-1938 S.E. ☐ 1939-Present	W. - EXPOSED T.C. TOILET PARTITION - WOOD DOOR
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	LARGE CRACK IN CONCRETE
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	5 WD. PANEL - E.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	INTACT - STAR GLASS CEILING MT.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☒ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed 2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	1 CORNER SINK 1 STRAIGHT LEG TOILET
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. M102

ELLIS ISLAND EXISTING CONDITION SURVEY CORRIDOR 2 page: 418

ROOM NO: M103 LAST KNOWN USE: SQUARE FEET: 73. CEILING HEIGHT: 9'.3" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	___ Tile X Vinyl ___ Concrete ___ Other:	___ Good ___ Fair ___ Poor ___ Destroyed	___ 1909-1912 ___ 1913-1923 X 1924-1938 ___ 1939-Present	DEBRIS
BASE:	X Wood ___ Tile ___ Tile Wainscot ___ Other:	X Good ___ Fair ___ Poor ___ Destroyed	___ 1909-1912 ___ 1913-1923 X 1924-1938 ___ 1939-Present	BOARD
WALLS:	X Plaster W X Gypsum Board ___ Partitions ___ Other:	___ Good X Fair G.B. ___ Poor X Destroyed W.	X 1909-1912 PLASTER ___ 1913-1923 X 1924-1938 N.E.S. ___ 1939-Present	
CEILING:	X Plaster ___ Acoustic panels ___ Cove ___ Other	___ Good ___ Fair ___ Poor X Destroyed	X 1909-1912 ___ 1913-1923 ___ 1924-1938 ___ 1939-Present	EXPOSED CONCRETE ✓ BROWN COAT
DOORS/ OPENINGS:	X Wood/Glass Panelled ___ Wood Veneer ___ Galvanized Metal ___ Other:	X Good ___ Fair ___ Poor ___ Destroyed	___ 1909-1912 ___ 1913-1923 X 1924-1938 ___ 1939-Present	5 WD PANEL PP
LIGHTING:	___ Incandescent/Type A X Incandescent/Type B ___ Incandescent/Type C ___ Other:	___ Intact ___ Destroyed 1 Intact ___ Destroyed ___ Intact ___ Destroyed ___ Intact ___ Destroyed	___ Pre-1924 X Post-1924 ___ In Question	METAL SHADE - CEILING MT.
HEATING/ VENTILATION PLUMBING:	___ Radiators ___ Vents/Fans ___ Sink/Toilet/Urinal ___ Other:	___ Intact ___ Destroyed ___ Intact ___ Destroyed ___ Intact ___ Destroyed ___ Intact ___ Destroyed	___ 1909-1912 ___ 1913-1923 ___ 1924-1938 ___ 1939-Present	
MISCELLANEOUS:		___ Good ___ Fair ___ Poor ___ Destroyed	___ 1909-1912 ___ 1913-1923 ___ 1924-1938 ___ 1939-Present	WOOD SHELVES - N.
SUMMARY:		___ Good ___ Fair X Poor ___ Destroyed	___ 1909-1912 ___ 1913-1923 X 1924-1938 ___ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ___ Most ___ Some ___ Minor X Negligible

PHOTOGRAPHS:

ROOM NO. M103

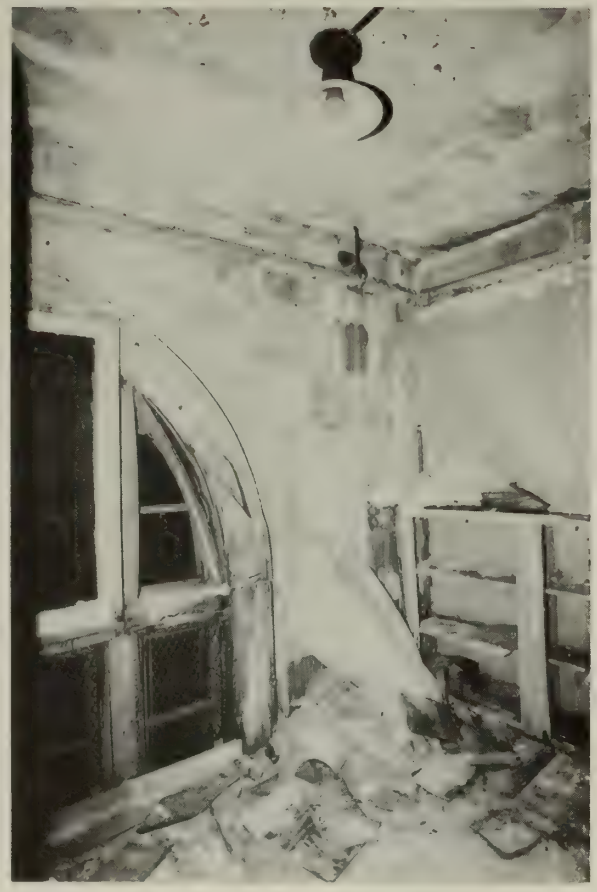

ELLIS ISLAND EXISTING CONDITION SURVEY — CORRIDOR 2 — page: 420

ROOM NO: M104 LAST KNOWN USE: TOILET SQUARE FEET: 24. CEILING HEIGHT: 9'-3" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	SQUARES DEBRIS
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	
WALLS:	☒ Plaster E - GOOD ☒ Gypsum Board W. ☒ Partitions WOOD ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912-E. ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	PLASTER - SOME CRACKING G.B. - PEELING TOILET PARTITION - WOOD OR. OFF HINGE
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	EXPOSED BROWN COAT
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	5 WD. PANEL
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☒ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	1-C.M.L.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☒ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	1- CORNER SINK 1- TOILET - STRAIGHT LEG BASE
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. M104

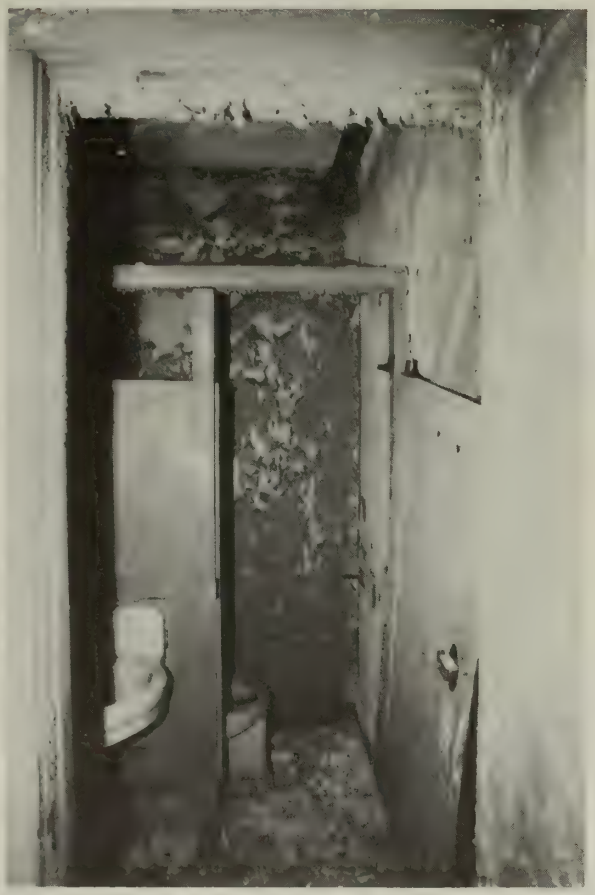

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY CORRIDOR 2 page: 422

ROOM NO: MH101 LAST KNOWN USE: HALL SQUARE FEET: 39. CEILING HEIGHT: 9'-3" DATE: 8/30/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	DEBRIS VINYL SQUARES
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	BOARD PP
WALLS:	[X] Plaster E. [X] Gypsum Board [ ] Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [X] Destroyed PLASTER	[X] 1909-1912 E. [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	E.-EXPOSED T.C. G.B.- SOME DETERIOR. AT TOP
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED CONCRETE
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	METAL SHADE- FLARED -CEILING MT.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WOOD CABINET- E. WALL
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. MH101

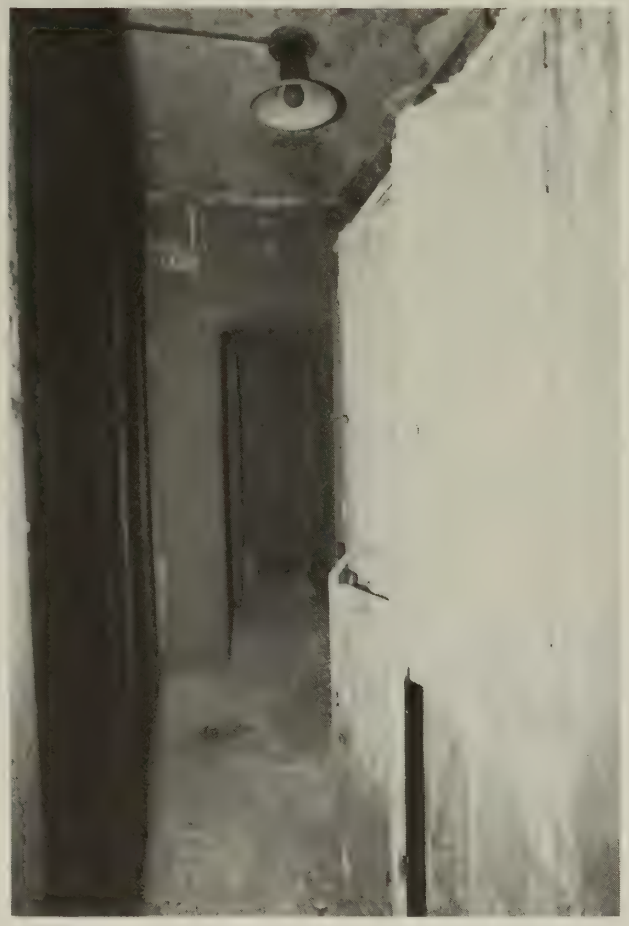

356 | 26,006 / 27 of 34
DSC | JUL 88

Exhibit 4

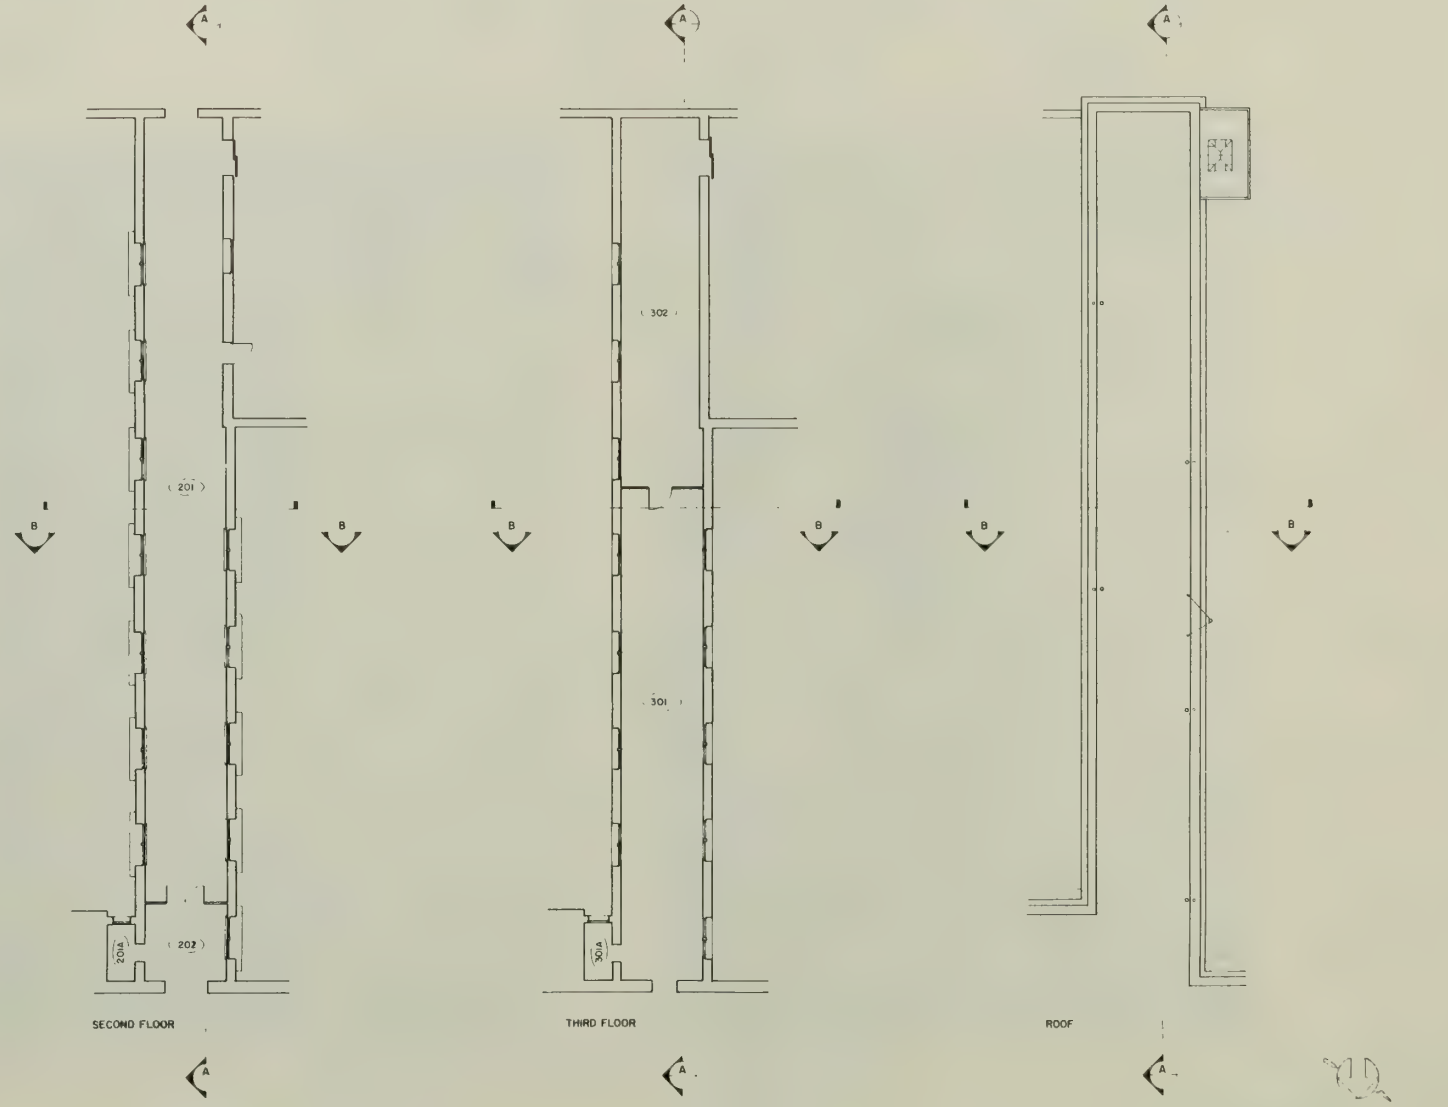

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | sht | REVISIONS | date | in

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
CORRIDOR 2
FLOOR PLANS

SUB SHEET NO | DRAWING NO

PKG NO | SHEET
OF

ELLIS ISLAND EXISTING CONDITION SURVEY CORRIDOR 2 page: 425

ROOM NO: 201 LAST KNOWN USE: PASSAGEWAY SQUARE FEET: 325. CEILING HEIGHT: 12'-0" DATE: 8/2/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	RETILED - 1933 WHITE HEX - GREEN SQ. TILE BORDER 10" WIDE (3" SQUARES)
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5'-3/4" h. SECTIONS OF TILE MISSING
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	BETWEEN 10 BAYS - EXPOSED T.C. OR PLASTER BULGING OUT EXPOSED BRICK - S. END ON W. WALL
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	9 LATERAL CRACKS - CONCRETE REINF. RODS EXPOSED
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor 3 [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	W. - TO K+L - MISSING WD. PANEL N. - TO B&D - WIRE GLASS, 3 PAN. S. END - ELEVATOR DOOR - 1911
LIGHTING:	[X] Incandescent/Type A 5 — Intact [ ] Destroyed [ ] Incandescent/Type B — Intact [ ] Destroyed [ ] Incandescent/Type C — Intact [ ] Destroyed [ ] Other: — Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CHAIN SUSPENDED
HEATING/ VENTILATION PLUMBING:	[ ] Radiators — Intact [ ] Destroyed [ ] Vents/Fans — Intact [ ] Destroyed [ ] Sink/Toilet/Urinal — Intact [ ] Destroyed [ ] Other: — Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 201

VIEW N.

E. WALL - LOOKING S.E.

VIEW S. FROM MIDWAY

ELLIS ISLAND — EXISTING CONDITION SURVEY — CORRIDOR 2 — page: 427

ROOM NO: 202 LAST KNOWN USE: HALLWAY SQUARE FEET: 129. CEILING HEIGHT: 12'-0" DATE: 8/2/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	RETILED - DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	5' h. LOOSE - DAMP WALL
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED T.C.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	REINFORCING CORRODED IN SPOTS
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor 2 [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	WIRE GLASS CT. — CORRODED METAL
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	CHAIN SUSPENDED
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	—
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[✓] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

ELLIS ISLAND EXISTING CONDITION SURVEY CORRIDOR 2 page: 428

ROOM NO: 301 LAST KNOWN USE: SQUARE FEET: 852. CEILING HEIGHT: 15'-10" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DEBRIS
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
WALLS:	[X] Plaster [ ] Gypsum Board [X] Partitions WOOD [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	PLY. PARTITION - S.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	N. END - HANGING LATH DESTROYED AT WALL PERIMETERS
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal N. [X] Other: SCREEN - S.	[X] Good S. [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [X] 1924-1938 [ ] 1939-Present	SCREEN - WOOD FRAME - PARTITION WALL N. - G.M. - WIREGLASS PANE PANELS CORRODED
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 - C.M. DROP CORDS
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[4] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1909-1912 [X] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 301

VIEW S.

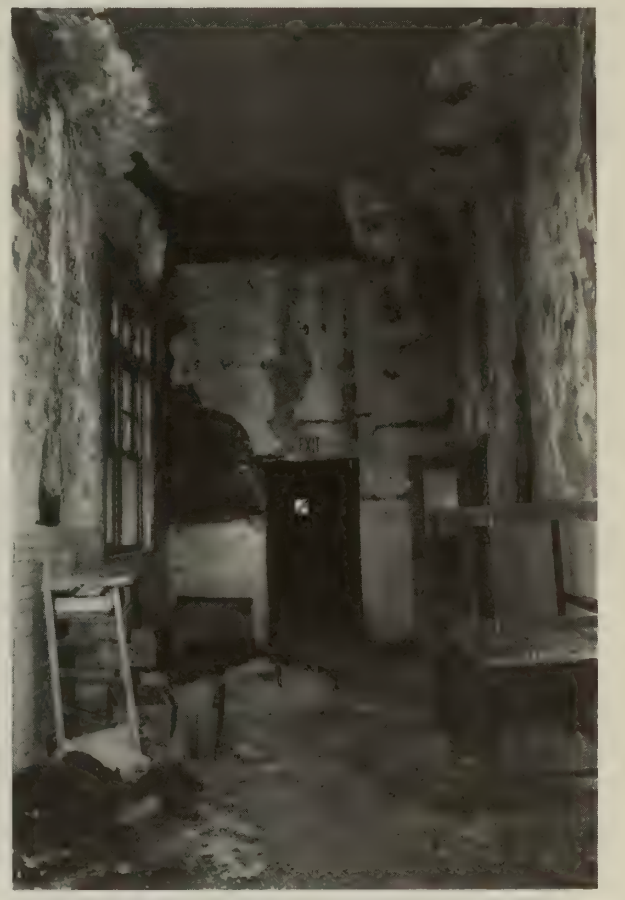

N. DOOR TO B+D BLDG.

PHOTOGRAPHS:

ROOM NO. 301

VIEW N. FROM PARTITION

VIEW S. END

ROOM NO: 301A LAST KNOWN USE: ELEC. RM. SQUARE FEET: 32. CEILING HEIGHT: 15'-10" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	—
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	ONLY REMAINING PLASTER - ON UPPER W. WALL GALV. WINDOW SURROUND - CORRODED
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	GLAZED VERY CORRODED
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	ELECTRIC (METER PANELS?) BOXES ON E & N WALLS - CORRODED
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	—
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	WOOD LADDER TO ROOF
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1909-1912 ☐ 1913-1923 ☐ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. 301A

VIEW E.

VIEW E.

ELLIS ISLAND EXISTING CONDITION SURVEY CORRIDOR 2 page: 433

ROOM NO: 302 LAST KNOWN USE: SQUARE FEET: 596. CEILING HEIGHT: 15'-10" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Concrete [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	DISCOLORATION
WALLS:	[X] Plaster [X] Gypsum Board N. [ ] Partitions [ ] Other:	[X] Good G.B. [ ] Fair [X] Poor PLASTER [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	E. – BASE COAT + T.C. EXPOSED W. – SMALL PORTION T.C. EXP. AT N. END
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	EXPOSED LATH AT N. END OF W. WALL AND ALONG WINDOWS
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [X] Other: SCREEN – PLY	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	ELEVATOR DOOR – S. END – W. WALL N. – SCREEN
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] Incandescent/Type C [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	2 – C.M. OUTLETS
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[3] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	4 – LEG METAL HOOD OVER RAD. ON W. WALL
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1909-1912 [ ] 1913-1923 [ ] 1924-1938 [ ] 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:

ROOM NO. 302

VIEW N.

VIEW N. FROM MIDWAY

S. WALL

ROOM NO: S01 LAST KNOWN USE: Stairway SQUARE FEET: CEILING HEIGHT: DATE:

DESCRIPTION:

General: Enclosed wood stair to mezzanine level from the first floor with wood handrail mounted to wall.

Floor: Stair steps and landing of wood. Tread has rounded nosing.

Walls: Gypsum board on north and south enclosing walls and plaster finish on the east original wall.

Ceiling: Plastered concrete.

CONDITION:

Floor: Wood appears to be sound.

Walls: Peeling paint.

Ceiling: Peeling plaster and paint.

SUMMARY:							
		[X] Good	[ ] 1909-1912	ARCHITECTURAL SIGNIFICANCE:	[ ] Most		
		[ ] Fair	[ ] 1913-1923		[ ] Some		
		[ ] Poor	[ ] 1924-1938		[X] Minor		
		[ ] Destroyed	[ ] 1939-Present		[ ] Negligible		

PHOTOGRAPHS:

ROOM NO. 501

VIEW FROM TOP OF STAIR — MEZZANINE LEVEL

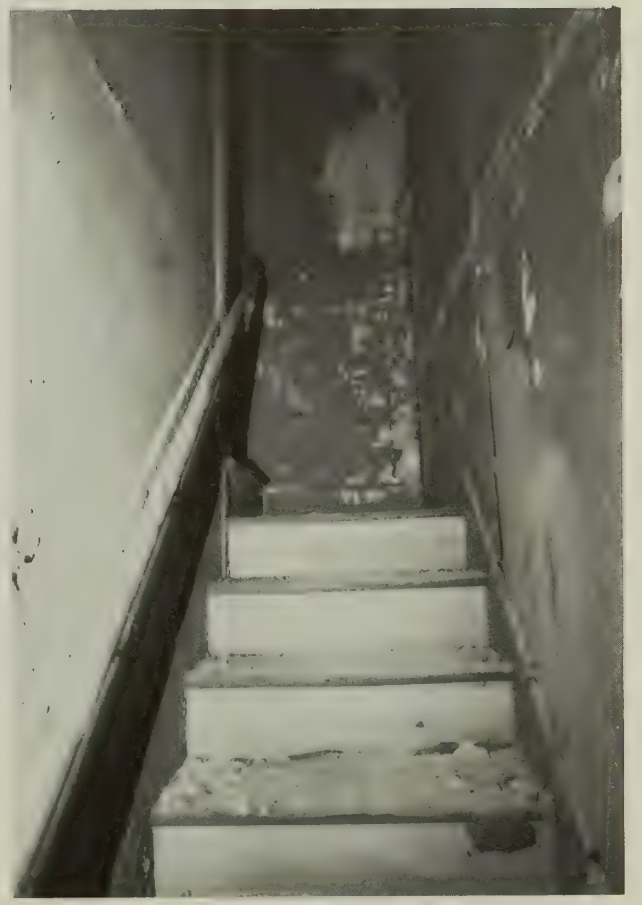

VIEW E.

Exhibit 3

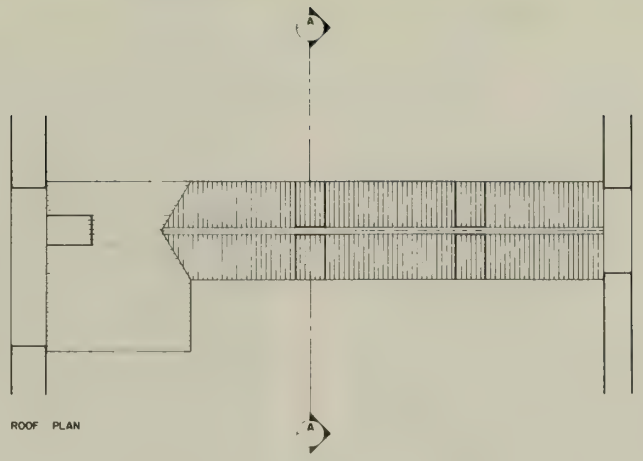

ROOF PLAN

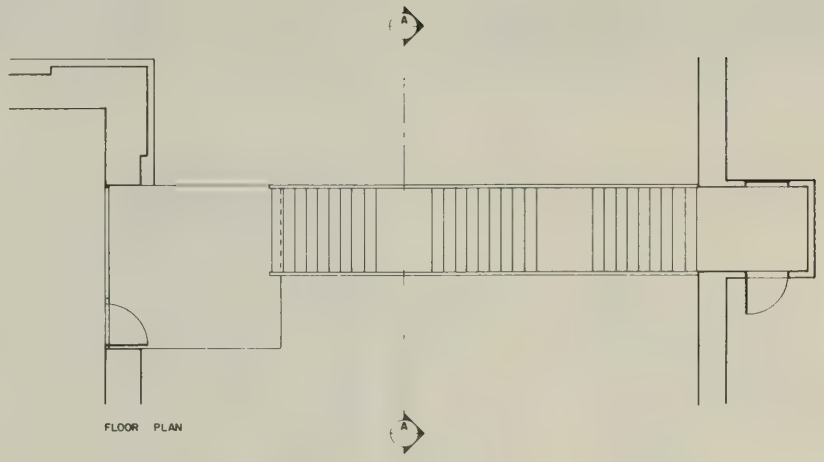

FLOOR PLAN

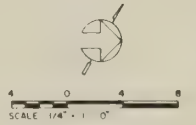

4 0 4 8
SCALE 1/4" = 1' 0"

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3980

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | apvl | REVISIONS | date | by

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN



TITLE OF SHEET
CORRIDOR 3
PLANS

SUB SHEET NO | DRAWING NO

PKG NO | SHEET OF

ROOM NO: C-3 LAST KNOWN USE: SQUARE FEET: CEILING HEIGHT: DATE:

General:

This exterior stairway extends across the courtyard from the south wall of room 201 of the baggage and dormitory building to the first floor of the main building. Two steel I-beams on concrete piers support the steel channel stringers with thirty risers and twenty-seven diamond plate treads. Two concrete landings, in addition to the bottom concrete landing platform, break the stair into three runs. The gable roof with light angle framing and the sides of the stair were originally covered with corrugated copper sheathing. The roof sheathing and flashing is intact with the exception of a section missing in the shed roof over the first floor platform, though none of the side sheathing is intact.

The stair received natural light at each landing through a six-over-three-light pivotal copper steel sash window on either side and a pair of skylights. The latter originally had 1/4" corrugated wire glass, which has been replaced by corrugated fiberglass. Two windows exist on either side of the first floor landing, an eight-over-four and a six-over-three pivoted metal sash window.

An electrical conduit feeds three bulb sockets along the central beam.

Condition:

All steel elements are corroded and steel windows are severely deteriorated. The only serious corrosion is at the top of the bottom flange of the channel stringers at the intermediate platform. Most of the wire glass panes are cracked or broken and the skylight replacements merely lay over the existing copper roofing. The top right-hand section of the 2-1/4" oak double handrails is missing over the first run.

SUMMARY:					ARCHITECTURAL SIGNIFICANCE:	
		[ ] Good				[ ] Most
		[ ] Fair				[ ] Some
		[X] Poor		1924		[X] Minor
		[ ] Destroyed				[ ] Negligible

PHOTOGRAPHS:

ROOM NO. C-3

VIEW OF STAIR FROM C-2-E.

VIEW OF ENTRY FROM MAIN BLDG.

VIEW E.

356 | 26,006 / 29 of 34
DSC | JUL 88

Exhibit 1

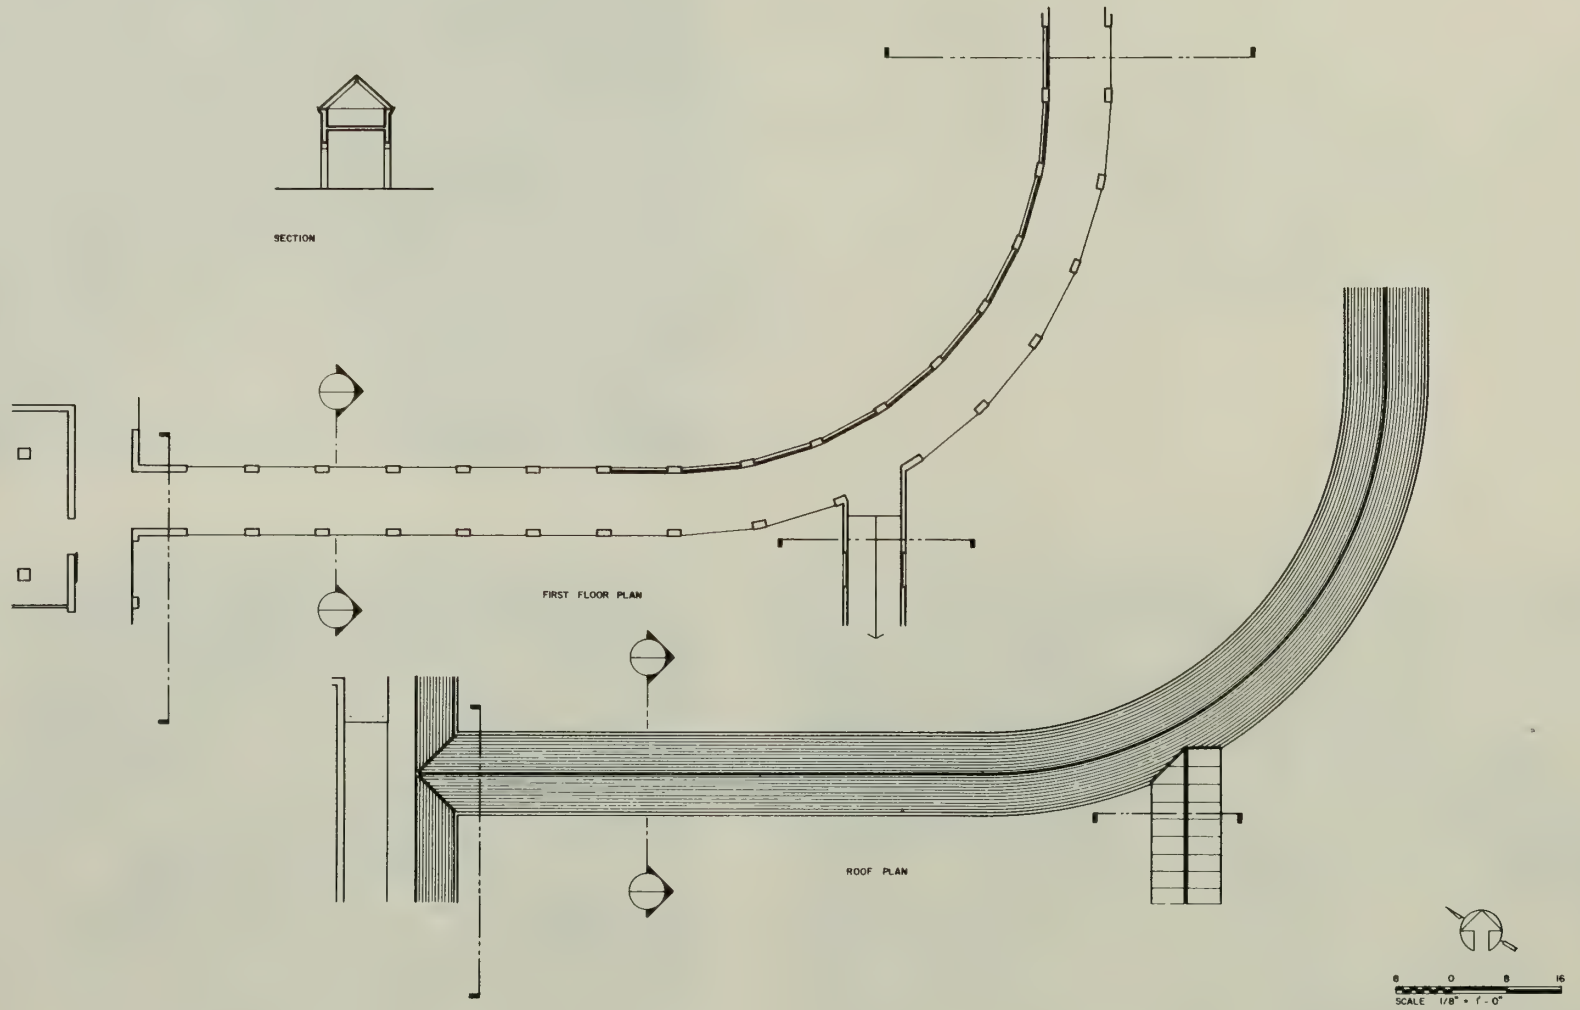

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE / ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-2860

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk	sht	REVISIONS	date	ml

DESIGNED: | DATE:
DRAWN: | TECH REVIEW:

KEY PLAN

TITLE OF SHEET
CORRIDOR 4

SUB SHEET NO. | DRAWING NO.

PKG. NO. | SHEET OF

ROOM NO: LAST KNOWN USE: passageway SQUARE FEET: 1,956 CEILING HEIGHT: 8'-1" DATE: 9/11/84

DESCRIPTION:

General:

Covered way 4 forms an arc from the baggage and dormitory building to covered way 5. At the north end it joins a 1-1/2-story arched entrance at the southwest corner of the baggage and dormitory building. At the west end the passage connects with the northern end of covered way 5. A section of the arcade on the west side has been filled in with brick, slightly recessed from the exterior surface. The flooring is concrete.

The gable roof framing is wood plank spanning from a center steel ridge beam to the exterior walls. The plywood-formed concrete ceiling slab was installed in 1934. The overhead pipe space above this ceiling contained electrical conduit, supplying power to the baggage and dormitory building from the powerhouse. No piping presently exists.

Condition:

The ceiling slab has many transverse cracks with evidence of some water leakage. Brick cracking occurs in the east and west walls near the baggage and dormitory end. The brick infill of one of the west arches has a wide vertical crack where the wall is bulging inward.

SUMMARY:						ARCHITECTURAL SIGNIFICANCE:	
			Good				Most
		X	Fair		1909	X	Some
			Poor				Minor
			Destroyed				Negligible

PHOTOGRAPHS:

ROOM NO.

VIEW E. FROM W. END

VIEW NE

VIEW S NEAR B+D BLDG.

PHOTOGRAPHS:

ROOM NO.

VIEW N. INTO B+D BLDG.

WEST WALL INFILL

Exhibit 8

EXISTING CONDITIONS

GOOD
FAIR
POOR
DESTROYED

356 | 26,006 / 30 of 34
DSC | JUL 88

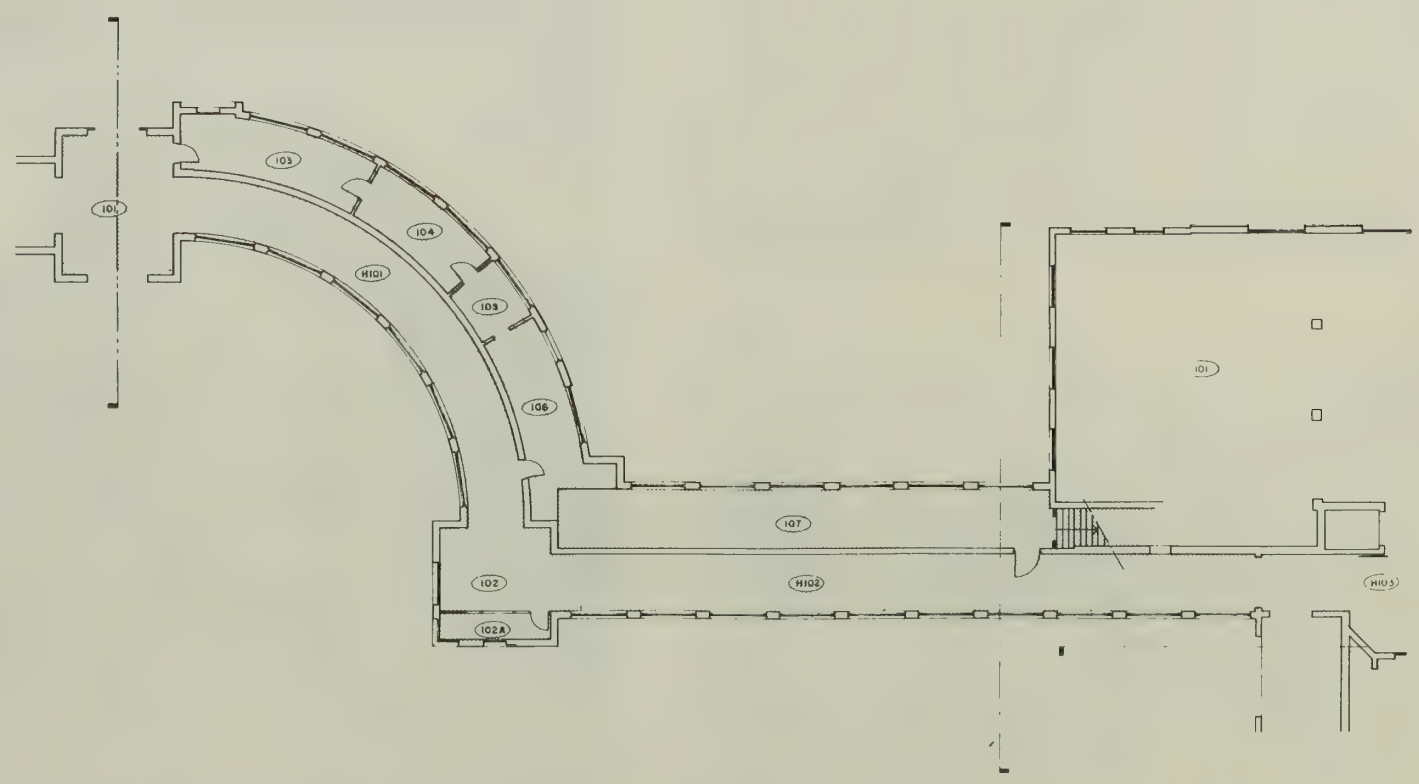

SCALE 1/8" = 1'-0"

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3980

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND

STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | sht | REVISIONS | date | vd

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
CORRIDOR 5
FIRST FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET
OF

Exhibit 6

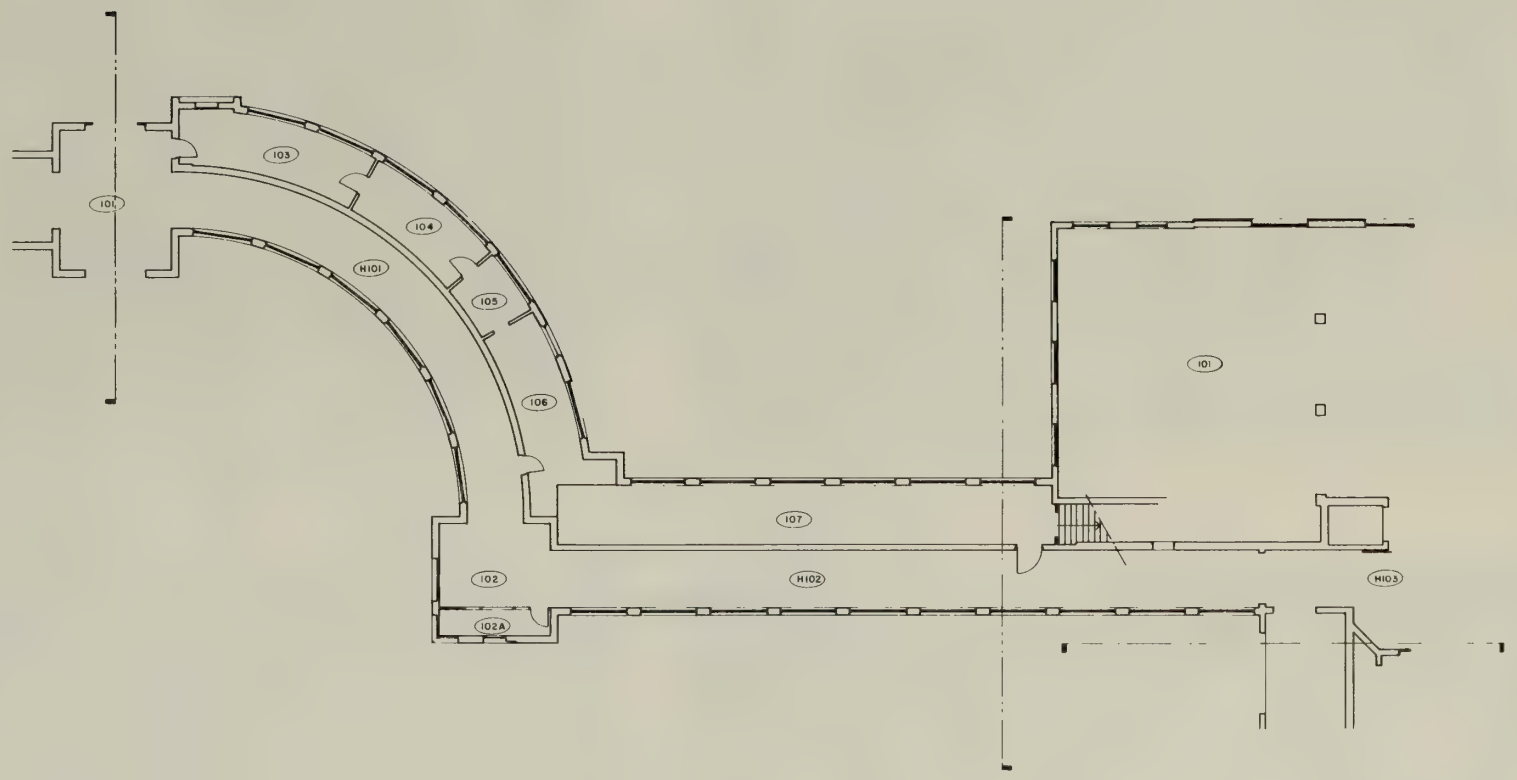

SCALE 1/8" = 1'-0"

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BETEN BLUMER BELLE /
ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | drn | REVISIONS | date | ini

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
CORRIDOR 5
FIRST FLOOR PLAN

SUB SHEET NO | DRAWING NO
PKG NO | SHEET
OF

ELLIS ISLAND EXISTING CONDITION SURVEY COVERED WAY 5 page: 446

ROOM NO: 101 LAST KNOWN USE: PAVILION SQUARE FEET: 320. CEILING HEIGHT: 8'-1" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 '35 ☐ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 PART N. ☐ 1939-Present	PP - DISCOLOR. - S. - WATER WASHING FROM CEILING
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	EXPOSED RE-BARS CONCRETE SPALLING
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE OPENINGS IN ALL 4 WALLS
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	1 - C.M.L.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO.

VIEW N.W.

VIEW N.E.

VIEW S.

VIEW. E.

ELLIS ISLAND EXISTING CONDITION SURVEY COVERED WAY 5 page: 448

ROOM NO: 102 LAST KNOWN USE: PAVILION SQUARE FEET: 192. CEILING HEIGHT: 8'-1" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	PAINTED ON E. WALL
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present E	CEMENT PLASTER - E. w/ WINDOWS S. - WOOD INFILL IN OPENING w/ 4 LT. CASEMENT WINDOW
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	E. - TO 102A 3 LT. / 1 WOOD PANEL C) 1 MISSING
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	1 PORCELAIN-MT. BULB w/ WIRE GUARD
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	—
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 102

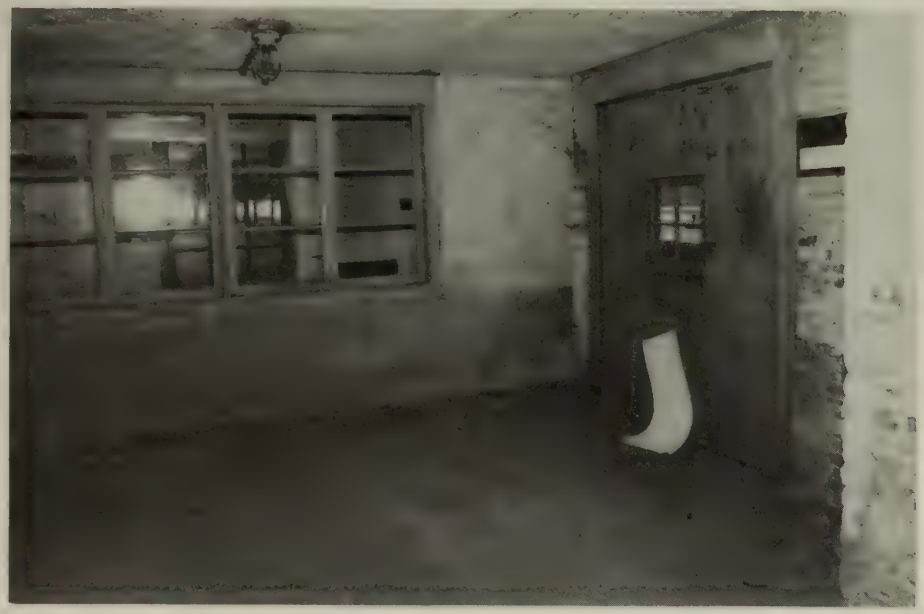

VIEW SE

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY COVERED WAY 5 page: 450

ROOM NO: 102A LAST KNOWN USE: SQUARE FEET: 58. CEILING HEIGHT: 8'-1" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	—
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	SOME FLAKING W. WALL - 2 PAIRS CASEMENT WINDOWS - BELOW - CEMENT PLASTER
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ? ☐ 1939-Present	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	(3 LT./1 WD. PANEL 1 MISSING
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	E. WALL
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 102A

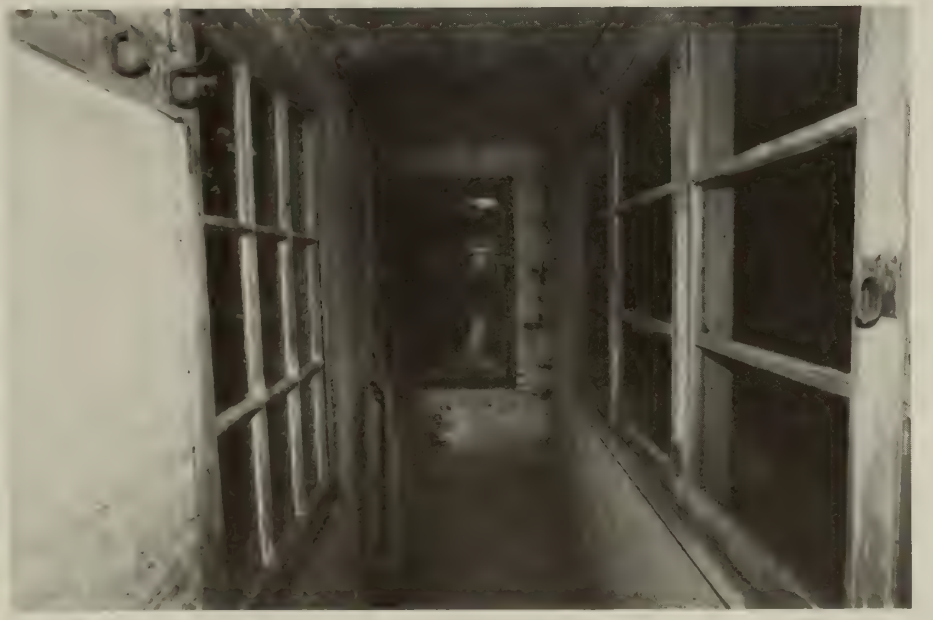

ELLIS ISLAND EXISTING CONDITION SURVEY — COVERED WAY 5 — page: 452

ROOM NO: 103 LAST KNOWN USE: SQUARE FEET: 204. CEILING HEIGHT: 8'-1" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	—
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	PP CEMENT PLASTER - N. W. - WINDOWS DESTROYED
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	PP
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	1 - N. - UPPER LT. MISSING/2 WD. PAN. 1 - S. - "
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	2 - RLM-TYPE - WHITE METAL - BLUE GLOBE
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	- 1 - S. 1 - W.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 103

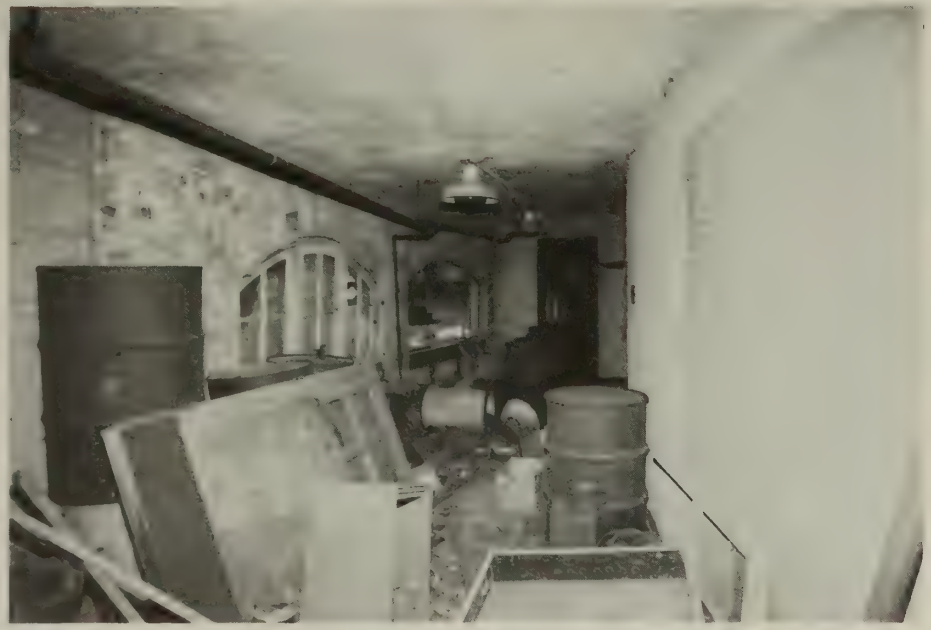

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY COVERED WAY 5 page: 454

ROOM NO: 104 LAST KNOWN USE: SQUARE FEET: 144. CEILING HEIGHT: 8'-1" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	CEMENT PLASTER - N & S SCALING
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	N.- VENEER S.- 1 LT./(MISSING) 1 PANEL
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact 1 Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	1- RLM TYPE - WHITE METAL
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	W.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 104

VIEW N.

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY COVERED WAY 5 page: 456

ROOM NO: 105 LAST KNOWN USE: SQUARE FEET: 64 CEILING HEIGHT: 8'-1" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
WALLS:	☒ Plaster N.S. ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	CEMENT PLASTER - N.S.
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	S. - VENEER PANELED
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed 1 Intact 2 Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	N.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 105

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY COVERED WAY 5 page: 458

ROOM NO: 106 LAST KNOWN USE: STORAGE SQUARE FEET: 208. CEILING HEIGHT: 8'-1" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	DEBRIS
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	—
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	E. - T.C. BLOCK
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	1 PANEL/2
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	CONDUIT-MOUNTED SOCKETS
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	W.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 106

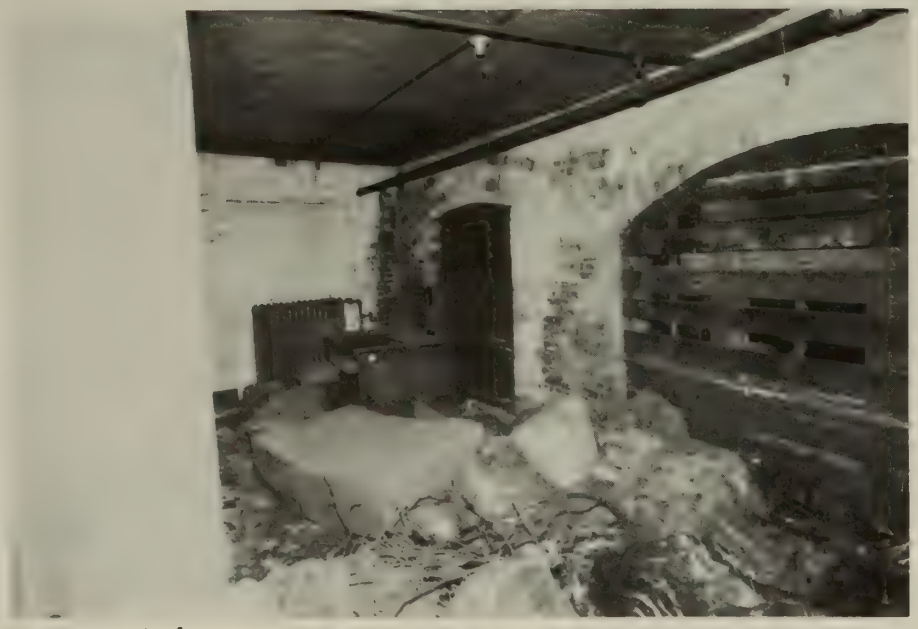

VIEW W.

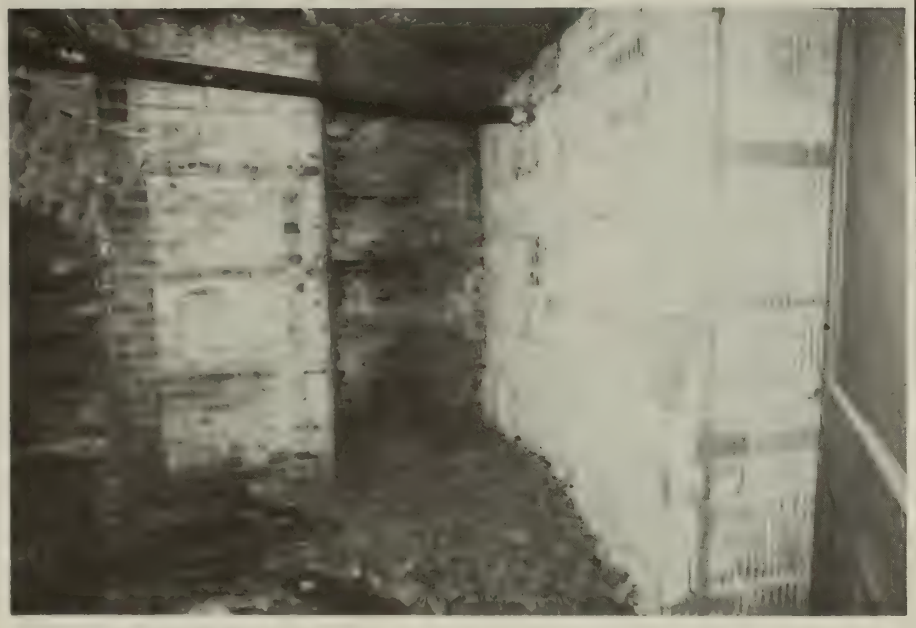

VIEW N.

ELLIS ISLAND EXISTING CONDITION SURVEY COVERED WAY 5 page: 460

ROOM NO: 107 LAST KNOWN USE: SQUARE FEET: 568. CEILING HEIGHT: 8'-1" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☒ 1939-Present N.	N. - WOOD INFILL W/ DR. TO STAIR
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	SOME CRACKS
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☒ 1939-Present N.	N. - WIRE GLASS / WD. PANEL E. - 6 LT. / WOOD PANEL
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	2 - C.M. SOCKETS
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☒ Vents (Fans) ☐ Sink/Toilet/Urinal ☐ Other:	1 ☐ Intact ☐ Destroyed 1 ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☒ 1939-Present	W. FAN MTED TO WALL - E.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	ALL WINDOWS - OUT
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. 107

VIEW N.

VIEW N.

VIEW S.

ELLIS ISLAND EXISTING CONDITION SURVEY COVERED WAY 5 page: 462

ROOM NO: H101 LAST KNOWN USE: PASSAGE SQUARE FEET: 536. CEILING HEIGHT: 8'-1" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	—
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 E. ☐ 1908-1923 ☒ 1924-1938 '35-W. ☐ 1939-Present	
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	NEW SLAB IN '35
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	NONE
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	3-C.M.L.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	—
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. H101

VIEW ~~E~~ TOWARD PAVILION 102

ELLIS ISLAND EXISTING CONDITION SURVEY COVERED WAY 5 page: 464

ROOM NO: H102 LAST KNOWN USE: HALLWAY SQUARE FEET: 812. CEILING HEIGHT: 8'-1" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	1 TRANSVERSE CRACK
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	—
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 W. ☐ 1939-Present	PAINTED FLAKING ON E. W- 1935 ± WINDOW INFILL ON E.
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	1 CROSS-CRACK IN SLAB 1 OPEN ACCESS HOLE TO PIPE SPACE ABOVE CEILING SLAB
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	W. - WOOD DR. W/ 6 LTS. N. - DOUBLE DR. - 3 WD. PANELS @
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	3-C.M.L. W/ WIRE GUARDS
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	—
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	LETTERS OVER DR. TO RM. 107- "CP103"
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. H102

VIEW N.

VIEW S.

VIEW S.

ELLIS ISLAND EXISTING CONDITION SURVEY COVERED WAY 5 page: 466

ROOM NO: H103 LAST KNOWN USE: PASSAGE SQUARE FEET: 855. CEILING HEIGHT: 8'-1" DATE: 8/23/84

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Concrete ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ? ☐ 1939-Present	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	—
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Partitions ☒ Other: BRICK	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☒ 1939-Present	2 ARCH OPENINGS W/ HORIZONTAL WOOD INFILL - EACH W/ WINDOW OPENING CUT IN
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other CONCRETE	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☒ 1924-1938 ? ☐ 1939-Present	WATER STAINS NEW SCABS?
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1907 ☒ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	N.- DOUBLE POWERHOUSE - 4 LT./2 WD. PANEL SLIDING G.M. FREIGHT DRS. - 2 - W. 1 - E. 2 G.M. SOLID - W. S. - DOUBLE - 8 LT. - WD. MULLIONS
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ Incandescent/Type C ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	2 PORCELAIN CEILNG MTS.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	—
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 ☐ 1908-1923 ☐ 1924-1938 ☐ 1939-Present	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1907 - BUILT ☐ 1908-1923 ☒ 1924-1938 ☐ 1939-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS:

ROOM NO. H103

VIEW N.

VIEW N. TO POWERHOUSE ENTRY

VIEW S. - C-4 AT LEFT

PHOTOGRAPHS:

ROOM NO. H103

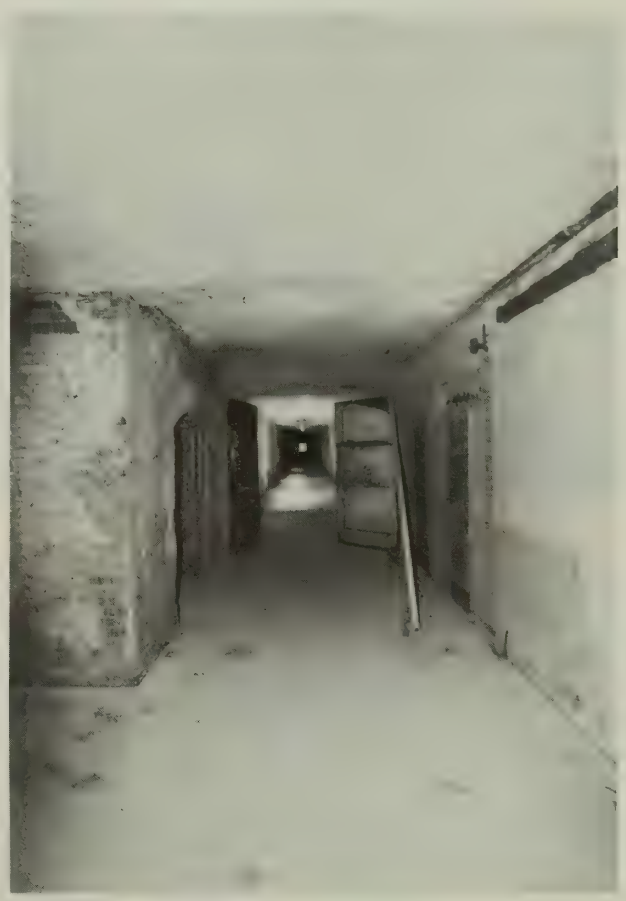

VIEW S.

ROOM NO: S01 LAST KNOWN USE: Stairway SQUARE FEET: CEILING HEIGHT: DATE:

DESCRIPTION:

General: Enclosed stairway built in 1935 at the east side of the bakery and carpentry building and north end of the 1935addition to corridor 5. It provided access to the second floor of the kitchen and laundry building and this top landing was filled in with terra-cotta block during the 1940's.
Pipe handrails are used on both sides of the stair.

Floor: Concrete steps and landing.

Walls: Unpainted brick. One window in the west wall leads onto the roof of the bake oven addition.

Ceiling: Concrete.

CONDITION:

Floor: Good condition.

Walls: Some efflorescence on the north wall. Otherwise good.

Ceiling: Some water discoloration.

SUMMARY:						ARCHITECTURAL SIGNIFICANCE:	
		[X]	Good	[ ]	1900-1907		[ ] Most
		[ ]	Fair	[ ]	1908-1923		[ ] Some
		[ ]	Poor	[X]	1924-1933		[X] Minor
		[ ]	Destroyed	[ ]	1939-Present		[ ] Negligible

PHOTOGRAPHS:

ROOM NO. 501

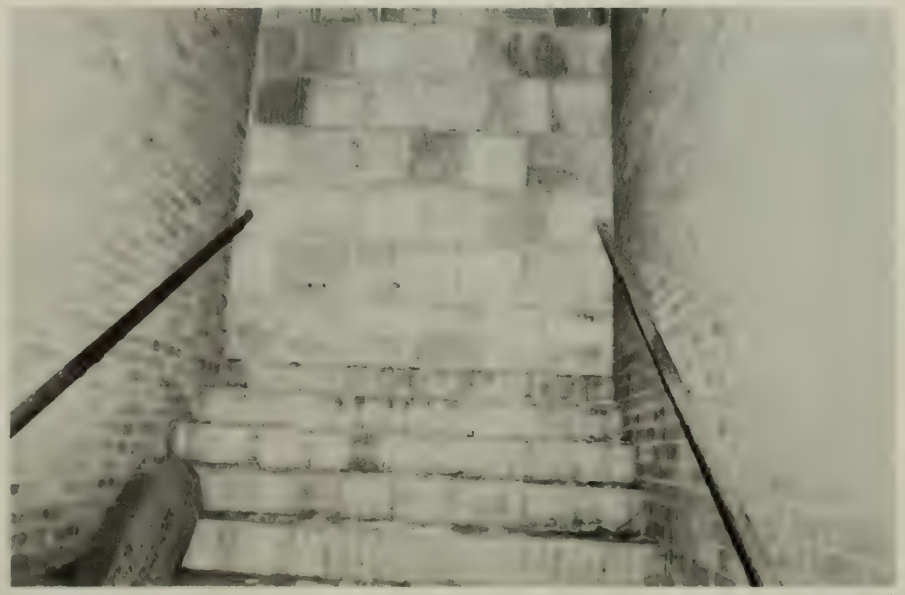

TOP OF STAIR BLOCKED IN K&L BLDG.

ROOM NO: LAST KNOWN USE: SQUARE FEET: CEILING HEIGHT: DATE: 2/3/85

DESCRIPTION:

General: This open room, constructed in 1908, serves as a connecting passage from the main building to the baggage and dormitory building. Temporary wood steps and platform in the southeast corner lead up to the railroad ticket office. A wood railing with overhead protection forms a walkway along the west and part of the south from the door to the main building.

Floor: White hexagonal tile.
Cast-iron manhole along the west wall.

Base: White vitreous tile wainscot on the north, south and west walls.

Walls: Plaster on terra cotta block on north, south and west walls. East wall is the exterior wall of the railroad ticket office and has cast-iron Tuscan columns above molded copper panels. Two fiberboard partitions with wood trim form an office in the northeast corner.

Ceiling: Plaster and lath on hung metal frame.

Doors/Openings: Wood veneer to office in northeast corner. Wood double door in south wall and at entry to room 104 (baggage and dormitory building). Wood and glass paneled double door at north end.

Floor: Fair condition. Areas of patching and cracking. Probe holes cut through the slab at several locations.

Base: Poor condition. Wainscot is buckled in the northeast corner with sections missing on the south wall.

Walls: The plaster of all walls is almost entirely destroyed with exposed terra-cotta block. The copper panels and columns of the east wall are intact though surface corroded and the original window glass above the panels has been removed.

Ceiling: Very poor condition. Frame and lath is exposed around the perimeter and large areas of plaster have fallen off.

Doors/Openings: Fair condition.

SUMMARY:						ARCHITECTURAL SIGNIFICANCE:	
			Good		1909		Most
			Fair				Some
		X	Poor			X	Minor
			Destroyed				Negligible

PHOTOGRAPHS: (DESCRIPTION CONT.) **ROOM NO.** C-6

Lighting: Two RLM-type fixtures ceiling suspended on chains with white enamel finish on shades.

Heating/
Ventilation/
Plumbing: Two intact radiators on the west wall. One wall-mounted sink with back splash (c. 1940's) located on the north wall.

Lighting: Edges corroded.

PHOTOGRAPHS: ROOM NO.

VIEW S.E.

VIEW SW

NE CORNER - OFFICE PARTIONS 4-7-73

PHOTOGRAPHS:

ROOM NO.

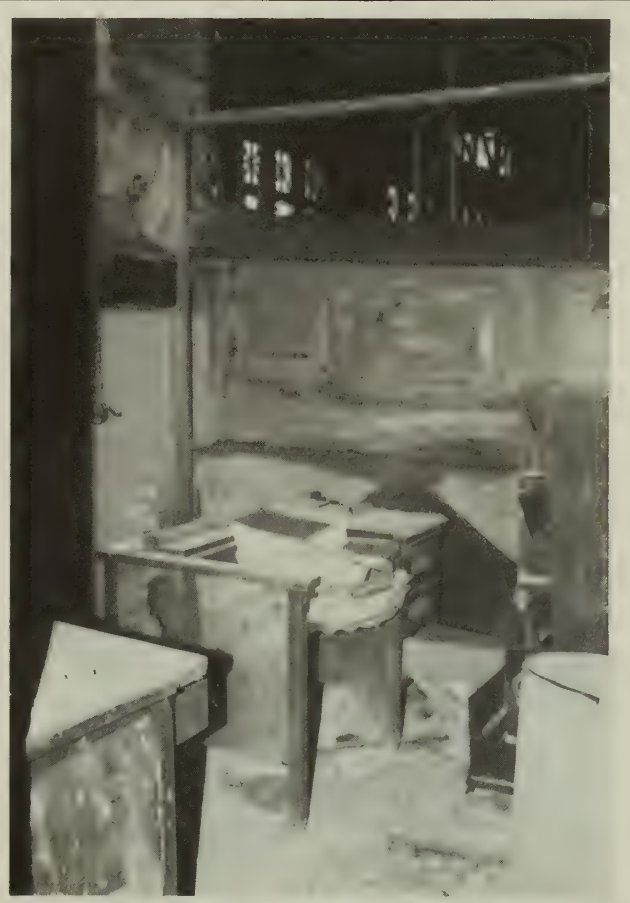

N.E. CORNER – INSIDE OFFICE.

FREE-STANDING BUILDINGS

356 | 26,006 / 32 of 34
DSC | JUL 88

Exhibit 6

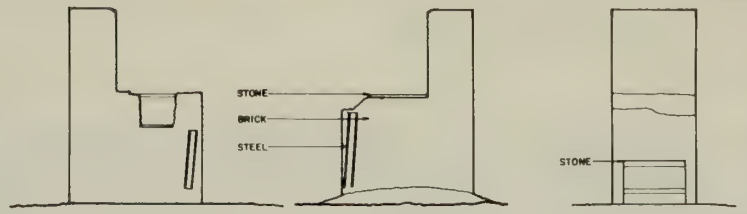

FURNACE WEST ELEVATION EAST ELEVATION SOUTH ELEVATION

SEA WALL

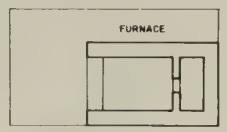

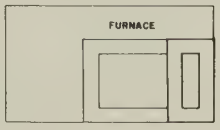

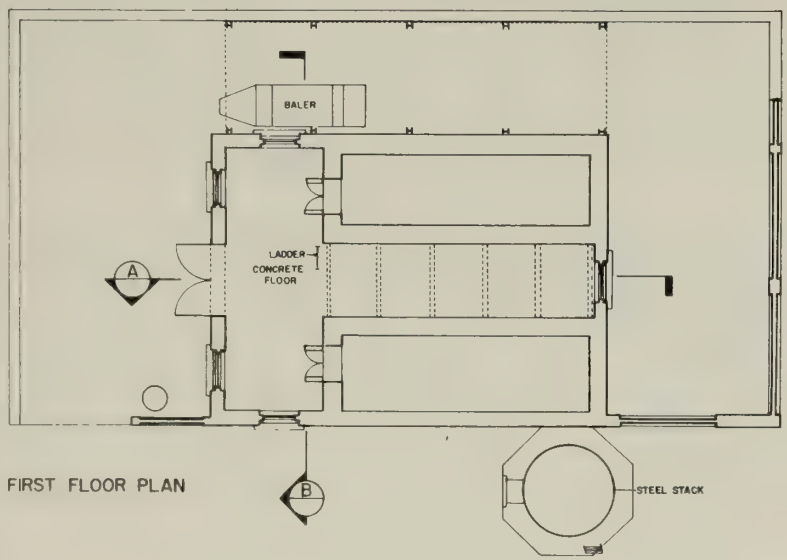

FIRST FLOOR PLAN

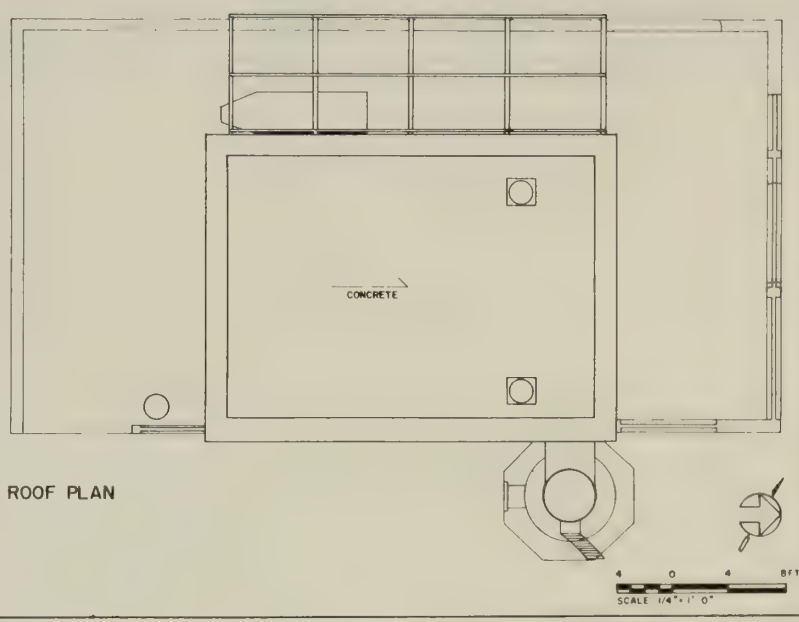

ROOF PLAN

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE / ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3660

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk	dtr	REVISIONS	date	by

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
INCINERATOR PLANS
FURNACE ELEVS.

SUB SHEET NO | DRAWING NO
PKG NO | SHEET OF

ROOM NO: (1 rm.) LAST KNOWN USE: incineration SQUARE FEET: 841 CEILING HEIGHT: 15'8" DATE: 2/8/85

DESCRIPTION:

General:

The interior consists of a narrow passage between the two incinerators along the east and west walls and a small loading space along the south end of the incinerators. An iron ladder at the south end provides access to the cast-iron charging platform and the tops of the incinerators. The floor is concrete slab and the walls and ceiling are parged concrete flush with the exposed bottom flange of steel beams. One circular hole in the ceiling over each incinerator marks the location of the flues.

The incinerators have cast-iron fronts, each with two doors and white glazed brick facing on the side walls, each with eight cast-iron firing doors and fire brick on the interior cavities.

Condition:

All metal surfaces are heavily corroded and pitted. Concrete parging has peeled away in areas. The white glazed brick exhibits iron staining, cracking and spalling.

SUMMARY:							
		[ ] Good [ ] Fair [X] Poor [ ] Destroyed		1911	ARCHITECTURAL SIGNIFICANCE:	[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: 477 **ROOM NO.**

VIEW N.

VIEW N. ABOVE TO CHARGING PLATFORM

PHOTOGRAPHS: ROOM NO.

WESTERN INCINERATOR - VIEW N.

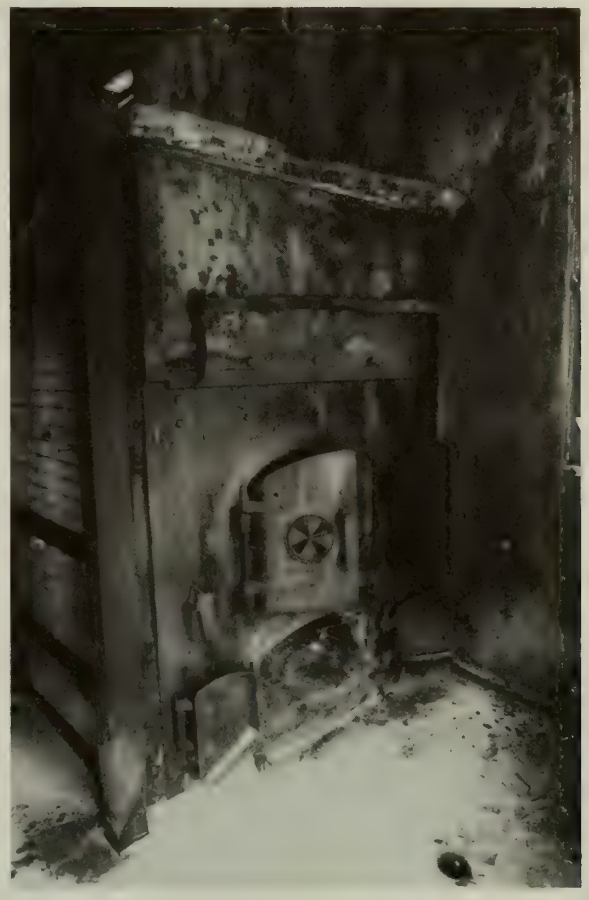

EASTERN INCINERATOR - VIEW N.

356 | 26,006 / 33 of 34
DSC | JUL 88

Exhibit 3

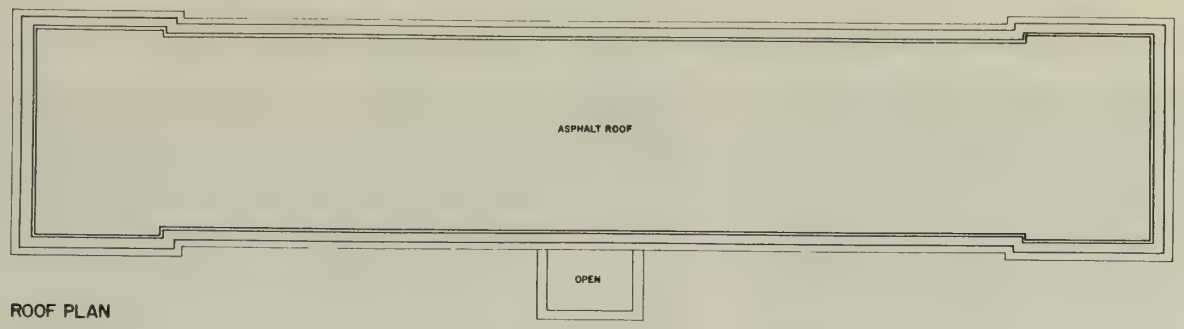

ROOF PLAN

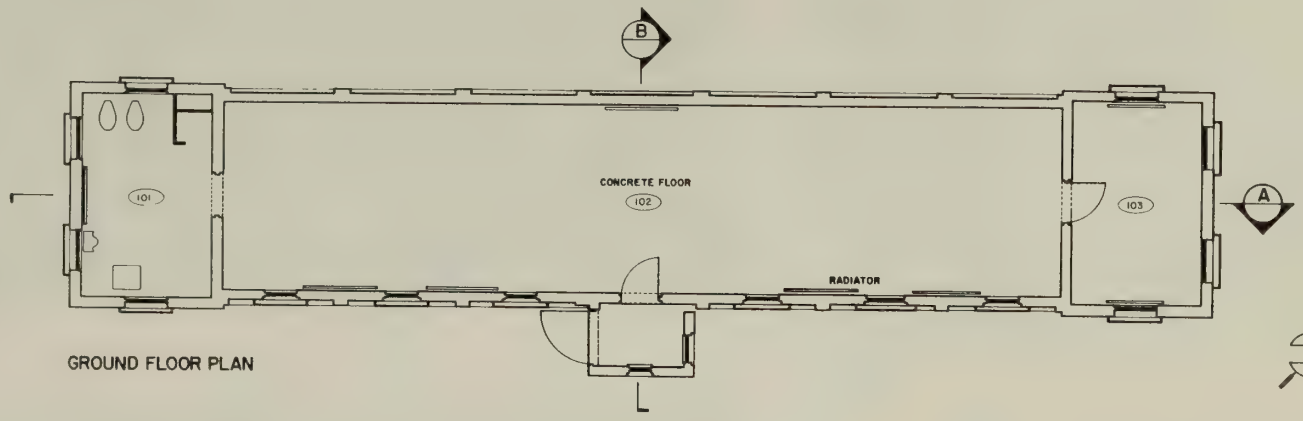

GROUND FLOOR PLAN

SEAWALL

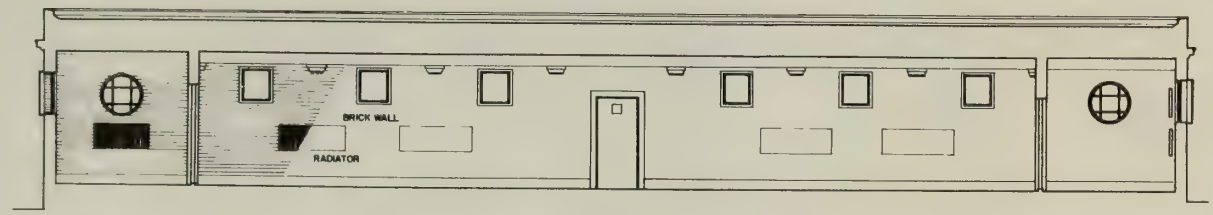

SECTION A

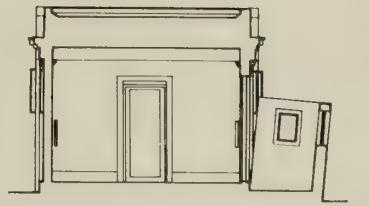

SECTION B

4 0 4 8 FT
SCALE 1/4"=1'-0"

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE / ANDERSON NOTTER FINEGOLD
80 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk	apl	REVISIONS	date	ap

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY PLAN

TITLE OF SHEET
SHELTER BUILDING PLANS & SECTIONS

SUB SHEET NO | DRAWING NO
PKG NO | SHEET OF

ROOM NO: 101-103 LAST KNOWN USE: Detention SQUARE FEET: 1,078 CEILING HEIGHT: 9'-6" DATE: 9/11/84

DESCRIPTION:

General: The interior consists of two small rooms (rooms 101 and 103) on either side of a long narrow narrow room (room 102). The single entry is at the center of the east wall.

Floor: Scored concrete in all rooms.

Base: None in room 102, 5-1/2" concrete base in rooms 101 and 103.

Walls: Painted brick, room 102. Plaster on terra-cotta block, rooms 101 and 103.

Ceiling: Concrete, room 102. Plaster, rooms 101 and 103.

Doors/Openings: Entry door of wood with small opening. Galvanized metal door to room 103.

Lighting: Ceiling mount lamps with metal plates and porcelain sockets.

Heating/
Ventilation/
Plumbing: Wall mounted radiators; room 101-2, room 102-4 on east wall, 1 on west, room 103-2. Room 101 has two toilets, one urinal, two sinks, one aluminum enclosed shower with wood slat floor.

Floor: Good condition.

Base: Good condition.

Walls: Brick- peeling paint and minimum spalling on base of west wall. Plaster- poor condition. Exposed terra-cotta in room 103 on north and east walls and spalling occurs elsewhere.

Ceiling: Fair condition. Exposed lath in northwest corner of room 103 and surface spalling in room 101. Concrete ceiling is good.

Doors/Openings: Galvanized door is surface corroded, missing hardware. Entry door is missing hardware. Door to room 101 is missing.

Plumbing: One urinal destroyed.

SUMMARY:						ARCHITECTURAL SIGNIFICANCE:	
			Good		1935		Most
		X	Fair				Some
			Poor			X	Minor
			Destroyed				Negligible

PHOTOGRAPHS:

ROOM NO. 102

VIEW S.

VIEW N.

E. WALL

PHOTOGRAPHS: ROOM NO.

ROOM 101 - VIEW E.

ROOM 101 - VIEW W.

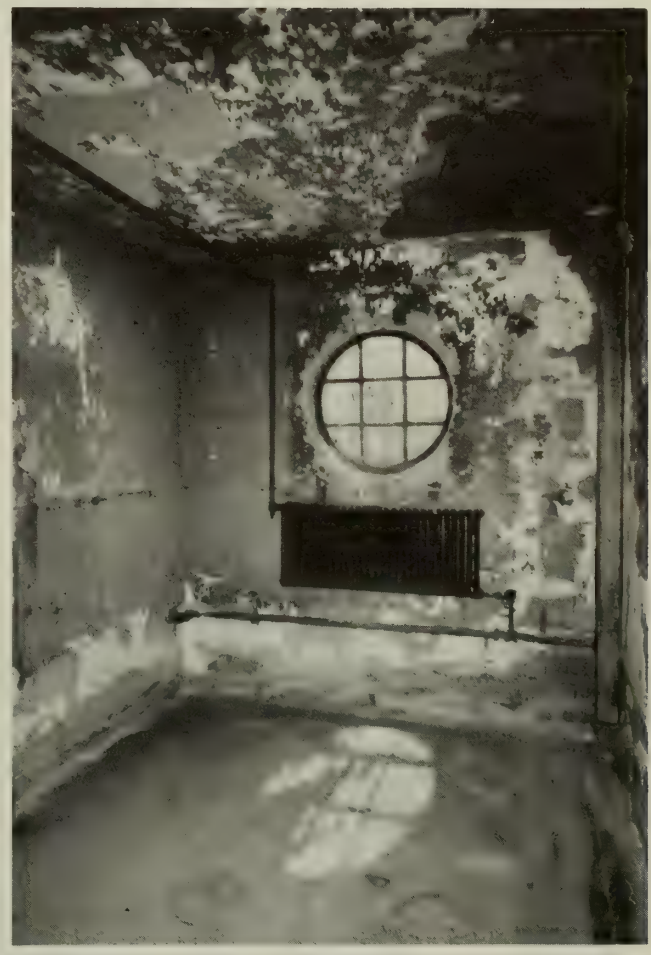

ROOM 103 - VIEW W.

Exhibit 2

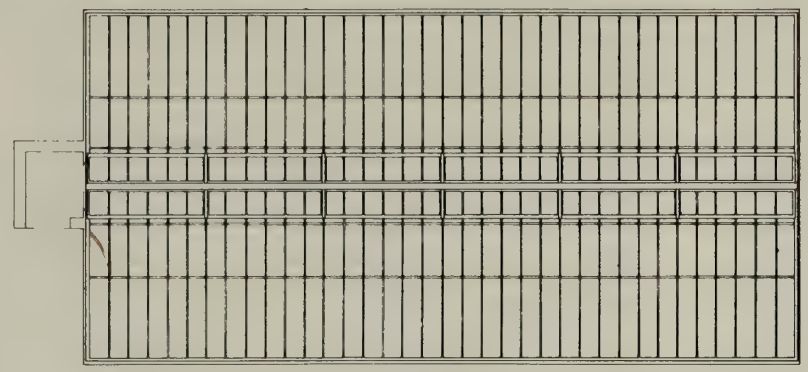

ROOF PLAN

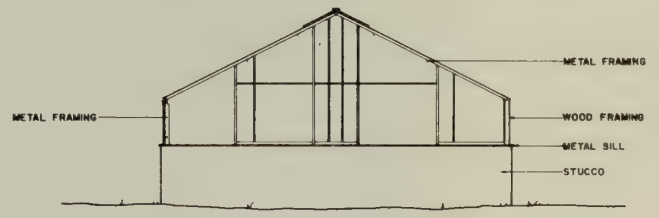

NORTH ELEVATION

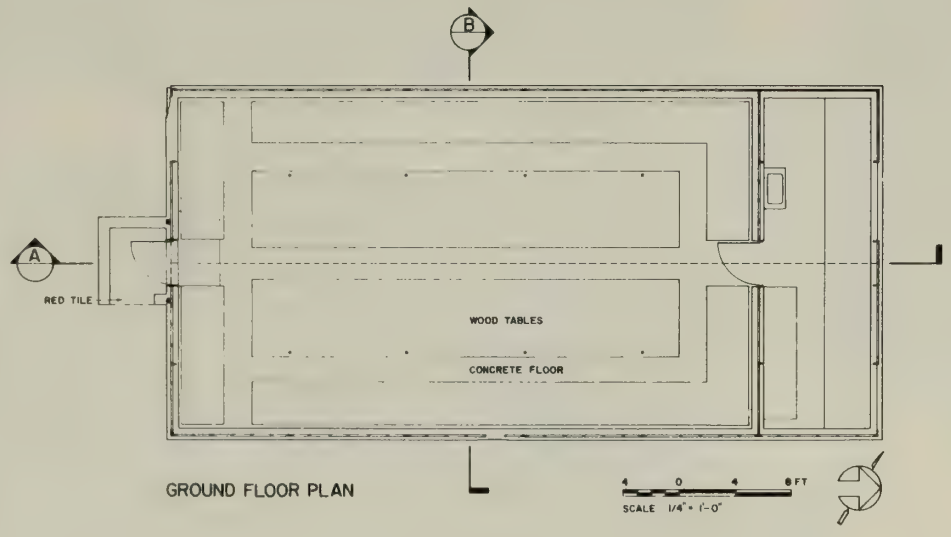

GROUND FLOOR PLAN

SOUTH ELEVATION

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
ANDERSON NOTTER FINEGOLD
50 FIFTH AVENUE
NEW YORK, NY 10114
(212) 741-3960

SURVEY OF STRUCTURES UNIT ONE

ELLIS ISLAND
STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk	dpt	REVISIONS	date	by

DESIGNED: | DATE:
DRAWN: | TECH REVIEW:

KEY PLAN



TITLE OF SHEET
GREENHOUSE
PLANS ELEVATIONS

SUB SHEET NO | DRAWING NO

PKG NO | SHEET
OF

ROOM NO: LAST KNOWN USE: Plant Propagation SQUARE FEET: 1,159. CEILING HEIGHT: Ridge: 12'-6" DATE: 9/11/84

DESCRIPTION:

General:

This standard greenhouse structure has an angle iron frame, trusses, and pipe columns. Five steel trusses and two longitudinal angle braces support the wood framing for glazing of the gable roof. The plain wood ridge is capped with copper. The top row of the three horizontal bands of roof lights was operable by horizontal bar arms controlled by two wheel cranks at the northern end of the building.

The north and south ends are fifteen lights wide and the east and west sides above the base wall consist of six wood-framed awning windows of six lights each. The wood door on the south end has nine intact upper lights and three wood panels. In front of the entry door is a small square vestibule, with a three foot high concrete wall above a red quarry tile floor.

The flooring of the interior is concrete. Tables consisting of wood frames, pipe legs and metal corners line the perimeter with two long tables down the center. All tabletop surfaces are missing. A narrow room at the north end is formed by a glass wall and doorway. A table is intact along the north and on the south wall is another short table and a basin sink.

Condition:

All metal elements display surface corrosion and all wood framing is weathered and split. Pipe columns are rusted out at the bases. At the northern end, almost all wood framing is missing. The majority of glazing is missing or broken. There is some cracking of the foundation wall at the entry. All framing above the vestibule wall has been destroyed and the weathered door to this vestibule leans against one side.

At the time of this visual survey, the interior was overgrown with plants and shrubs.

SUMMARY:						ARCHITECTURAL SIGNIFICANCE:	
		[ ] Good	[ ]	1935		[ ] Most	
		[ ] Fair	[ ]			[ ] Some	
		[X] Poor	[ ]			[X] Minor	
		[ ] Destroyed	[ ]			[ ] Negligible	

PHOTOGRAPHS:

ROOM NO.

WESTERN SIDE

VIEW N.

PHOTOGRAPHS: ROOM NO.

VIEW N. - DOOR TO END ROOM

N. END ROOM - "POTTING RM."

PHOTOGRAPHS:

ROOM NO.

POTTING RM. — TABLES

VIEW N.W.

BIBLIOGRAPHY
ELLIS ISLAND HISTORIC STRUCTURE REPORT
DOCUMENTATION

Prepared for the U.S. Department of Interior/National Park Service, Denver Service Center
by Beyer Blinder Belle/Notter Finegold Alexander

HISTORIC STRUCTURES REPORTS

Volume 1	The Main Building June 1, 1984	NPS D-41
Volume 2 Part One	Unit One Buildings December 1985	NPS D-42
Volume 2 Part Two	Unit One Buildings December 1985	NPS D-42
Volume 3	Powerhouse December 1985	NPS D-43
Volume 4 Part One	Units 2, 3 and 4 August 30, 1986	NPS D-44
Volume 4 Part Two	Units 2, 3 and 4 August 30, 1986	NPS D-44
Volume 4 Part Three	Units 2, 3 and 4 August 30, 1986	NPS D-44

EXISTING CONDITION SURVEYS

Volume 1 Appendix A	Main Building February 1, 1984	NPS D-41
Volume 2 Appendix D	Unit One Buildings July 1985	NPS D-42
Volume 3 Appendix A	Powerhouse December 1985	NPS D-43
Volume 4 Appendix A Part One	Units 2, 3 and 4 July 1986	NPS D-44
Volume 4 Appendix A Part Two	Units 2, 3 and 4 July 1986	NPS D-44

☆ U.S. GOVERNMENT PRINTING OFFICE: 1988—576-793 REGION NO. 8

As the nation's principal conservation agency, the Department of the Interior has basic responsibilities to protect and conserve our land and water, energy and minerals, fish and wildlife, parks and recreation areas, and to ensure the wise use of all these resources. The department also has major responsibility for American Indian reservation communities and for people who live in island territories under U.S. administration.

Publication services were provided by the graphics staff of the Denver Service Center.
NPS D-42 September 1988